

CONTINUED FROM PRECEDING PAGE

WEATHER DATA SOURCES: AWOS-3P 125.9 (907) 697-2447. (WX CAM)

COMMUNICATIONS: CTAF 122.5

RCO 122.65 (JUNEAU RADIO)

① ANCHORAGE CENTER APP/DEP CON 133.2

RADIO AIDS TO NAVIGATION: NOTAM FILE JNU.

SISTERS ISLAND (H) (H) VORTACW 114.0 SSR Chan 87 N58°10.66' W135°15.53' 297° 20.6 NM to fld. 40/20E.

VOR unusable:

050°-070° byd 12 NM blo 10,000'
 115°-130° byd 32 NM blo 8,000'
 131°-175° byd 25 NM blo 13,000'
 176°-189° byd 35 NM blo 14,000'
 190°-245° byd 30 NM blo 12,000'
 246°-260° byd 18 NM blo 7,000'
 306°-360° byd 21 NM

TAC AZM unusable:

050°-070° byd 12 NM blo 10,000'
 115°-130° byd 32 NM blo 8,000'
 131°-175° byd 25 NM blo 13,000'
 176°-189° byd 28 NM blo 14,000'
 190°-245° byd 30 NM blo 12,000'
 246°-260° byd 18 NM blo 7,000'
 306°-360° byd 21 NM

DME unusable:

050°-070° byd 12 NM blo 10,000'
 115°-130° byd 32 NM blo 8,000'
 131°-175° byd 25 NM blo 13,000'
 176°-189° byd 28 NM blo 14,000'
 190°-245° byd 30 NM blo 12,000'
 246°-260° byd 18 NM blo 7,000'
 306°-360° byd 21 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Juneau FSS dial 1-866-297-2236.

HAINES (HNS)(PAHN) 3 W UTC-9(-8DT) N59°14.63' W135°31.41'

29 B LRA NOTAM FILE HNS

JUNEAU
H-1C, L-1B

RWY 08-26: H4000X100 (ASPH) PCR 40 F/B/X/U MIRL

RWY 08: REIL. PAPI(P4L)—GA 4.0° TCH 57'. Brush. Rgt tfc.

RWY 26: REIL. PAPI(P4L)—GA 4.0° TCH 56'. Brush.

SERVICE: FUEL 100LL, JET A LGT ACTVT REIL Rwy 08 and 26; PAPI Rwy 08 and 26; MIRL Rwy 08-26—CTAF. Rwy 08 PAPI unusbl byd 5 degs left of cntrln.


AIRPORT REMARKS: Unattended. Fuel svc avbl 907-766-3190. Arpt cond not mnt; arpt maint on ireg basis; visual insp rcmd. Rcnd dalgt ops only. Birds, bears, and moose on and invof arpt. Paja onto rwy. Twy and prkg apron NA. Turbulence on NW apch. Clsd to ACR ops with more than 30 pax seats. Arpt clsd to acft over 12500 lbs or more exc PPR—Arpt Safety and Scety; DOT and Pub Fac; P.O. Box 112506; Juneau, AK 99811-2506-907-465-1786. Bluff NW. Narrow apch fm NW. Mtns both sides; turbc on NW apch, Bluff NW. Twy D not mntnd 15 Oct-30 Apr. Rwy 08-26 sand to enhance rwy friction may not meet FAA spec. Safety area 4600 ft x 150 ft; 300 ft gravel safety area each end. Rwy 26 50 ft trees 1000 ft SE. Cold temperature airport. Altitude correction required at or below -18C. Alert: See Genots—ENROUTE CTAF FREQS.

AIRPORT MANAGER: 907-766-2340

WEATHER DATA SOURCES: ASOS 135.7 (907) 766-2519. (WX CAM)

COMMUNICATIONS: CTAF 122.9

RCO 122.6 (JUNEAU RADIO)

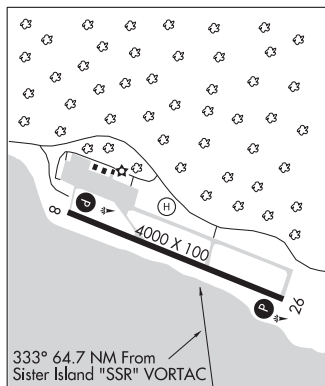

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE JNU.

SISTERS ISLAND (H) (H) VORTACW 114.0 SSR Chan 87 N58°10.66' W135°15.53' 333° 64.7 NM to fld. 40/20E.

VOR unusable:

050°-070° byd 12 NM blo 10,000'

115°-130° byd 32 NM blo 8,000'

131°-175° byd 25 NM blo 13,000'

176°-189° byd 35 NM blo 14,000'

190°-245° byd 30 NM blo 12,000'

246°-260° byd 18 NM blo 7,000'

306°-360° byd 21 NM

TAC AZM unusable:

050°-070° byd 12 NM blo 10,000'

115°-130° byd 32 NM blo 8,000'

131°-175° byd 25 NM blo 13,000'

176°-189° byd 28 NM blo 14,000'

190°-245° byd 30 NM blo 12,000'

246°-260° byd 18 NM blo 7,000'

306°-360° byd 21 NM

DME unusable:

050°-070° byd 12 NM blo 10,000'

115°-130° byd 32 NM blo 8,000'

131°-175° byd 25 NM blo 13,000'

176°-189° byd 28 NM blo 14,000'

190°-245° byd 30 NM blo 12,000'

246°-260° byd 18 NM blo 7,000'

306°-360° byd 21 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Juneau FSS dial 1-866-297-2236.

.

HELIPAD H1: H40X40 (ASPH-CONC)

HANGAR LAKE SPB (See BETHEL on page 61)**HARLEQUIN LAKE** (See YAKUTAT on page 266)**HEALY RIVER** (HRR)(PAHV) O N UTC-9(-8DT) N63°52.06' W148°58.13'

1275 B NOTAM FILE FAI

RWY 15-33: H2910X60 (ASPH) MIRL 0.6% up SE**RWY 15:** Trees. Rgt tfc.**RWY 33:** Trees.

SERVICE: FUEL 100LL, JET A **LGT** ACTVT MIRL Rwy 15-33—CTAF.
AIRPORT REMARKS: Unattended. Full service Av Gas and Jet A fuel available during normal business hours May to September and by call out year round and after hours. Call out fee may apply, call 907-683-2359. Rwy condition not monitored, recommend visual inspection prior to landing. Rwy 15-33 numerous cracks in asph with weeds and grass growing through sfc up to 12" tall. Turbulent winds invof arpt. RR tracks 700' fm thld 20' above rwy elev. Arpt 2 SM southwest of Usibelli Mine. Segmented circle 400' from Rwy 33 thld 200' left of centerline. Rwy 15-33 nstd markings: thld marked with panels, cones and lgts. Cold temperature airport. Altitude correction required at or below -14C.

AIRPORT MANAGER: 907-451-5280**COMMUNICATIONS:** CTAF 122.9

RCO 122.4 (FAIRBANKS RADIO)

® **ANCHORAGE CENTER APP/DEP CON** 120.9**RADIO AIDS TO NAVIGATION:** NOTAM FILE ENN.**NENANA (H) (H) VORTACW** 115.8 ENN Chan 105 N64°35.40' W149°04.37' 155° 43.6 NM to fld. 1601/21E.

VOR unusable:

086°-096° byd 34 NM blo 5,000'

097°-105°

310°-335° byd 33 NM blo 5,000'

336°-360° byd 33 NM blo 4,000'

TAC AZM unusable:

097°-105°

DME unusable:

097°-105°

COMM/NAV/WEATHER REMARKS: For a toll free call to Fairbanks FSS dial 1-866-248-6516.

ANCHORAGE

H-1B, 2K, L-3D

IAP

