

**MEYERS CHUCK SPB** (84K) 0 W UTC-9(-8DT) N55°44.38' W132°15.30'

KETCHIKAN

00 NOTAM FILE KTN

**WATERWAY NW-SE:** 7000X200 (WATER)

**SEAPLANE REMARKS:** Unattended. Small protected landing area in main chuck, back channel narrow. Large rocks above water in touchdown zone during low tides. Approximately 2,500' from SPB float. Entire SPB/boat float in poor condition and sinking. Small SPB float. Dock. Boats may be tied to SPB float. Large rock 100' N of SPB float. Small harbor. Large rocks/reefs at entrance, swells on northerly, SE winds require takeoff to head of bay.

**AIRPORT MANAGER:** (907) 874-3736

**COMMUNICATIONS:** CTAF 122.9


**RADIO AIDS TO NAVIGATION:** NOTAM FILE KTN.

**CLAM COVE NDB (HW)** 396 CMJ N55°20.53'  
W131°41.45' 300° 30.7 NM to fld. 46/21E.

NDB unusable:

Byd 15 NM

**COMM/NAV/WEATHER REMARKS:** LC to Ketchikan FSS dial 225-9481. For a LC to Juneau FSS dial 789-7380.

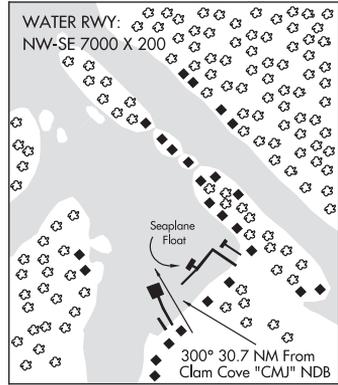

**MIDDLETON ISLAND** (MDO)(PAMD) 1 S UTC-9(-8DT) N59°27.00' W146°18.43'

SEWARD

100 NOTAM FILE MDO

L-1A, 2I, 3E

**RWY 02-20:** 3158X115 (GRVL)

**RWY 02:** Road.

**RWY 20:** Road.

**RWY 13-31:** 1500X125 (TURF-DIRT)

**RWY 13:** Road.

**RWY 31:** Road.

**AIRPORT REMARKS:** Unattended. Rwy 13-31 CLOSED indefly. Maint NA. Grass and rocks on rwy. Waterfowl and wildlife invof rwys.

**CAUTION:** Eagle nest on apch. Elec transformer wi safety area apch end. Rwy 31 2' brush apch end. Wx camera located on rwy edge. Rwy 02-20 and Rwy 13-31 marked with rwy cones. Rwy 02-20 slopes down toward S end. Safety areas soft.

**AIRPORT MANAGER:** 907-283-4526

**WEATHER DATA SOURCES:** AWOS-3P 135.725 (907) 269-2855. (WX CAM)

**COMMUNICATIONS:** CTAF 122.9

RCO 122.05 (JUNEAU RADIO)

Ⓡ ANCHORAGE CENTER APP/DEP CON 133.6

**RADIO AIDS TO NAVIGATION:** NOTAM FILE MDO.

(H) (H) VORW/DME 115.3 MDO Chan 100 N59°25.31'  
W146°21.00' 020° 2.1 NM to fld. 133/18E.

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Juneau FSS dial 1-866-297-2236.

