

HOQUIAM**BOWERMAN FLD** (HQM)(KHQM) 2 W UTC-8(-7DT) N46°58.27' W123°56.19'**SEATTLE**

18 B LRA NOTAM FILE HQM

H-1B, L-1D**Rwy 06-24:** H5000X150 (ASPH) S-30, D-40, 2D-80 HIRL**IAP****Rwy 06:** REIL. PAPI(P4R)—GA 3.0° TCH 40'. Rgt tfc.**Rwy 24:** MALSR. PAPI(P4L)—GA 3.5° TCH 55'.**SERVICE:** FUEL 100LL, JET A LGT ACTIVATE HIRL Rwy 06-24, PAPI

Rwy 06-24, MALSR Rwy 24 and REIL Rwy 06—CTAF.

AIRPORT REMARKS: Unattended. 100LL and Jet A avbl 24 hrs a day with major credit card. Flocks of waterfowl on and invof arpt. 103' crane 0.2 NM southwest of AER 24. Svc road south of rwy in primary sfc.

Ultralights prohibited without written permission from arpt mgr. Rwy 06-24 mrkgs faded.

AIRPORT MANAGER: 360-533-9544**WEATHER DATA SOURCES:** ASOS 135.775 (360) 538-7021.**COMMUNICATIONS:** CTAF/UNICOM 122.7**HOQUIAM RCO** 122.2 (SEATTLE RADIO)® **SEATTLE CENTER APP/DEP CON** 128.3**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Seattle

ARTCC at 253-351-3694.

AIRSPACE: CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HQM.**HOQUIAM (VH) (H) VORTACW** 117.7 HQM Chan 124 N46°56.82'

W124°08.96' 062° 8.9 NM to fld. 10/19E.

VOR unusable:

017°-024° byd 40 NM

037°-042° byd 40 NM

053°-058° byd 40 NM

066°-079° byd 40 NM

081°-091° byd 40 NM blo 4,000'

081°-091° byd 55 NM blo 5,000'

081°-091° byd 62 NM

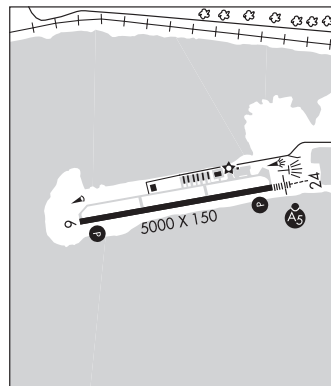
092°-137° byd 40 NM

154°-157° byd 40 NM

195°-208° byd 40 NM

268°-273° byd 40 NM

357°-004° byd 40 NM

ILS/DME 108.7 I-HQM Chan 24 Rwy 24. Class IT.**HOQUIAM** N46°56.82' W124°08.96' NOTAM FILE HQM.**SEATTLE****(VH) (H) VORTACW** 117.7 HQM Chan 124 062° 8.9 NM to Bowerman Fld. 10/19E.**H-1B, L-1D**

VOR unusable:

017°-024° byd 40 NM

037°-042° byd 40 NM

053°-058° byd 40 NM

066°-079° byd 40 NM

081°-091° byd 40 NM blo 4,000'

081°-091° byd 55 NM blo 5,000'

081°-091° byd 62 NM

092°-137° byd 40 NM

154°-157° byd 40 NM

195°-208° byd 40 NM

268°-273° byd 40 NM

357°-004° byd 40 NM

RCO 122.2 (SEATTLE RADIO)**HOSKINS FLD** (See OLYMPIA on page 253)