

NEW COALINGA MUNI (C80) 3 E UTC-8(-7DT) N36°09.73' W120°17.69'

625 B NOTAM FILE RIU

RWY 12-30: H5000X100 (ASPH) S-30 MIRL 0.5% up NW

RWY 12: REIL. PAPI(P2L)—GA 3.0° TCH 40'.

RWY 30: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Rgt tfc.

RWY 01-19: H2471X60 (ASPH-GRVL) S-12.5

RWY 19: Rgt t/c.

SERVICE: LGT REIL Rwy 12 and 30; MIRL Rwy 12-30; Perimeter Igts H1 on dusk—0800Z±; after 0800Z± ACTVT—CTAF. PAPI Rwy 12 and 30 opr consly. Rwy 30 VGSI OTS.

AIRPORT REMARKS: Attended irregularly. Rwy 01-19 clsd. Rwy 01-19 rwy sfc failed with potholes and brush. Rwy 12 markings has crack seal covers much of the runway centerline.

AIRPORT MANAGER: 559-246-6243

WEATHER DATA SOURCES: AWOS-3 119.275 (559) 935-5960.

COMMUNICATIONS: CTAF/UNICOM 122.7

® OAKLAND CENTER APP/DEP CON 128.7

CLEARANCE DELIVERY PHONE: For CD ctc Oakland ARTCC at 510-745-3380.

RADIO AIDS TO NAVIGATION: NOTAM FILE PRB.

PASO ROBLES (VL) (L) VORTACW 114.3 PRB Chan 90 N35°40.35'
W120°37.63' 013° 33.5 NM to fld. 817/16E.

TACAN AZIMUTH unusable:

120°–140° byd 27 NM blo 8,000'

DME unusable:

120°–140° byd 27 NM blo 8,000'

VOR unusable:

128°–138° byd 40 NM blo 6,000'


128°–138° byd 46 NM

139°–283° byd 40 NM

290°–295° byd 40 NM

325°–127° byd 40 NM

COMM/NAV/WEATHER REMARKS: AWOS OTS.

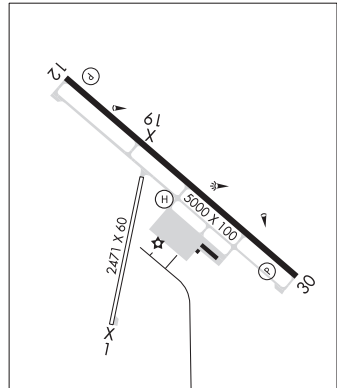

HELIPAD H1: H50X50 (ASPH) PERIMETER LGTS