CONTINUED FROM PRECEDING PAGE

COMMUNICATIONS: SFA 354.125 (Sooner Con/Okie Ops 228.45 311.0)
ATIS 270.1 (1100–0400Z‡) DSN 884–5152, C405–734–5152.
PTD 134.1 372.2
Ⓡ **OKE CITY APP/DEP CON** 120.45 288.325 (081º–170º) 124.2 336.4 (001º–080º) 124.6 266.8 (261º–360º) 126.65 263.075 (171º–260º)
TOWER 124.45 251.05 **GND CON** 121.8 275.8 **CLNC DEL** 119.7 335.8
TIK COMD POST (Arrow Ctl) 139.95 141.65 225.875 305.6
PMSV METRO 261.025 (Forecast svc avbl during afld opr hr.) DSN 884–3196, C405–734–3196. Alternate wx location DSN 884–3529, C405–734–3529. **TINKER ATOC** 119.15
AFMC FLT TEST 382.6 (OC–ALC PDM input acft ctc Sabre Control 30 min prior arrival.)
AIRSPACE: CLASS C svc ctc **APP CON**.
RADIO AIDS TO NAVIGATION: NOTAM FILE PWA.
WILEY POST (T) (T) VORW/DME 113.4 PWA Chan 81 N35º31.98´ W97º38.83´ 111º 14.6 NM to fld. 1271/8E.
WILL ROGERS (H) (H) VORTACW 114.1 IRW Chan 88 N35º21.52´ W97º36.55´ 066º 11.4 NM to fld. 1240/7E. NOTAM FILE OKC.
TACAN AZIMUTH unusable:
297º–315º
(T) TACAN Chan 105 TIK (115.8) N35º26.19´ W97º22.78´ 192º 1.3 NM to fld. 1251/3E. NOTAM FILE MLC.
TACAN AZIMUTH unusable:
051º–061º byd 20 NM blo 3,400´
154º–174º byd 23 NM blo 3,400´
DME unusable:
051º–061º byd 20 NM blo 3,400´
154º–174º byd 23 NM blo 3,400´
No NOTAM MP: 1300–1500Z‡ 1st & 3rd Tue each Month
LOC 111.7 I–EVG Rwy 13.
ILS 111.3 I–FRJ Rwy 18. Glideslope sgl not protected fm psbl reflective intfc caused by vehicle tfc. Acft with AN/ARN–58 localizer rcvr may experience course deviations due to intfc. LOC unusable byd 15º right of course centerline; fm 0.1 NM to rwy thld. No NOTAM MP: 1300–1500Z‡ 1st and 3rd Tue each Month.
LOC 111.7 I–PLH Rwy 31.
ILS 109.5 I–TIK Rwy 36. Acft with AN/ARN–58 localizer rcvr may experience course deviations due to intfc. No NOTAM MP: 1300–1500Z‡ 1st and 3rd Tue each Month.
ASR
COMM/NAV/WEATHER REMARKS: Radar see Terminal FLIP for Radar Minima. Acft with AN/ARN–58 localizer receiver may experience course deviations due to interference.

TIPTON MUNI (1O8) 3 SW UTC–6(–5DT) N34º27.52´ W99º10.28´

DALLAS–FT WORTH
L–17B
IAP
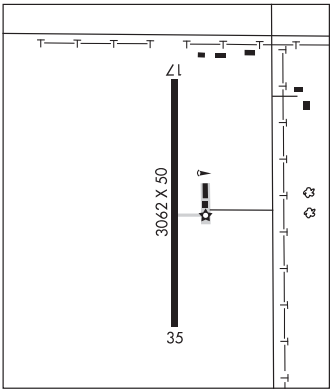
1248 B NOTAM FILE MLC
RWY 17–35: H3062X50 (ASPH) S–12 MIRL
RWY 17: Pole.
RWY 35: Pole.
AIRPORT REMARKS: Unattended. Rwy 17–35 moderate to severe cracking and grass growing through cracks.
AIRPORT MANAGER: 580-667-5211
COMMUNICATIONS: CTAF 122.9
Ⓡ **ALTUS APP/DEP CON** 125.1 (1500–0830Z‡ Mon–Fri, clsd weekends and holidays, other times ctc)
Ⓡ **FORT WORTH CENTER APP/DEP CON** 128.4 133.5
CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.
RADIO AIDS TO NAVIGATION: NOTAM FILE HBR.
HOBART (VL) (L) VORTACW 115.85 HBR Chan 105(Y) N34º51.99´ W99º03.80´ 182º 25.0 NM to fld. 1472/10E.
VOR unusable:
045º–070º byd 40 NM
071º–079º byd 54 NM blo 7,000´
071º–079º byd 66 NM
080º–120º byd 10 NM
355º–360º byd 15 NM blo 4,500´
TACAN AZIMUTH unusable:
050º–055º byd 21 NM blo 4,500´
050º–055º byd 26 NM blo 5,500´
050º–055º byd 33 NM blo 7,500 . 080–120 byd 10 NM´
245º–270º byd 33 NM blo 3,500´
DME unusable:
080º–120º byd 10 NM
355º–360º byd 15 NM blo 4,500´