

FRANKFORT CLINTON CO RGNL (FKR)(KFKR) 3 W UTC-5(-4DT) N40°16.41' W86°33.73'**CHICAGO**

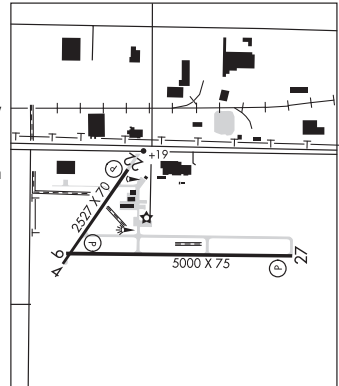
861 B NOTAM FILE HUF

H-5E, 10F, L-27D**RWY 09-27:** H5000X75 (ASPH) MIRL**IAP****RWY 09:** REIL. PAPI(P2L)—GA 3.0° TCH 25' . Crops.**RWY 27:** REIL. PAPI(P2L)—GA 3.0° TCH 25' .**RWY 04-22:** H2527X70 (ASPH) S-12.5, D-20 MIRL**RWY 04:** Crops.**RWY 22:** PAPI(P2R)—GA 4.0° TCH 25' . Road.**SERVICE:** S2 **FUEL** 100LL, JET A **LGT** ACTIVATE REIL Rwy 09 and Rwy 27; MIRL Rwy Rwy 04-22 and 09-27—CTAF. MIRL Rwy Rwy 04-22 and 09-27 preset low ints, incr intst—CTAF.**AIRPORT REMARKS:** Attended 1300-2200Z±. Svc after hrs AMGR. Coyote on and in/ovf arpt. Rwy 04-22 420' swy NE end. 20' wide ditch perpendicular to rwy 100' W of cntrln. Parachute Jumping.**AIRPORT MANAGER:** 765-654-6275**WEATHER DATA SOURCES:** AWOS-3 124.325 (765) 654-0328.**COMMUNICATIONS:** CTAF/UNICOM 123.0® **GRISOM APP/DEP CON** 123.85 (1230-0400Z± other times etc)® **CHICAGO CENTER APP/DEP CON** 123.85**CLEARANCE DELIVERY PHONE:** For CD ctc Chicago ARTCC at 630-906-8921.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HUF.**BOILER (H) (H) VORTACW** 115.1 BVT Chan 98 N40°33.37'

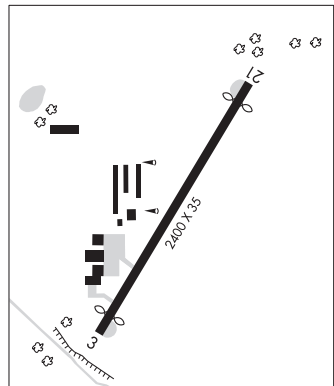
W87°04.16' 125° 28.8 NM to fld. 752/1E.

TACAN AZM/DME unusable:

298°-044° blo 2,800'

**FRANKLIN FLYING FLD** (3FK) 3 S UTC-5(-4DT) N39°25.59' W86°03.50'**ST LOUIS**

740 NOTAM FILE HUF

RWY 03-21: H2400X35 (ASPH) 0.6% up SW**RWY 03:** Thld dsplcd 125' . Tree.**RWY 21:** Thld dsplcd 165' . Crops.**AIRPORT REMARKS:** Attended irregularly. Parachute Jumping.**AIRPORT MANAGER:** 317-549-5273**COMMUNICATIONS:** CTAF/UNICOM 122.7**CLEARANCE DELIVERY PHONE:** For CD ctc Indianapolis Apch at 317-227-5743.**FREEMAN MUNI** (See SEYMOUR on page 139)