

**CINCINNATI MUNI/LUNKEN FLD** (LUK)(KLUK) 3 SE UTC-5(-4DT) N39°06.18' W84°25.06'CINCINNATI  
H-10G, L-27E  
IAP, AD

482 B LRA Class IV, ARFF Index A NOTAM FILE LUK

**RWY 03-21:** H6101X150 (ASPH-GRVD) S-60, D-70, 2D-140

PCR 377 R/C/X/T HIRL

**RWY 03:** REIL. PAPI(P4R)—GA 3.0° TCH 44'. RVR-R Tree.**RWY 21:** MALS. PAPI(P4L)—GA 3.0° TCH 39'. RVR-T Tree.**RWY 07-25:** H5127X100 (ASPH-GRVD) S-11, D-20, 2D-55

PCN 38 R/C/X/T MIRL No Part 121/Part 380 Ops

**RWY 07:** Thld displcd 439'. Bldg.**RWY 25:** VASI(V4L)—GA 3.0° TCH 40'. Tree.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 03:** TORA-6101 TODA-6101 ASDA-6101 LDA-6101**RWY 21:** TORA-6101 TODA-6101 ASDA-6101 LDA-6101**SERVICE:** S4 FUEL 100LL, JET A+ OX 1 LGT When ATCT clsd ACTVTY or incr instst MALS. Rwy 21; HIRL. Rwy 03-21—CTAF. HIRL. Rwy 03-21 preset on med instst. Rwy 07-25 PCL unavbl. Rwy 03 PAPI unusbl byd 7 degs left of cntrln. Rotating bcn lctd 1.7 NM E of arpt.**NOISE:** Noise abatement procs in efct call amgr. Actt maint runups rstrd btn 0200-1200Z.**AIRPORT REMARKS:** Attended continuously. Deer and birds on and invof

arpt. Fuel A+ C513-871-2020. Clsd to scheduled ACR ops greater

than 9 pax seats. 48 hr PPR for unsched ACR ops with gtr than 30

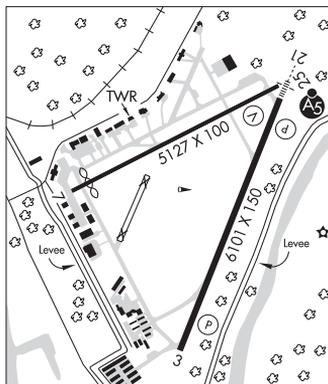
passenger seats call amgr. AER Rwy 25 and Rwy 21 are closely lctd; vfy cor rwy with compass hdg bfr dep. Arpt sfc cond

unmon dly 0400-1200Z. Twy D, E, G, &amp; H clsd to unsked ACR ops gtr than 30 pax seats. Twy H not vsb fm ATCT, ctc

ground control. When ATCT clsd, use CTAF. Ldg fee. Flight Notification Service (ADCUS) available.

**AIRPORT MANAGER:** 513-352-6340**WEATHER DATA SOURCES:** ASOS (513) 321-6291**COMMUNICATIONS:** CTAF 118.7 ATIS 123.6 UNICOM 122.95

Ⓡ APP/DEP CON 121.0

**LUNKEN TOWER** 118.7 (1200-0400Z) GND CON/CLNC DEL 121.9 CLNC DEL 124.9 (when twr closed)**AIRSPACE:** CLASS D svc 1200-0400Z; other times CLASS E.**VOR TEST FACILITY (VOT)** 108.4**RADIO AIDS TO NAVIGATION:** NOTAM FILE DAY.**ILS/DME** 110.9 I-LUK Chan 46 Rwy 21. Class IA. Unmonitored when ATCT clsd. DME unusable byd 25° left of course.**COMM/NAV/WEATHER REMARKS:** Emerg frequency 121.5 not avbl at twr. Cust in tempo fac; cust fac reqs must be smtd to arpt first by calling 513-709-2761 or email #DOTE-AVIATION@CINCINNATI.OH.GOV.**CINCINNATI WEST** (See HARRISON on page 291)**CINCINNATI/NORTHERN KENTUCKY INTL** (See COVINGTON on page 279)**CIRCLEVILLE****PICKAWAY CO MEML** (CYO)(KCYO) 5 S UTC-5(-4DT) N39°30.96' W82°58.93'

685 B NOTAM FILE DAY

**RWY 01-19:** H4346X75 (ASPH) S-30, D-40 MIRL 0.5% up N**RWY 19:** REIL. PAPI(P4R)—GA 3.0° TCH 24'.**SERVICE:** FUEL 100LL, JET A LGT ACTIVATE REIL Rwy 19; PAPI Rwy 19; MIRL—CTAF.**AIRPORT REMARKS:** Unatndd. Fuel: 100LL and Jet A avbl H24 via credit card.**AIRPORT MANAGER:** 740-474-5145**COMMUNICATIONS:** CTAF/UNICOM 122.7

Ⓡ COLUMBUS APP/DEP CON 134.0

**CLEARANCE DELIVERY PHONE:** For CD ctc Columbus Apch at 614-338-8537.**RADIO AIDS TO NAVIGATION:** NOTAM FILE DAY.**APPLETON (VH) (H) VORTAC** 116.7 APE Chan 114 N40°09.06' W82°35.30' 212° 42.2 NM to fld. 1354/6W.

VOR unusable:

025°-030°

TACAN AZIMUTH unusable:

075°-095°

110°-115°

DME unusable:

075°-080°

**YELLOW BUD (T) VORW** 112.5 XUB N39°31.61' W82°58.68' at fld. 689/5W.CINCINNATI  
L-29A  
IAP**CLERMONT CO** (See BATAVIA on page 262)