

ROUND LAKE (W57) 2 E UTC-5(-4DT) N42°55.87' W73°46.25'

NEW YORK

178 NOTAM FILE BTW

RWY 14-32: 1927X76 (TURF) 1.0% up SE

RWY 14: Tree.

RWY 32: Trees.

AIRPORT REMARKS: Attended on call. Deer on and invof arpt. Arpt clsd to itinerant acft Nov-May. Rwy 14-32 has 80' trees rgt and left of centerline in primary sfc. Rwy 14-32 soft during spring (Mar-Jun). Military helicopters and ultralight acft use rwy. Access to arpt from lake overgrown. Ctc arpt mgr prior to seaplane arrival.

AIRPORT MANAGER: 518-899-6316

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Albany Apch at 518-862-2299.

• • • • •
WATERWAY 14W-32W: 4000X600 (WATER)

ROYALTON (See GASPORT on page 204)

SARANAC LAKE

ADIRONDACK RGNL (SLK)(KSLK) 4 NW UTC-5(-4DT) N44°23.12' W74°12.37'

MONTREAL

1663 B LRA ARFF Index—See Remarks NOTAM FILE SLK

H-11C, 12K, L-32G

RWY 05-23: H6573X150 (ASPH-GRVD) S-40, D-73, 2S-92, 2D-115

IAP, AD

PCR 363 F/B/X/T HIRL 0.3% up NE

RWY 05: PAPI(P4L)—GA 3.0° TCH 35'. Trees.

RWY 23: MALSR. Trees.

RWY 09-27: H3997X100 (ASPH) S-40, D-73, 2S-92, 2D-115

PCR 349 F/A/X/T MIRL

RWY 09: Trees.

RWY 27: Thld dsplcd 400'. Trees.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA-6573 TODA-6573 ASDA-6573 LDA-6573

RWY 09: TORA-3997 TODA-3997 ASDA-3997 LDA-3997

RWY 23: TORA-6573 TODA-6573 ASDA-6333 LDA-6333

RWY 27: TORA-3997 TODA-3997 ASDA-3997 LDA-3597

SERVICE: S4 FUEL 100LL, JET A LGT ACTVT MALSR Rwy 23, HIRL Rwy 05-23, MIRL Rwy 09-27 and twy lgts—CTAF. PAPI Rwy 05 opr consly.

AIRPORT REMARKS: Attended May-Oct 1100-0200Z†. Nov-Apr

1100-0100Z†. For arpt attendant after hrs call 518-637-7329.

Rwy/twy/apron conds not mnt outside of nml atnd hrs. All sfc work

in prog; grass cutting Apr thru Oct. Class IV, ARFF Index A. PPR 48 hr

for unscheduled acft ops with more than 30 passenger seats call arpt manager 518-891-4600 ext 106. Index B coverage is avbl. Twy B unavbl to acft with wingspan 79' and abv. Abv ground twy edge lgts adjacent to Twy B tie down apron area. Rwy 09 nstd markings, thld markings 400' from rwy end. Cold temperature airport. Altitude correction required at or below -32C. Ldg fee.

AIRPORT MANAGER: 518-891-4600

WEATHER DATA SOURCES: ASOS 124.175 (518) 897-7532.

COMMUNICATIONS: CTAF/UNICOM 123.0

® **BOSTON CENTER APP/DEP CON** 120.35

CLEARANCE DELIVERY PHONE: For CD if una to ctc on freq, ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE SLK.

SARANAC LAKE (DH) DME 114.85 SLK Chan 95(Y) N44°23.07' W74°12.27' at fld. 1647.

DME unusable:

102°-107° byd 31 NM blo 11,500'


108°-111° byd 31 NM

112°-129° byd 31 NM blo 10,500'

310°-315° byd 36 NM blo 9,300'

Blw 8,600'

ILS 108.9 I-SLK Rwy 23. Class IA.

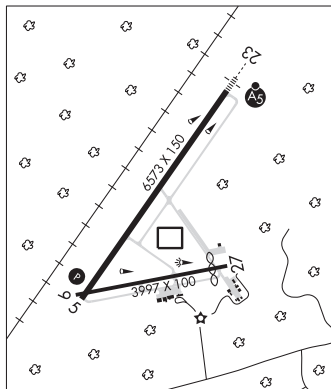

SARATOGA CO (See SARATOGA SPRINGS on page 241)