

**PINEHURST/SOUTHERN PINES**

**MOORE CO** (SOP)(KSOP) 3 N UTC-5(-4DT) N35°14.25' W79°23.34'

**CHARLOTTE**  
H-9C, 12H, L-35A, 36F  
IAF

459 B NOTAM FILE SOP

**RWY 05-23:** H6503X150 (ASPH-GRVD) S-100, D-162

PCN 27 F/A/X/T HIRL 0.4% up SW

**RWY 05:** MALSR. PAPI(P4L)—GA 3.0° TCH 40'. Thld dspcd 600'. Trees.

**RWY 23:** REIL. PAPI(P4R)—GA 3.0° TCH 41'. Thld dspcd 400'. Trees.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 05:** TORA-6502 TODA-6502 ASDA-6102 LDA-5502

**RWY 23:** TORA-6502 TODA-6502 ASDA-6102 LDA-5722

**SERVICE:** S4 **FUEL** 100LL, JET A+ **OX3** **LGT** ACTVT MALSR Rwy 05; REIL Rwy 23; HIRL Rwy 05-23; twy lgts—CTAF. PAPI Rwy 05 & 23 opers consly.

**NOISE:** Noise abatement procedures in effect. Ctc amgr 910-692-3212.

**AIRPORT REMARKS:** Attended 1300-0100Z±. Bird activity on and invof arpt Apr-Oct. Fixed wing aircraft operations not authorized from any grass/turf surface. Clsd to unscheduled air carrier ops with more than 30 passenger seats, call arpt mgr 910-692-3212. 12 hr PPR for jet ops conducted 0400-1100Z±, ctc arpt mgr 910-692-3212. Maint avbl. Flt trng avbl.

**AIRPORT MANAGER:** 910-692-3212

**WEATHER DATA SOURCES:** AWOS-3PT 127.575 (910) 692-4287.

**COMMUNICATIONS:** CTAF/UNICOM 123.05

Ⓡ FAYETTEVILLE APP/DEP CON 127.8

CLNC DEL 127.0

**CLEARANCE DELIVERY PHONE:** For CD ctc Fayetteville Apch 910-484-8012.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE RDU.

**SANDHILLS (L) (L) VORTACW** 111.8 SDZ Chan 55 N35°12.93' W79°35.28' 085° 9.9 NM to fld. 588/3W.

VOR unusable:

075°-143°

144°-154° blo 6,000'

144°-154° byd 23 NM

155°-179° blo 5,000'

180°-264° blo 8,000'

301°-019° byd 10 NM blo 10,000'


DME unusable:

041°-092° blo 3,000'

TAC AZM unusable:

016°-050° byd 28 NM blo 3,000'

ILS/DME 111.5 I-SOP Chan 52 Rwy 05. Class IT. LOC unmonitored 0100-1300Z±.

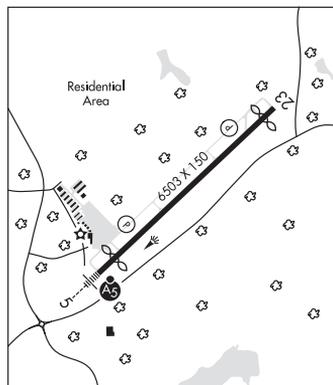

**PITT-GREENVILLE** (See GREENVILLE on page 319)

**PLYMOUTH**

**DONALD'S AIR PARK INC** (7NC) 8 SE UTC-5(-4DT) N35°43.90' W76°40.28'

**CHARLOTTE**

18 NOTAM FILE RDU

**RWY 05-23:** 4195X100 (TURF) LIRL(NSTD)

**RWY 05:** Brush.

**RWY 23:** Pole.

**SERVICE:** S3 **LGT** To ACTVT LIRL Rwy 05-23 call 252-809-9010. Rwy 05-23 nstd LIRL due to spacing of rwy lgts and no end lgts.

**AIRPORT REMARKS:** Attended Mon-Sat 1300-2200Z±, Sun 1800-2200Z±. Heavy agricultural acct ops Mar-Nov. Parallel turf rwy arpt within 3/4 mile NW. Rwy 23 has unmkd p-line 60' +/- each side of thld with p-line buried acrs rwy width at thld. Addnl unmkd 50' p-line 1200' from Rwy 23 thld. Rwy 05 and Rwy 23 mkd with yellow cones. Rwy 5 has 8' ditch 12' from thld both sides cntrl.

**AIRPORT MANAGER:** 252-809-9010

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Washington ARTCC at 703-771-3587.

**COMM/NAV/WEATHER REMARKS:** Mnt freq 122.8 for tfc adzy.