

PINEHURST/SOUTHERN PINES**MOORE CO** (SOP)(KSOP) 3 N UTC-5(-4DT) N35°14.25' W79°23.34'

459 B NOTAM FILE SOP

RWY 05-23: H6503X150 (ASPH-GRVD) S-100, D-162

PCN 27/F/A/X/T HIRL 0.4% up SW

RWY 05: MALSR. PAPI(P4L)—GA 3.0° TCH 40'. Thld dspcd 600'. Trees.**RWY 23:** REIL. PAPI(P4R)—GA 3.0° TCH 41'. Thld dspcd 400'. Trees.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 05:** TORA-6502 TODA-6502 ASDA-6102 LDA-5502**RWY 23:** TORA-6502 TODA-6502 ASDA-6102 LDA-5722**SERVICE:** S4 **FUEL** 100LL, JET A+ **OX 3** **LGT** ACTVT MALSR Rwy 05; REIL Rwy 23; HIRL Rwy 05-23; twy lgts—CTAF. PAPI Rwy 05 & 23 ops consly. Rwy 23 PAPI unusbl byd 8 deg left of cntrln.**NOISE:** Noise abatement procs in effect. Ctc amgr 910-692-3212.**AIRPORT REMARKS:** Attended 1300-0100Z†. Bird activity on and invof arpt Apr-Oct. Fixed wing acft ops not auth from any grass/turf sfc. Clsd to unscheduled air carrier oper with more than 30 passenger seats, call arpt mgr 910-692-3212. 12 hr PPR for jet ops conducted 0400-1100Z†, ctc arpt mgr 910-692-3212. Maint avbl. Flt trng avbl.**AIRPORT MANAGER:** 910-692-3212**WEATHER DATA SOURCES:** AWOS-3PT 127.575 (910) 692-4287.**COMMUNICATIONS:** CTAF/UNICOM 123.05® **FAYETTEVILLE APP/DEP CON** 127.8

CLNC DEL 127.0

CLEARANCE DELIVERY PHONE: For CD ctc Fayetteville Apch 910-484-8012.**RADIO AIDS TO NAVIGATION:** NOTAM FILE RDU.**SANDHILLS (L) (L) VORTACW** 111.8 SDZ Chan 55 N35°12.93' W79°35.28' 085° 9.9 NM to fld. 588/3W.

VOR unusable:

075°-143°

144°-154° blo 6,000'

144°-154° byd 23 NM

155°-179° blo 5,000'

180°-264° blo 8,000'

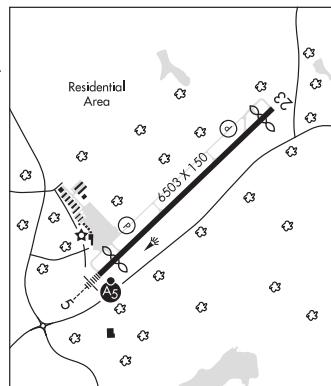
301°-019° byd 10 NM blo 10,000'

DME unusable:

041°-092° blo 3,000'

TAC AZM unusable:

016°-050° byd 28 NM blo 3,000'

ILS/DME 111.5 I-SOP Chan 52 Rwy 05. Class IT. LOC unmonitored 0100-1300Z†. Autopilot cpd apch NA blw 700' MSL.**PITT-GREENVILLE** (See GREENVILLE on page 330)**PLYMOUTH****DONALD'S AIR PARK INC** (7NC) 8 SE UTC-5(-4DT) N35°43.90' W76°40.28'

CHARLOTTE

18 NOTAM FILE RDU

RWY 05-23: 4195X100 (TURF) LIRL(NSTD)**RWY 05:** Brush.**RWY 23:** Pole.**SERVICE:** S3 **LGT** LIRL Rwy 05-23 on cont day and night; Rwy 05 lgtd thld relocated 250 ft and Rwy 23 lgtd thld relocated 1000 ft; 2750 ft of rwy usbl at night. Rwy 05-23 NSTD LIRL due to spacing of rwy lgts and no end lgts.**AIRPORT REMARKS:** Attended Mon-Sat 1300-2200Z†, Sun 1800-2200Z†. Heavy agricultural acft ops Mar-Nov. Parallel turf rwy arpt within 3/4 mile NW. Rwy 23 has unmkd p-line 60' +/- each side of thld with p-line buried acrs rwy width at thld. Adnl unmkd 50' p-line 1200' from Rwy 23 thld. Rwy 05 and Rwy 23 mkd with yellow cones. Rwy 5 has 8' ditch 12' from thld both sides cntrln.**AIRPORT MANAGER:** 252-809-9010**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Washington ARTCC at 703-771-3587.**COMM/NAV/WEATHER REMARKS:** Mnt freq 122.8 for ttc adzy.