

TARBORO—EDGECOMBE (ETC)(KETC) 2 N UTC-5(-4DT) N35°56.24' W77°32.79'

CHARLOTTE

53 B NOTAM FILE RDU

L-35C, 36G

RWY 09-27: H3999X60 (ASPH) MIRL

IAP

RWY 09: PAPI(P2L)—GA 4.0° TCH 27'. Thld dsplcd 200'. Trees.

RWY 27: REIL. PAPI(P2L)—GA 3.0° TCH 29'. Trees.

SERVICE: FUEL 100LL LGT ACTVT REIL Rwy 27, PAPI Rwy 09 and Rwy 27, MIRLS Rwy 09-27—CTAF.

AIRPORT REMARKS: Unattended. Deer on and in/ovf arpt. Self svc 100LL avbl 24 hrs with credit card. 500' low level rte 3 mi NE of arpt—be alert for mil acft in/ovf arpt. Rwy 27 safety area has sfc variations and depressions and a 20' drop-off 100' fm both sides.

AIRPORT MANAGER: (252) 641-4229

WEATHER DATA SOURCES: AWOS-3P 119.575 (252) 641-1640.

COMMUNICATIONS: CTAF 122.9

Ⓡ WASHINGTON CENTER APP/DEP CON 123.85

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.

RADIO AIDS TO NAVIGATION: NOTAM FILE RDU.

TAR RIVER (VL) (H) VORTAC 117.8 TYI Chan 125 N35°58.60' W77°42.22' 112° 8.0 NM to fld. 73/5W.

VOR unusable:

048°-052° byd 40NM blo 6,000'

186°-189° byd 40 NM blo 6,000'

298°-318° byd 40 NM blo 6,000'

TAC AZ unusable:

008°-018° byd 27 NM

120°-127° byd 33 NM

284°-289°

DME unusable:


008°-018° byd 27 NM

120°-127° byd 33 NM

209°-215° byd 30 NM

287°-292° byd 38 NM

339°-347° byd 30 NM

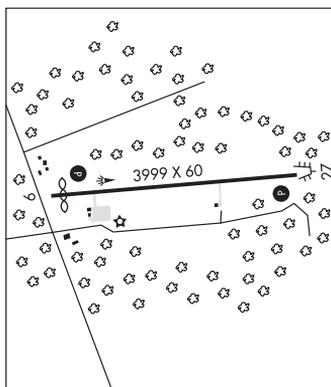

TAWBA N35°47.19' W81°18.32' NOTAM FILE HKY.

CHARLOTTE

NDB (MHW/LOM) 332 HK 243° 4.9 NM to Hickory Rgnl. 986/6W.

L-25D