

MURRAY FLD (EKA)(KEKA) 3 E UTC-8(-7DT) N40°48.20' W124°06.77'

KLAMATH FALLS

11 B TPA-811(800) NOTAM FILE OAK

L-2H

RWY 12-30: H3011X75 (ASPH) S-19 MIRL

IAP

RWY 30: VASI(V2L)—GA 4.0° TCH 26'. Rgt ttc.

SERVICE: S4 FUEL 100LL LGT ACTVT VASI Rwy 30; MIRL Rwy 12-30—CTAF. Rwy 30 VGSI unusbl byd 6.5 NM due to trnn.

AIRPORT REMARKS: Unatndd. Be alert for birds invof arpt. Deer in vcnty of rwy. Be aware, CTAF freq shared with nearby arpt. Flight Notification Service (ADCUS) avbl. Landing fee: ctc arpt website for dtls, exemptions.

AIRPORT MANAGER: (707) 839-5402

COMMUNICATIONS: CTAF/UNICOM 122.7

® **SEATTLE CENTER APP/DEP CON** 124.85 306.3

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

RADIO AIDS TO NAVIGATION: NOTAM FILE FOT.

FORTUNA (L) (L) VORTACW 114.0 FOT Chan 87 N40°40.28' W124°14.07' 016° 9.7 NM to fld. 392/19E.

VOR unusable:

060°-070° byd 35 NM blo 9,500'

150°-165° byd 25 NM blo 6,500'

165°-200° byd 25 NM blo 8,000'

280°-330° byd 20 NM blo 3,000'

330°-336° byd 20 NM

336°-350° byd 20 NM blo 3,000'

TACAN AZIMUTH unusable:

060°-070° byd 35 NM blo 9,500'

150°-165° byd 25 NM blo 5,500'

165°-200° byd 25 NM blo 8,000'

315°-325° byd 15 NM blo 5,500'


DME unusable:

060°-070° byd 35 NM blo 9,500'

150°-165° byd 25 NM blo 5,500'

165°-200° byd 25 NM blo 8,000'

315°-325° byd 15 NM blo 5,500'

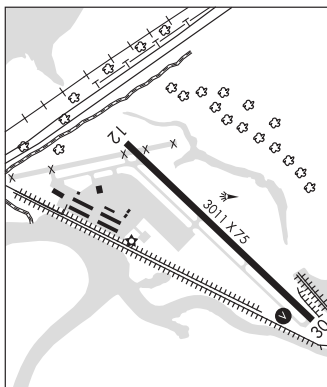

SAMOA FLD (O33) 2 W UTC-8(-7DT) N40°46.85' W124°12.74'

KLAMATH FALLS

20 TPA-820(800) LRA NOTAM FILE OAK

RWY 16-34: H2700X60 (ASPH) S-10 0.4% up N

RWY 16: Rgt ttc.

AIRPORT REMARKS: Unattended. Day use only; CLOSED ngts. Ultralight activity on and invof arpt. Be aware, CTAF freq shared with nearby arpt.

AIRPORT MANAGER: 707-441-4374

COMMUNICATIONS: CTAF 122.7

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.