

INYOKERN (IYK)(KIYK) 1 NW UTC-8(-7DT) N35°39.52' W117°49.77'

2457 B NOTAM FILE IYK

RWY 15-33: H7100X75 (ASPH) S-24 PCN 7 F/C/Y/U MIRL

0.4% up NW

RWY 15: PAPI(P2L)—GA 3.0° TCH 40'.**RWY 33:** PAPI(P2L)—GA 3.3° TCH 40'.**RWY 02-20:** H6275X75 (ASPH) S-30, D-50, 2D-80 PCN 6 F/C/X/U

MIRL 0.4% up S

RWY 02: PAPI(P2L)—GA 3.3° TCH 40'.**RWY 20:** VASI(V4L)—GA 3.0° TCH 35'. Thld dspld 320'. Rgt tfc.**RWY 10-28:** H4150X75 (ASPH) S-24 PCN 7 F/C/Y/U MIRL

1.0% up W

RWY 28: Thld dspld 103'.
SERVICE: S2 FUEL 100LL, JET A LGT ACTVT VASI Rwy 20; MIRL Rwy 02-20, Rwy 10-28, Rwy 15-33—CTAF. PAPI Rwy 02, Rwy 15 and Rwy 33 opr consly.

AIRPORT REMARKS: Attended Mon-Fri 1530-0000Z, Frequent glider ops on weekends. After 0000Z callout fee for svc call 760-382-3383. Rwy 10-28 condition poor but stable. Ptns of rwy ctrln marking obscd by crack filler. Rwy 15-33 surface: pavement experiencing longl and lateral block cracking on ptns of rwy.
AIRPORT MANAGER: 760-377-5844**COMMUNICATIONS:** CTAF/AUNICOM 122.8

JOSHUA APP/DEP CON 133.65

CLEARANCE DELIVERY PHONE: For CD ctc Los Angeles ARTCC at 661-575-2079.**RADIO AIDS TO NAVIGATION:** NOTAM FILE EDW.**EDWARDS (T) (T) VORTACW** 116.4 EDW Chan 111 N34°58.94' W117°43.96' 341° 40.8 NM to fld. 2378/12E.

TACAN AZIMUTH unusable:

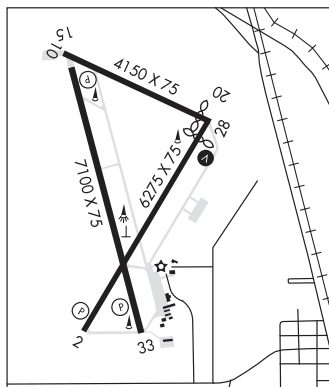
098°-158° byd 19 NM

DME unusable:

107°-158° byd 19 NM

VOR unusable:

098°-158° byd 19 NM blo 7,900'

COMM/NAV/WEATHER REMARKS: Automated UNICOM-3 clicks for arpt advisory and wx or dial 617-262-3825, 4 clicks for radio check. Monitor 122.8 in tfc pat.

JACK MC NAMARA FLD (See CRESCENT CITY on page 146)

JACK NORTHROP FLD/HAWTHORNE MUNI (See HAWTHORNE on page 173)

JACKSON

WESTOVER FLD AMADOR CO (JAK)(KJAK) 2 NW UTC-8(-7DT) N38°22.61' W120°47.63'

SAN FRANCISCO

1693 B NOTAM FILE RIU

L-3A

RWY 01-19: H3401X60 (ASPH) S-12.5 MIRL

IAP

RWY 01: REIL. PAPI(P2L)—GA 3.0° TCH 22'.**RWY 19:** REIL. PAPI(P2L)—GA 4.0° TCH 32'. Tree.
SERVICE: FUEL 100LL, JET A LGT ACTVT REIL Rwy 01 and 19; PAPI Rwy 01 and 19; MIRL Rwy 01-19; Twy lgts SS-SR only—CTAF. PAPI Rwy 19 unusable byd 5° left of course.
AIRPORT REMARKS: Attended Mon-Fri 1600-0100Z. Rwy 19 is preferred rwy.**AIRPORT MANAGER:** 209-223-6376**WEATHER DATA SOURCES:** AWOS-3 121.125 (209) 257-1292.**COMMUNICATIONS:** CTAF/UNICOM 123.075

® NORCAL APP CON 125.1

® NORCAL DEP CON 127.4

CLEARANCE DELIVERY PHONE: For CD ctc NorCal Apch at 916-361-6874.**RADIO AIDS TO NAVIGATION:** NOTAM FILE RIU.**LINDEN (VH) (DH) VORW/DME** 114.8 LIN Chan 95 N38°04.47' W121°00.23' 012° 20.7 NM to fld. 266/17E.

DME unusable:

191°-235°

VOR unusable:

228°-232° byd 40 NM

236°-240° byd 40 NM

 • • • • •
HELIPAD H1: H50X50 (CONC)

JACQUELINE COCHRAN RGNL (See PALM SPRINGS on page 233)