

HUGHES (HUS)(PAHU) 1 SW UTC-9(-8DT) N66°02.35' W154°15.88'
 299 B NOTAM FILE FAI
 RWY 18-36: 3381X100 (GRVL) MIRL

FAIRBANKS
 L-4I
 IAP

RWY 18: Trees.

RWY 36: Trees.

SERVICE: LGT ACTVT MIRL Rwy 18-36—CTAF. ACTVT rotating beacon—CTAF.

AIRPORT REMARKS: Unattended. Rwy condition not monitored; recommend visual inspection prior to landing. Twy A unlit. Twy A reflectors 36 inches tall. Snow removal operations during winter—monitor CTAF. South safety area soft and rutted. 150 ft x 100 ft turn around north side of rwy.

AIRPORT MANAGER: (907) 451-5280

COMMUNICATIONS: CTAF 122.9

Ⓡ **ANCHORAGE CENTER APP/DEP CON** 124.6

RADIO AIDS TO NAVIGATION: NOTAM FILE UTO.

UTOPIA CREEK NDB/DME (HW) 272 UTO Chan 22(Y) N65°59.71' W153°41.63' 264° 14.2 NM to fld. 983/17E.

NDB unusable:

210°-240°


340°-355°

NDB/DME unusable:

45°-105° byd 25 NM

105°-45°

COMM/NAV/WEATHER REMARKS: For a toll free call to Fairbanks FSS dial 1-866-248-6516.

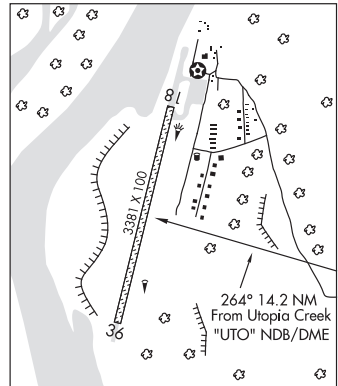

HUNT STRIP (See WASILLA on page 253)

HUSLIA (HLA)(PAHL) 1 E UTC-9(-8DT) N65°41.87' W156°21.08'
 220 B NOTAM FILE HLA

FAIRBANKS
 H-1A, L-4I
 IAP

RWY 03-21: 4000X75 (GRVL) MIRL 0.3% up SW

RWY 03: REIL. PAPI(P4L)—GA 3.0° TCH 25'. Tree.

RWY 21: REIL. PAPI(P4L)—GA 3.0° TCH 25'. Trees.

SERVICE: LGT ACTIVATE MIRL Rwy 03-21, PAPI and REIL Rwy 03 and Rwy 21—CTAF.

AIRPORT REMARKS: Unattended. Rwy condition unmonitored, recommend visual inspection prior to ldg. Snow removal during winter months—monitor CTAF. Rwy 03-21 soft when wet.

AIRPORT MANAGER: (907) 451-5280

WEATHER DATA SOURCES: AWOS-3P 135.75 (907) 829-2282. (WX CAM)

COMMUNICATIONS: CTAF 122.8

HUSLIA RCO 122.4 (FAIRBANKS RADIO)

ANCHORAGE CENTER APP/DEP CON 127.0 290.2

RADIO AIDS TO NAVIGATION: NOTAM FILE HLA.

(H) (H) **VORW/DME** 117.4 HSL Chan 121 N65°42.47'

W156°21.79' at fld. 187/19E.

COMM/NAV/WEATHER REMARKS: For a toll free call to Fairbanks FSS dial 1-866-248-6516.

