

DAHL CREEK (DCK)(PODC) 10 SE UTC-9(-8DT) N66°56.55' W156°53.48'

FAIRBANKS
H-1A, L-41

260 NOTAM FILE OTZ

RWY 08-26: 4780X75 (GRVL)

RWY 08: Brush. Rgt tfc.

RWY 26: Brush.

AIRPORT REMARKS: Unattended. Arprt not maintained, no snow removal, rwy cond not monitored. Recommend visual inspection prior to ldg. Caribou may be on rwy. Rwy 08-26 grass growing on rwy, dip forming aprx 250' from Rwy 26 thld and 2" wide erosion channels developing from cntrln to south edge, rwy no longer maintained. Rwy 08-26 also used as a road. Wind sock damaged and not reliable, segmented circle and wind sock are overgrown with brush and trees.


AIRPORT MANAGER: 907-442-3147

COMMUNICATIONS: CTAF 122.7

RADIO AIDS TO NAVIGATION: NOTAM FILE OTZ.

KOTZEBUE (H) (H) VORW/DME 115.7 OTZ Chan 104 N66°53.14' W162°32.40' 071° 133.5 NM to fld. 121/15E.

COMM/NAV/WEATHER REMARKS: For a LC to Kotzebue FSS dial 907-442-3310. For a toll free call to Kotzebue FSS dial 1-800-478-7460. For a toll free call to Fairbanks FSS dial 1-866-248-6516.

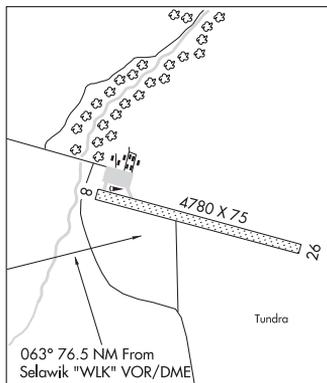

DEADHORSE

BADAMI (AK78)(PABP) PVT 29 E UTC-9(-8DT) N70°08.25' W147°01.83'

POINT BARROW
H-1A, L-41

26 NOTAM FILE FDC Not insp.

RWY 04-22: 5100X75 (GRVL) MIRL

RWY 04: PVASI(PSIL)—GA 3.0° TCH 50'.

RWY 22: PVASI(PSIL)—GA 3.0° TCH 50'.

SERVICE: LGT Rwy 04 VGSI unusable beyond 5° left or right of rwy centerline. Rwy 22 VGSI unusable beyond 5° left or right of rwy centerline.

AIRPORT REMARKS: Unattended.

AIRPORT MANAGER: 907-433-3808

COMMUNICATIONS: CTAF 122.9

COMM/NAV/WEATHER REMARKS: For a LC to Deadhorse FSS dial 659-2401. For a toll free call to Fairbanks FSS dial 1-866-248-6516.

DEADHORSE (SCC)(PASC) 0 SE UTC-9(-8DT) N70°11.69' W148°27.91'

POINT BARROW
H-1A, L-41
IAP

67 B ARFF Index—See Remarks NOTAM FILE SCC

RWY 06-24: H6500X150 (ASPH-GRVD) S-120, D-250, 2D-550

PCR 801 F/A/X/T HIRL CL

RWY 06: MALSR. VASI(V4L)—GA 3.0° TCH 50'. RVR-T Rgt tfc.

RWY 24: MALSR. VASI(V4L)—GA 3.0° TCH 54'. RVR-T


RUNWAY DECLARED DISTANCE INFORMATION

RWY 06: TORA-6500 TODA-6500 ASDA-6500 LDA-6500

RWY 24: TORA-6500 TODA-6500 ASDA-6500 LDA-6500

SERVICE: FUEL 100, JET A LGT When FSS clsd ACTVT MALSR Rwy 06 & 24; HIRL Rwy 06-24—CTAF. HIRL Rwy 06-24 preset low intst; incr intst—CTAF.

AIRPORT REMARKS: Attended 1500-0330Z±. Waterfowl invof arprt; caribou on rwy & mov areas. Fuel A: 1500-0300Z±—122.85 or 907-659-6215. Arprt maint 1500-0330Z±; aft hr—amgr. Snow removal, wildlife control, cond reporting, and other airfield maint services only avbl and valid during arprt maint duty hrs. Colville ramp clsd. Ctc arprt mgmt for any after—hours req for airfield services. Class I, ARFF Index B. Clsd to ACR ops more than 30 pax seats exc PPR in writing—amgr, PO Box 340002, Prudhoe Bay, AK 99734. ARFF svc PPR in writing—amgr. TSA regulated; see 49 CFR 1542. All gates & doors must be secured at all times. Tsnt or unfamiliar pilots—amgr for info. NOTE: See Notices—Drone Activity at Coastal Airport Launch Sites.

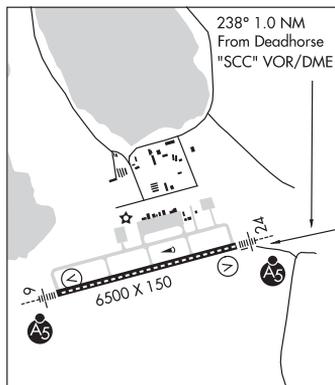

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRPORT MANAGER: 907-328-7130

WEATHER DATA SOURCES: ASOS 118.4 (907) 659-2591. (WX CAM)

COMMUNICATIONS: CTAF 123.6 AFIS 118.4 (1500-0630Z† OT ctc Fairbanks FSS) UNICOM 123.0

FSS SCC (DEADHORSE RCO) 1500-0630Z†OT CTC FAIRBANKS FAI)

DEADHORSE RADIO 121.5 122.2 123.6 (LAA 123.6)

Ⓡ ANCHORAGE CENTER APP/DEP CON 134.4

AIRSPACE: CLASS E svc continuous.

RADIO AIDS TO NAVIGATION: NOTAM FILE SCC.

(H) (H) VORW/DME 113.9 SCC Chan 86 N70°11.95' W148°24.97' 238° 1.0 NM to fld. 54/17E.

DME unusable:

143°-190° blo 2,300'

143°-190° byd 16 NM

VOR unusable:

145°-158° blo 3,000'

145°-158° byd 15 NM blo 4,000'

145°-158° byd 20 NM blo 5,000'

145°-158° byd 25 NM blo 6,000'

145°-158° byd 30 NM blo 10,000'

ILS/DME 109.3 I-SCC Chan 30 Rwy 06. Class IT. Auto pilot cpd apch NA blw 350'.

COMM/NAV/WEATHER REMARKS: Local call to Deadhorse FSS dial 659-2401. For a toll free call to Fairbanks FSS dial

1-866-248-6516. Wx obs when Deadhorse FSS clsd - 133.55 or 907-659-2401. AFIS operd by SCC FSS when open, OT Fairbanks FSS.

INIGOK (4AK1) PVT 96 W UTC-9(-8DT) N70°00.23' W153°04.65'

POINT BARROW

191 B NOTAM FILE FDC Not insp.

H-1A, L-4I

RWY 02-20: 5000X150 (GRVL) 0.6% up S

AIRPORT REMARKS: Unattended. Closed to the public. Bureau of Land Management (BLM) installation. All acct

oprs shall obtain a permit prior to intended ldg. Ctc the BLM Arctic fld Office, 1150 University Avenue, Fairbanks, AK 99709 (http://www.blm.gov/ak/st/en/fo/fdo/arctic_field_office.html) or call 907-474-2200 to apply for a permit 45 days prior to intended ldg. Failure to obtain and have onboard an apvd permit will result in trespass violations and possibly criminal and civ actions. Rwy not maintained, recommend visual inspection prior to ldg. Rwy 02 multiple soft spots last 2000'. 25' antenna 650' NW of Rwy 02.

AIRPORT MANAGER: 907-474-2200

COMMUNICATIONS: CTAF/UNICOM 122.8

COMM/NAV/WEATHER REMARKS: For a local call to Barrow FSS dial 852-2511. For a toll free call to Fairbanks FSS dial 1-866-248-6516.

DEADHORSE PTZ N70°08.36' W146°16.66'/56

POINT BARROW

AWOS-3P 125.125 (907) 685-3590 AWOS-3P associated with Point Thomson airstrip 37AA.