

CONNERSVILLE**METTEL FLD** (CEV)(KCEV) 3 N UTC-5(-4DT) N39°41.89' W85°07.87'**ST LOUIS**

866 B NOTAM FILE HUF

H-5E, 10F, L-27E**RWY 18-36:** H6503X100 (ASPH-GRVD) S-50, D-84, 2S-107 MIRL**IAP****RWY 18:** MALSR. PAPI(P4L)—GA 3.0° TCH 47'. Road.**RWY 36:** REIL. PAPI(P4L)—GA 3.0° TCH 34'. Trees.**RWY 04-22:** 2601X100 (TURF)**RWY 04:** Pole.**RWY 22:** Trees.**SERVICE:** FUEL 100LL, JET A LGT MIRL Rwy 18-36 preset to low intst; to incr intst and ACTVT MALSR Rwy 18; REIL Rwy 36; MIRL Rwy 18-36—CTAF.**AIRPORT REMARKS:** Attended 1300-2200Z±. Birds and deer on and in/ov arpt. Aft hr svc - 765-969-2586. Self-svc 24 hr.**AIRPORT MANAGER:** (765) 825-5581**WEATHER DATA SOURCES:** AWOS-3 118.325 (765) 827-6649.**COMMUNICATIONS:** CTAF/UNICOM 122.8® **COLUMBUS APP/DEP CON** 134.45**RADIO AIDS TO NAVIGATION:** NOTAM FILE HUF.**RICHMOND (L) DME** 113.65 RID Chan 83(Y) N39°45.30'

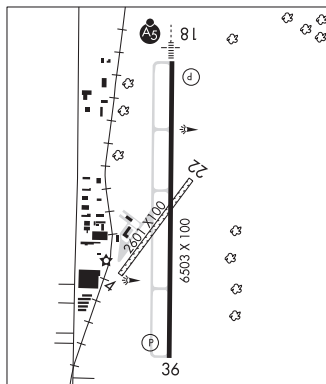
W84°50.33' 256° 14.0 NM to fld. 1135.

DME unusable:

025°-030° byd 35 NM

PNTHR NDB (LOMW) 227 SQ N39°46.63' W85°07.79' 185° 4.7 NM to fld. 917/4W.

ILS 108.35 I-SQK Rwy 18. LOM PNTHR NDB. ILS and LOM unmonitored.

COMM/NAV/WEATHER REMARKS: Columbus CLNC DEL (614) 338-8537.**CONVERSE** (118) 1 W UTC-5(-4DT) N40°34.39' W85°53.98'**CHICAGO**

840 NOTAM FILE HUF

RWY 07-25: H1800X40 (ASPH)**RWY 07:** Thld dsplcd 38'. Crops.**RWY 25:** Thld dsplcd 38'. Crops.**AIRPORT REMARKS:** Unattended. Radio controlled airplanes on and in/ov arpt. Rwy 07-25 75' wide conc ovld with 37' wide asph strip down mid of rwy. Rwy 07-25 extdd 46' equally at both ends.**AIRPORT MANAGER:** 765-395-3495**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD etc Chicago ARTCC at 630-906-8921.**CRAWFORDSVILLE RGNL** (CFJ)(KCFJ) 4 S UTC-5(-4DT) N39°58.48' W86°55.26'**ST LOUIS**

800 B NOTAM FILE HUF

L-27D**RWY 05-23:** H5506X75 (ASPH-GRVD) S-16, D-25 MIRL**IAP, AD****RWY 05:** REIL. PAPI(P4L)—GA 3.0° TCH 41'. Crops.**RWY 23:** REIL. PAPI(P4L)—GA 3.0° TCH 42'. Thld dsplcd 503'. Road.**SERVICE:** S4 FUEL 100LL, JET A, A+ LGT ACTVT REIL Rws 05 and 23—CTAF. MIRL Rwy 05-23 preset to low intst; incr intst—CTAF. Rwy 05 PAPI unusbl byd 8' left of cntrn.**AIRPORT REMARKS:** Attended 1400-2200Z±. Arpt CLOSED to Part 137 ops exc PPR 765-362-0070. Parachute Jumping.**AIRPORT MANAGER:** 765-362-0707**WEATHER DATA SOURCES:** AWOS-3PT 125.650 (765) 362-2967.**COMMUNICATIONS:** CTAF/UNICOM 122.8® **INDIANAPOLIS APP/DEP CON** 119.05**CLEARANCE DELIVERY PHONE:** For CD etc Indianapolis Apch at 317-227-5744.**RADIO AIDS TO NAVIGATION:** NOTAM FILE HUF.**BRICKYARD (VH) (H) VORTAC** 116.3 VHP Chan 110 N39°48.88' W86°22.05' 290° 27.3 NM to fld. 872/1E.

TACAN AZIMUTH unusable:

312°-346° byd 25 NM blo 4,000'

DME unusable:

312°-346° byd 25 NM blo 4,000'

VOR unusable:

054°-064° byd 40 NM blo 2,900'

054°-064° byd 57 NM

NDB (MHW) 388 CFJ N39°58.86' W86°54.94' at fld. 803/4W.

Unmonitored

CROOKED LAKE SPB (See ANGOLA on page 93)