

ELKHART

ELKHART MUNI (EKM)(KEKM) 3 NW UTC-5(-4DT) N41°43.16' W86°00.19'

CHICAGO

778 B NOTAM FILE EKM

H-5E, 10F, L-281

RWY 09-27: H6500X120 (CONC-GRVD) S-40, D-60, 2D-120 HIRL

IAP, AD

RWY 09: REIL. VASI(V4L)—GA 3.0° TCH 38'. RVR-R Trees.

RWY 27: MALSR. PAPI(P4L)—GA 3.0° TCH 46'. RVR-T Trees.

RWY 18-36: H3999X75 (ASPH-GRVD) S-45, D-65, 2S-82 MIRL

RWY 18: REIL. PAPI(P4L)—GA 3.0° TCH 38'. Trees.

RWY 36: REIL. VASI(V4L)—GA 4.0° TCH 57'. Trees.

RWY 08-26: 2480X250 (TURF)

RUNWAY DECLARED DISTANCE INFORMATION

RWY 08: TORA-2480 TODA-2480 ASDA-2480 LDA-2480

RWY 09: TORA-6500 TODA-6500 ASDA-6500 LDA-6500

RWY 18: TORA-4001 TODA-4001 ASDA-4001 LDA-4001

RWY 26: TORA-2480 TODA-2480 ASDA-2480 LDA-2480

RWY 27: TORA-6500 TODA-6500 ASDA-6500 LDA-6500

RWY 36: TORA-4001 TODA-4001 ASDA-4001 LDA-4001

SERVICE: S3 FUEL 100LL, JET A OX4 LGT ACTIVATE MALSR Rwy

27, REIL Rwy 09, Rwy 18 and Rwy 36, VASI Rwy 09 and Rwy 36,

PAPI Rwy 18 and Rwy 27—CTAF. When twr clsd HIRL Rwy 09-27,

MIRL Rwy 18-36 preset low intst; incr intst—CTAF. Rwy 36 VASI

unusb1 7° left and right of cntrln.

AIRPORT REMARKS: Attended 1100-0300Z†. Rwy 08-26 mkd white corner

mkrs. VFR ops during twr hrs only. Twy mkd with reflectors, Twy A unavbl to acft with more than 30 pax seats. Rwy 18-36 cntrln and striping faded.

AIRPORT MANAGER: 574-264-5217

WEATHER DATA SOURCES: AWOS-3 124.475 (574) 264-9002.

COMMUNICATIONS: CTAF 119.5 UNICOM 122.95

Ⓡ **SOUTH BEND APP/DEP CON** 118.55 (1030-0500Z† Mon-Fri, 1030-2200Z† Sun) other times ctc

Ⓡ **CHICAGO CENTER APP/DEP CON** 127.55

TOWER 119.5 (1200-0200Z† Mon-Fri, 1300-2300Z† Sat-Sun) **GND CON** 121.8

CLNC DEL 121.8 119.7 (When Elkhart twr clsd).

CLEARANCE DELIVERY PHONE: For CD when ATCT clsd, ctc South Bend ATCT on freq. When South Bend ATCT clsd, ctc Chicago ARTCC at 630-906-8921.

AIRSPACE: CLASS D svc 1200-0200Z† Mon-Fri, 1300-2300Z† Sat-Sun; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAN.

GIPPER (H) (H) VORTACW 115.4 GJ J Chan 101 N41°46.12' W86°19.11' 102° 14.5 NM to fld. 804/OE.

TACAN AZIMUTH unusable:

245°-255°

276°-306° byd 25 NM blo 3,000'

307°-312° byd 25 NM blo 4,500'

313°-331° byd 25 NM blo 3,000'

DME unusable:

276°-306° byd 25 NM blo 3,000'

307°-312° byd 25 NM blo 4,500'

313°-331° byd 25 NM blo 3,000'

GOSHEN (H) TACAN Chan 84 GSH (113.7) N41°31.51' W86°01.68' 005° 11.7 NM to fld. 852/OE. NOTAM

FILE GSH.


TAC AZM unusable:

071°-129°

DME unusable:

076°-086° byd 30 NM

ILS 111.5 I-OUP Rwy 27. Class IB.

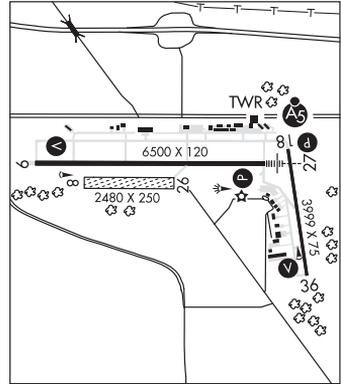

MISHAWAKA PILOTS CLUB (3C1) 3 SW UTC-5(-4DT) N41°39.42' W86°02.08'

CHICAGO

755 B NOTAM FILE HUF

RWY 12-30: 3140X100 (TURF)

RWY 12: Thld dsplcd 690'. Trees.

RWY 30: Thld dsplcd 520'. Trees.

RWY 03-21: H2243X40 (ASPH) LIRL

RWY 03: Thld dsplcd 187'. Road.

RWY 21: Thld dsplcd 200'. Road.

AIRPORT REMARKS: Attended irregularly. Arpt bcn OTS indefly. Rwy end 12: nstd gnd mkrs. Rwy end 30: nstd gnd mkrs.

AIRPORT MANAGER: (574) 675-7575

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc South Bend Apch 574-251-2609. When South Bend Apch clsd, for CD ctc Chicago ARTCC at 630-906-8921.