

KANKAKEE**GREATER KANKAKEE** (IKK)(KIKK) 3 S UTC-6(-5DT) N41°04.28' W87°50.78'**CHICAGO**
H-5E, L-27C
IAP

630 B NOTAM FILE IKK

RWY 04-22: H5981X100 (ASPH-PFC) S-60, D-95 HIRL

RWY 04: MALSR. PAPI(P4L)—GA 3.0° TCH 51'.

RWY 22: REIL. PAPI(P4L)—GA 3.0° TCH 37'.

RWY 16-34: H4398X75 (ASPH-GRVD) S-30, D-40 MIRL

RWY 16: PAPI(P4L)—GA 3.0° TCH 40'. Tree.

RWY 34: PAPI(P4L)—GA 3.0° TCH 37'.

SERVICE: S2 FUEL 100LL, JET A LGT ACTVT MALSR Rwy 04; REIL

Rwy 22; HIRL Rwy 04-22; MIRL Rwy 16-34—CTAF. HIRL Rwy

04-22 preset to low intst; to incr intst—CTAF.

AIRPORT REMARKS: Attended 1330-2330Z†. Deer and waterfowl on and in/ovf.

AIRPORT MANAGER: 815-939-1422

WEATHER DATA SOURCES: AWOS-3 128.475 (815) 939-4044.

COMMUNICATIONS: CTAF/UNICOM 123.0

® CHICAGO CENTER APP/DEP CON 132.5

CLEARANCE DELIVERY PHONE: For CD ctc Chicago ARTCC at 630-906-8921.

RADIO AIDS TO NAVIGATION: NOTAM FILE IKK.

PEOTONE (L) (L) VORTACW 113.2 EON Chan 79 N41°16.18'


W87°47.46' 190° 12.1 NM to fld. 689/2E.

LUKOW NDB (LOMW) 272 IK N41°01.07'

W87°54.23' 043° 4.1 NM to fld. 669/4W.

ILS 108.7 I-IKK Rwy 04. Class IT. LOM LUKOW NDB. Unmonitored.

COMM/NAV/WEATHER REMARKS: Can contact Chicago Center on ground 132.5.

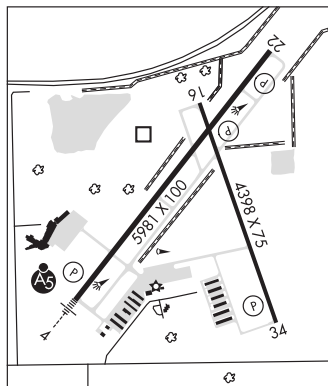**KANKAKEE** (3KK) 3 SW UTC-6(-5DT) N41°06.00' W87°55.00'**CHICAGO**

625 TPA—1425(800) NOTAM FILE IKK

RWY 09-27: 2644X300 (TURF) LIRL(NSTD)

RWY 27: Thld dsplcd 285'. Road.

RWY 18-36: 2564X200 (TURF)

RWY 18: Brush.

RWY 36: Thld dsplcd 900'. Trees.

SERVICE: S4 LGT Rwy 09-27 NSTD LIRL; variable ints and spacing and non-frangible mountings.

AIRPORT REMARKS: Attended Mon-Fri 1300-0100Z†, Sat-Sun irregularly. Contact manager in advance for rwy lgts. Ultralight activity on and in/ovf arpt. Rwy 27 and Rwy 36 dsplcd thld marked with white rocks. 400 ft ovrn end of Rwy 27.

AIRPORT MANAGER: 815-932-4222

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Chicago ARTCC at 630-906-8921.

Kewanee Muni (EZI)(KEZI) 3 SW UTC-6(-5DT) N41°12.31' W89°57.83'**CHICAGO**
L-27C
IAP

858 B TPA—See Remarks NOTAM FILE IKK

RWY 09-27: H4500X75 (ASPH) S-20 MIRL

RWY 09: PVASI(P5IL)—GA 3.5° TCH 27'.

RWY 27: PVASI(P5IL)—GA 3.0° TCH 23'.

RWY 01-19: H3200X60 (ASPH) S-20 MIRL 0.5% up S

SERVICE: S4 FUEL 100LL LGT MIRL Rwy 09-27 preset on low ints; to

increase ints and ACTIVATE MIRL Rwy 01-19 and twy lgts—CTAF.

Rwy 09 PVASI unusable byd 6° left and right of centerline. Rwy 27

PVASI unusable byd 6° left and right of centerline.

AIRPORT REMARKS: Attended Mon-Fri 1400-0000Z†, Sat-Sun

1500-2300Z†. Ultralight acft on and in/ovf arpt. Hospital heliport 1.2

NM northeast of arpt. TPA—1258 (400) ultralight acft. 100LL 24 hr

fuel avbl with credit card.


AIRPORT MANAGER: 309-853-8671

COMMUNICATIONS: CTAF/UNICOM 122.8

® QUAD CITY APP/DEP CON 133.275 (1130-0430Z†)

® CHICAGO CENTER APP/DEP CON 118.75 (0430-1130Z†)

CLEARANCE DELIVERY PHONE: For CD ctc Chicago ARTCC at 630-906-8921.

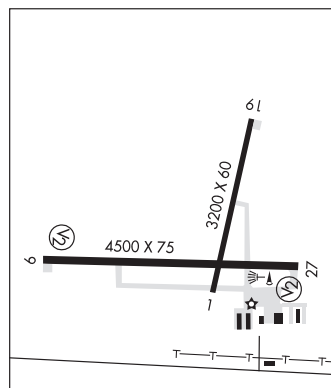

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE IKKBRADFORD (H) TACAN Chan 94 BDF (114.7) N41°09.58'

W89°35.27' 279° 17.3 NM to fld. 810/OE.

VOR portion unusable:

189°-199° blo 3,500' btn 25 and 35 NM

COMM/NAV/WEATHER REMARKS: Automated wx adzy avbl on CTAF-4 mic clicks to ACTVT. 5 clicks is abbreviated "wind only".

RADIO AIDS TO NAVIGATION: NOTAM FILE IKKBRADFORD (H) TACAN Chan 94 BDF (114.7) N41°09.58'

W89°35.27' 279° 17.3 NM to fld. 810/OE.

VOR portion unusable:

189°-199° blo 3,500' btn 25 and 35 NM

COMM/NAV/WEATHER REMARKS: Automated wx adzy avbl on CTAF-4 mic clicks to ACTVT. 5 clicks is abbreviated "wind only".

LACON

MARSHALL CO (C75) 1 E UTC-6(-5DT) N41°01.13' W89°23.15'

585 B NOTAM FILE C75

RWY 13-31: H4003X75 (ASPH) MIRL 1.1% up SE

RWY 13: REIL.

RWY 31: PAPI(P4L)—GA 4.0° TCH 20'. Ground. Rgt tfc.

RWY 18-36: H2199X50 (ASPH) S-4 LIRL 0.3% up N

RWY 18: Road.

SERVICE: S4 FUEL 100LL, UL94 LGT ACTVT MIRL Rwy 13-31; REIL Rwy 13 and PAPI Rwy 31—CTAF.

NOISE: Rwy 31 departures encouraged to begin right turn as soon as practical for noise abatement. Rwy 31 R tfc and Rwy 13 L tfc due to noise abatement.

AIRPORT REMARKS: Attended 1400-2300Z†. Birds and animals on and invof arpt. Fuel 100LL and UL94 avbl 24hr self svc via credit card.

AIRPORT MANAGER: 309-246-2870

WEATHER DATA SOURCES: AWOS-3 119.425 (309) 246-3089.

COMMUNICATIONS: CTAF/UNICOM 122.8

® CHICAGO CENTER APP/DEP CON 124.55

CLEARANCE DELIVERY PHONE: For CD ctc Chicago ARTCC at 630-906-8921.


RADIO AIDS TO NAVIGATION: NOTAM FILE IKK.

BRADFORD (H) TACAN Chan 94 BDF (114.7) N41°09.58'

W89°35.27' 133° 12.5 NM to fld. 810/OE.

VOR portion unusable:

189°-199° blo 3,500' btn 25 and 35 NM

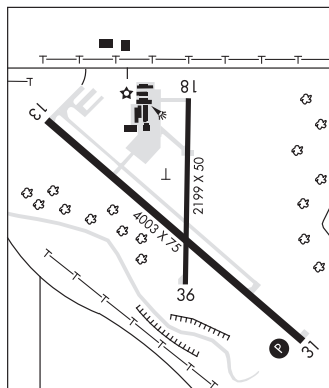

CHICAGO

L-27C

IAP

LAKE IN THE HILLS (See CHICAGO/LAKE IN THE HILLS on page 46)

LANSING MUNI (See CHICAGO on page 45)

LAWRENCEVILLE-VINCENNES INTL (LWV)(KLWV) 3 NE UTC-6(-5DT) N38°45.86' W87°36.33'

430 B TPA—See Remarks NOTAM FILE LWV

RWY 18-36: H5199X100 (ASPH) S-75, D-100, 2D-180 MIRL

RWY 18: REIL. PVASI(PSIL)—GA 3.0° TCH 25'.

RWY 36: REIL. PAPI(P4L)—GA 3.0° TCH 41'.

RWY 09-27: H5198X100 (ASPH) S-75, D-100, 2D-180 MIRL

RWY 09: REIL. PVASI(PSIL)—GA 3.0° TCH 26'.

RWY 27: ODALS. REIL. PAPI(P4L)—GA 3.0° TCH 26'.


RWY 04U-22U: 1000X200 (TURF)

RWY 22U: Rgt tfc.

SERVICE: FUEL 100LL, JET A LGT ACTIVATE ODALS Rwy 27; REIL Rwy 09, 27, 18 and 36; PAPI Rwy 36; MIRL Rwy 09-27—CTAF. MIRL Rwy 18-36 preset on low instst to incr instst—CTAF. BE ALERT: ODALS for Rwy 27 are in operation simultaneously with REILS on Rwy 18. Rwy 09 and Rwy 18 PVASI unusable byd 8° left of centerline and byd 6° right of centerline.

AIRPORT REMARKS: Attended Mon-Fri 1300-0000Z†, Sat-Sun 1500-2300Z†. Glider activity SR-SS. Rwy 09-27 and Rwy 18-36 have left hand tfc pattern for glider acft. Traffic pattern indicators on sod Rwy 04U-22U. TPA—Rwy 09-27 and Rwy 18-36 1330 (900) powered acft, Rwy 04U-22U 930 (500) max ultralights.

AIRPORT MANAGER: 618-943-5733

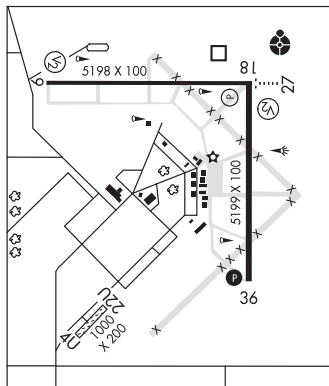

ST LOUIS

H-5E, L-2D

IAP

CONTINUED ON NEXT PAGE