

OBERLIN MUNI (OIN)(KOIN) 1 NW UTC-6(-5DT) N39°50.06' W100°32.39'

2707 B NOTAM FILE ICT

RWY 17-35: H4301X60 (ASPH) S-12.5 MIRL 0.9% up N

RWY 17: PAPI(P2L)—GA 3.0° TCH 45'.

RWY 35: PAPI(P2L)—GA 3.0° TCH 43'. Thld dspcd 800'.

RWY 12-30: 2832X130 (TURF) 1.2% up NW

RWY 30: Trees.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 17: TORA-3501 TODA-4301 ASDA-4301 LDA-4301

RWY 35: TORA-4301 TODA-4301 ASDA-4301 LDA-3501

SERVICE: S4 FUEL 100LL LGT ACTVT MIRL Rwy 17-35—CTAF.

AIRPORT REMARKS: Attended dawn-dusk.

AIRPORT MANAGER: 785-470-0019

WEATHER DATA SOURCES: AWOS-3PT 119.225 (785) 470-4236.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **DENVER CENTER APP/DEP CON** 132.7

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE HLC.

HILL CITY (VH) (H) VORTAC 113.7 HLC Chan 84 N39°15.52'

W100°13.55' 329° 37.5 NM to fld. 2690/8E.


VOR unusable:

271°-274° byd 40 NM

279°-289° byd 40 NM blo 4,800'

279°-289° byd 47 NM

WICHITA
L-10H
IAP

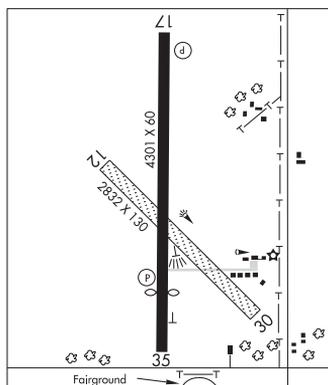

OLATHE

CEDAR AIR PARK (51K) 4 NW UTC-6(-5DT) N38°55.87' W94°53.09'

KANSAS CITY

1024 NOTAM FILE COU

RWY 17-35: 2440X75 (TURF) 0.9% up S

RWY 17: Trees.

RWY 35: Trees.

AIRPORT REMARKS: Unattended. Wildlife on and invof arpt. Trees both sides of rwy. Golf course north end of Rwy 17 can be mistaken for arpt. Rwy 17 outlined with concrete pads at 300' intervals. Rwy 17 ends marked with yellow concrete pads.

AIRPORT MANAGER: 913-782-5176

COMMUNICATIONS: CTAF/UNICOM 122.7

CLEARANCE DELIVERY PHONE: For CD ctc Kansas City Apch at 816-329-2710.