

COLONEL JAMES JABARA (AAO)(KAAO) 9 NE UTC-6(-5DT) N37°44.85' W97°13.27'

WICHITA

1421 B NOTAM FILE AAO

H-5C, L-101, 15D

RWY 18-36: H6101X100 (CONC-GRVD) S-40, D-62 PCN 15 R/B/X/T

IAP

MIRL 0.3% up S

RWY 18: MALSR. PAPI(P4L)—GA 3.0° TCH 45'. Rgt tfc.

RWY 36: REIL. PAPI(P4L)—GA 3.0° TCH 45'.

SERVICE: S4 **FUEL** 100LL, JET A **LGT ACTVT** MIRL Rwy 18-36, MALSR Rwy 18, REIL Rwy 36—CTAF. **FUEL** For 24 hr fuel contact FBO.

AIRPORT REMARKS: Attended continuously. Migratory birds on and in vcnty of arpt. For 24 hour fuel contact FBO 316-636-9700. PPR for acft carrying Class 1 Division 1.1, 1.2 or 1.3 explosives as defined by 49 CFR 173.50. McConnell AFB 9 miles S and Beech Factory arpt 3 miles S. Beech Factory Arpt Class D airspace 1 mile S Rwy 18. Southerly and southeasterly VFR arr and dep not recommended without ATC radar svcs due to Beech factory arpt and McConnell AFB Class D airspace. VFR arr and dep recommended to mn at or blw 2,500 MSL within 5 miles due to heavy mil tfc 3,000' MSL. No line of sight between rwy ends. Engine runs—ups not permitted on acft ramps. Rwy 36 dsngd calm wind rwy.

AIRPORT MANAGER: 316-946-4700

WEATHER DATA SOURCES: ASOS 134.025 (316) 636-2541.

COMMUNICATIONS: CTAF/UNICOM 122.7

® **WICHITA APP/DEP CON** 134.8

WICHITA CLNC DEL 125.0

AIRSPACE: CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE ICT.

WICHITA (H) (H) VORTACW 113.8 ICT Chan 85 N37°44.72' W97°35.03' 082° 17.3 NM to fld. 1472/7E.

TACAN AZIMUTH unusable:

025°-035° blo 4,000'

040°-055° byd 20 NM


147°-159° blo 4,900'

VOR unusable:

025°-035° blo 4,000'

147°-159° blo 4,400'

ILS/DME 109.55 I-AAO Chan 32(Y) Rwy 18. Class IT.

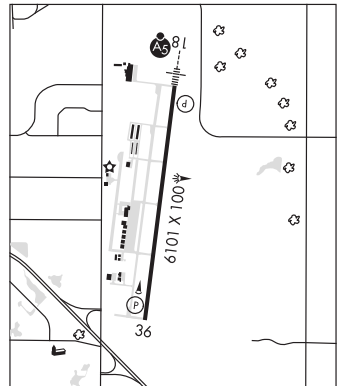

WESTPORT (71K) 3 SW UTC-6(-5DT) N37°38.86' W97°23.02'

WICHITA

1290 NOTAM FILE ICT

RWY 17-35: H2520X30 (ASPH) S-3

RWY 17: Thld dsplcd 400'. Pole.

RWY 35: Fence. Rgt tfc.

SERVICE: S4 **FUEL** 100LL

AIRPORT REMARKS: Attended dalgt hours. Departures ctc Wichita twr on the ground on frequency 125.7 for departure instructions. If unable—ctc twr on frequency 118.2 upon departure and remain east of the fld until communications are established. Rwy 17-35 grass encroaching on rwy sides numerous surface cracks.

AIRPORT MANAGER: 316-943-5510

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Wichita Apch at 316-350-1520.

WESTPORT AUXILIARY (72K) 5 SW UTC-6(-5DT) N37°36.25' W97°21.53'

WICHITA

1272 NOTAM FILE ICT

RWY 17-35: 2550X50 (TURF)

RWY 17: P-line.

RWY 35: Trees.

AIRPORT REMARKS: Unattended. If conditions favorable, balloon traffic in area. Road crosses north end Rwy 17-35. 775 ft m AER 17 large ridge at crossing. Crops both sides of Rwy 17-35. Edge drop off along east edge Rwy 17-35. Rwy 17-35 surface rough and bumpy. 10 ft dirt rd crosses rwy 780 ft m N end.

AIRPORT MANAGER: 316-943-5510

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Wichita Apch at 316-350-1520.