

**HASTINGS MUNI** (HSI)(KHSI) 2 NW UTC-6(-5DT) N40°36.32' W98°25.67'OMAHA  
H-5B, L-10H  
IAP

1961 B NOTAM FILE HSI

RWY 14-32: H6451X100 (CONC) S-36, D-58, 2D-106 MIRL

0.4% up NW

RWY 14: REIL. PAPI(P4L)—GA 3.0° TCH 38'.

RWY 32: REIL. PAPI(P4R)—GA 3.0° TCH 42'. Thld dsplcd 950'.  
Road.

RWY 04-22: H4501X75 (CONC) S-36, D-47 MIRL

RWY 04: PAPI(P2L)—GA 3.0° TCH 40'.

RWY 22: PAPI(P2L)—GA 3.0° TCH 40'.

**RUNWAY DECLARED DISTANCE INFORMATION**

RWY 14: TORA-5500 TODA-6451 ASDA-5500 LDA-5500

RWY 32: TORA-6451 TODA-6451 ASDA-6451 LDA-5500

SERVICE: S4 FUEL 100LL, JET A LGT ACTIVATE MIRL Rwy 04-22  
and Rwy 14-32; PAPI Rwy 04-22 and Rwy 14-32; REIL Rwy 14  
and Rwy 32—CTAF.AIRPORT REMARKS: Attended Mon-Fri 1400-2300Z±. Self-svc fuel avbl 24  
hrs. Fuel injection additives avbl.

AIRPORT MANAGER: 402-984-5223

WEATHER DATA SOURCES: ASOS 120.525 (402) 463-4029.

COMMUNICATIONS: CTAF/UNICOM 122.8

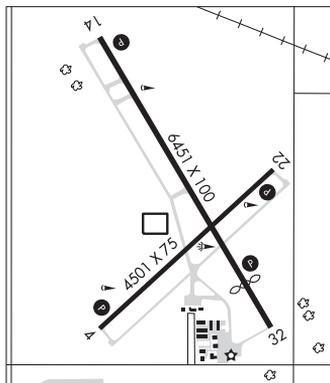
® MINNEAPOLIS CENTER APP/DEP CON 119.4

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

AIRSPACE: CLASS E svc 1200-0430Z± Mon-Fri, 1200-2000Z± Sat, 1600-0430Z± Sun; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE HSI.

(L) DME 108.8 HSI Chan 25 N40°36.27' W98°25.78' at fld. 1957.

**HAY SPRINGS MUNI** (4V6) 0 SW UTC-7(-6DT) N42°40.92' W102°42.04'

CHEYENNE

3831 B NOTAM FILE OLU

RWY 11-29: 2775X300 (TURF) MIRL 0.4% up W

RWY 29: Thld dsplcd 205'. Pole.

SERVICE: LGT ACTIVATE MIRL Rwy 11-29 and rotating bcn—CTAF.

AIRPORT REMARKS: Unattended. Rwy 11-29 NSTD markings, marked with yellow cones around lgts.

AIRPORT MANAGER: 308-638-7275

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

**HAYES CENTER** N40°27.24' W100°55.41' NOTAM FILE OLU.OMAHA  
H-5B, L-10G

(VH) (H) VORTAC 117.7 HCT Chan 124 051° 23.4 NM to Curtis Muni. 3010/11E.

RCO 122.1R 117.7T (COLUMBUS RADIO)

**HEBRON MUNI** (HJH)(KHJH) 1 S UTC-6(-5DT) N40°09.12' W97°35.07'OMAHA  
L-10I  
IAP

1468 B NOTAM FILE HJH

RWY 12-30: H3600X60 (CONC) S-30 MIRL

RWY 12: REIL. PAPI(P2L)—GA 3.9° TCH 52'. Tree.

RWY 30: REIL. PAPI(P2L)—GA 3.0° TCH 40'. Road.

RWY 03-21: 2513X150 (TURF) 0.7% up SW

RWY 03: Trees.

SERVICE: FUEL 100LL, JET A LGT ACTVAT MIRL Rwy 12-30; PAPI  
Rwy 12 and Rwy 30; REIL Rwy 12 and Rwy 30—CTAF. MAINT  
Airframe and pwr plant rprs by apntmt only.AIRPORT REMARKS: Unattended. Fuel: 100LL: Fuel avbl H24 via credit  
card. If unavbl call 402-768-6597. Rwy 03 mkd with reflectors and  
yellow cones. Rwy 21 mkd with reflectors and yellow cones.

AIRPORT MANAGER: (402) 768-6597

WEATHER DATA SOURCES: AWOS-3 118.525 (402) 768-2501.

COMMUNICATIONS: CTAF 122.9

® MINNEAPOLIS CENTER APP/DEP CON 126.4

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at  
651-463-5588.

RADIO AIDS TO NAVIGATION: NOTAM FILE ICT.

MANKATO (L) TACAN Chan 35 TKO (109.8) N39°48.38'

W98°15.60' 046° 37.4 NM to fld. 1880/10E.

