

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE DVL.

(DH) DME 114.75 DVL Chan 94(Y) N48°06.91' W98°54.75' at fld. 1448.

ILS 108.7 I-VKE Rwy 31. Unmonitored.

DICKINSON/THEODORE ROOSEVELT RGNL (DIK)(KDIK) 5 S UTC-7(-6DT) N46°48.03'**BILLINGS**

H-2H, L-14F

IAP, AD

W102°48.27'

2592 B TPA—See Remarks Class I, ARFF Index A NOTAM FILE DIK

RWY 14-32: H7301X150 (CONC-GRVD) S-60, D-90, 2D-90

PCR 440 R/D/W/T HIRL

RWY 14: REIL. PAPI(P4L)—GA 3.0° TCH 50'. Pole.**RWY 32:** MALSR. PAPI(P4L)—GA 3.0° TCH 50'. Road.**RWY 07-25:** H4700X75 (ASPH-GRVD) S-16, D-20 PCR 60 F/D/X/T

MIRL 0.4% up E No Part 121/Part 380 Ops

RWY 07: REIL. PAPI(P4L)—GA 3.0° TCH 27'.**RWY 25:** REIL. PAPI(P4L)—GA 3.0° TCH 28'. Road.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 07:** TORA-4700 TODA-4700 ASDA-4700 LDA-4700**RWY 14:** TORA-7301 TODA-7301 ASDA-7301 LDA-7301**RWY 25:** TORA-4700 TODA-4700 ASDA-4700 LDA-4700**RWY 32:** TORA-7301 TODA-7301 ASDA-7301 LDA-7301**SERVICE:** S4 FUEL 100LL, JET A LGT ACTVT MALSR Rwy 32; REIL

Rwy 14, 07 & 25; PAPI Rwy 14 & 32; HIRL Rwy 14-32—CTAF. PAPI

Rwy 07 & 25 opr consly SS-SR. MIRL Rwy 07-25 preset on low instst dusk-0500Z†; to incr instst aft 0500Z†—CTAF.

AIRPORT REMARKS: Attended 1400-2300Z†. For svc aft hrs call

701-264-9966. Crop dusting operations invof arpt. Airfield sfc conds unmon btn 0600 and 1130Z†. Haying operations adjacent to all surfaces Jun-Sep. PAEW on movement areas during winter (Oct-Apr). TPA—single engine 3602 (1010); multiengine 4102 (1510). Conc apron for heavy acft parking.

AIRPORT MANAGER: 701-483-1062**WEATHER DATA SOURCES:** ASOS 118.375 (701) 227-0280.**COMMUNICATIONS:** CTAF/UNICOM 123.0

RCO 122.2 (GRAND FORKS RADIO)

⑧ MINNEAPOLIS CENTER APP/DEP CON 124.25

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Minneapolis ARTCC at 651-463-5588.**AIRSPACE:** CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE DIK.

(VH) (H) VORTACW 112.9 DIK Chan 76 N46°51.60' W102°46.41' 186° 3.8 NM to fld. 2527/14E.

VOR unusable:

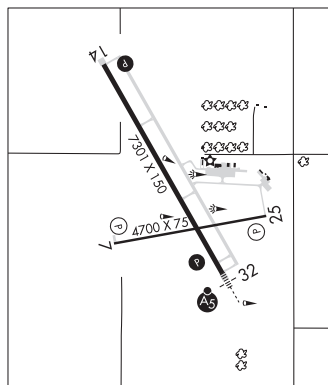
005°-015°

180°-230° byd 40 NM

190°-200°

260°-270°

ILS/DME 108.3 I-DIK Chan 20 Rwy 32. Class IE. Unmonitored.

**DRAYTON MUNI** (D29) 3 N UTC-6(-5DT) N48°37.11' W97°10.55'**TWIN CITIES**

798 B NOTAM FILE GFK

RWY 17-35: H2596X60 (ASPH) S-4 LIRL**RWY 35:** Thld dsplcd 505'.**SERVICE:** LGT LIRL Rwy 17-35 opr dusk-0600Z†, after 0600Z†, ACTIVATE LIRL Rwy 17-35 —CTAF.**AIRPORT REMARKS:** Unattended. For svc call 701-454-6588. Confirm winter conditions and snow removal before use, call 701-454-3590 or 701-454-6588. Rwy 35 dsplcd thld ngt ops only. Rwy 17 cultivated fld 20 ft fm thr. Rwy 17 mkggs heavily worn & faded. Rwy 35 mkggs heavily worn & faded.**AIRPORT MANAGER:** 701-520-1219**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.**DUNN CO WEYDAHL FLD** (See KILLDEER on page 343)