

MIDDLETOWN

RANDALL (Ø6N) 2 SE UTC-5(-4DT) N41°25.91' W74°23.49'

NEW YORK
L-33A, 34H
IAP

523 NOTAM FILE ISP

RWY 08-26: H2810X60 (ASPH) S-25 MIRL 0.6% up E

RWY 08: PAPI(P2L)—GA 4.0° TCH 44'. Thld dspclcd 563'. Road.

RWY 26: PAPI(P2R)—GA 4.0° TCH 30'. Trees.

SERVICE: LGT ACTVT PAPI RWY 08; MIRL RWY 08-26—CTAF. Several rwy and twy lgts OTS indef.

AIRPORT REMARKS: Unattended. Hvy glider and hang glider act on wkends and hols. Ultralgt on and invof of arpt. RWY 08-26 SW strength is 12.5. RWY 08 markings very badly faded.

AIRPORT MANAGER: 845-343-5965

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ NEW YORK APP/DEP CON 132.75

CLEARANCE DELIVERY PHONE: For CD ctc New York Apmh at 516-683-2448.

RADIO AIDS TO NAVIGATION: NOTAM FILE ISP.

HUGUENOT (H) (H) VOR/DME 116.1 HUGO Chan 108 N41°24.58' W74°35.50' 093° 9.1 NM to fld. 1300/11W.

VOR unusable:

029°-045°

050°-060° byd 10 NM


061°-079°

210°-230° byd 20 NM blo 6,500'

DME unusable:

037°-048° byd 20 NM

215°-225° byd 33 NM

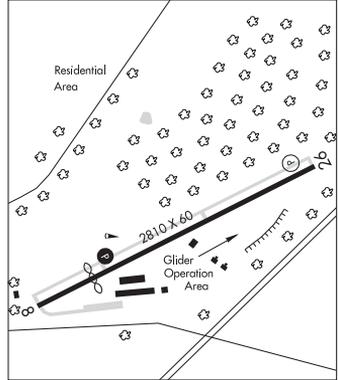

MIDLAKES (See GORHAM on page 206)

MILLBROOK

SKY ACRES (44N) 6 SW UTC-5(-4DT) N41°42.45' W73°44.28'

NEW YORK
L-33B, 34I
IAP

697 NOTAM FILE ISP

RWY 17-35: H3828X60 (ASPH) S-20 MIRL 1.3% up S

RWY 17: Trees.

RWY 35: PAPI(P2L)—GA 3.0° TCH 33'. Trees.

SERVICE: S4 FUEL 100LL LGT SS-SR ACTVT PAPI RWY 35; MIRL RWY 17-35—CTAF. PAPI RWY 35 unusbl 8 degs right of cntrln.

AIRPORT REMARKS: Attended 1300-2100Z. Self-svc fuel avbl 24 hrs. RWY 17-35 safety areas have 30' dropoffs sloping 20' from thld at both ends. Parallel twy not lgtd. Cold temperature airport. Altitude correction required at or below -22C.

AIRPORT MANAGER: 845-677-5010

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ NEW YORK APP/DEP CON 132.75

CLEARANCE DELIVERY PHONE: For CD ctc New York Apmh at 516-683-2448

RADIO AIDS TO NAVIGATION: NOTAM FILE ISP.

KINGSTON (VL) (L) VOR/DME 117.6 IGN Chan 123 N41°39.93' W73°49.33' 068° 4.5 NM to fld. 581/12W.

VOR unusable:

008°-018° byd 40 NM blo 4,000'

008°-018° byd 70 NM

020°-123° byd 40 NM

045°-050° byd 35 NM blo 4,300'

070°-140° byd 30 NM blo 3,400'

082°-092° byd 20 NM blo 4,000'

082°-092° byd 35 NM blo 5,500'

130°-148° byd 40 NM

203°-216° byd 30NM


243°-253° byd 40 NM

275°-310° byd 40 NM

311°-321° byd 40 NM blo 6,000'

311°-321° byd 64 NM

322°-001° byd 40 NM

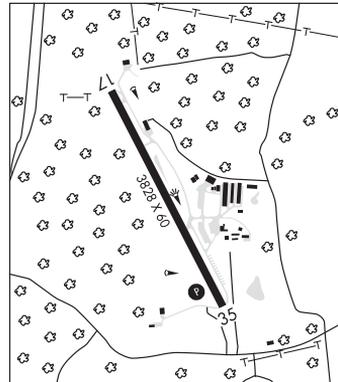

MISSE N44°51.25' W74°54.95' NOTAM FILE MSS.

NDB (LOMW) 278 MS 045° 5.8 NM to Massena Intl-Richards Fld. 245/14W.