

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE BTV.

BURLINGTON (VL) (L) VORW/DME 117.5 BTW Chan 122 N44°23.83' W73°10.96' 186° 24.9 NM to fld. 417/15W.

VOR unusable:

030°-086° byd 40 NM
 075°-132° byd 30 NM blo 9,000'
 087°-097° byd 40 NM blo 9,000'
 087°-097° byd 49 NM
 098°-169° byd 40 NM
 133°-165° byd 30 NM blo 8,000'
 170°-180° byd 40 NM blo 5,800'
 170°-180° byd 47 NM
 181°-196° byd 40 NM
 244°-292° byd 40 NM
 340°-350° byd 40 NM blo 6,000'
 351°-010° byd 40 NM

DME unusable:

075°-132° byd 30 NM blo 9,000'
 133°-165° byd 30 NM blo 8,000'

MONTPELIER N44°05.13' W72°26.96' NOTAM FILE MPV.

MONTREAL

(VL) (DH) VORW/DME 116.9 MPV Chan 116 342° 8.6 NM to Edward F Knapp State. 2086/16W.

L-32G

VOR unusable:

010°-020° byd 25 NM blo 7,500'
 015°-031° byd 40 NM
 032°-042° byd 40 NM blo 5,000'
 032°-042° byd 65 NM
 043°-060° byd 40 NM
 043°-070° byd 40 NM blo 9,100'
 045°-060° byd 24 NM blo 8,500'
 170°-182° byd 40 NM
 210°-275° byd 40 NM

DME unusable:

043°-070° byd 40 NM
 045°-060° byd 24 NM blo 8,500'

RCO 122.2 (BURLINGTON RADIO)**RCO** 122.6 (BURLINGTON RADIO)**MORRISVILLE-STOWE STATE** (MVL)(KMVL) 2 SW UTC-5(-4DT) N44°32.06' W72°36.84'

MONTREAL

733 B NOTAM FILE MVL

L-32G

RWY 01-19: H4200X75 (ASPH) S-25 PCN 12 F/A/X/T HIRL

IAP


0.4% up N

RWY 01: REIL. Thld dsplcd 250'. Trees.**RWY 19:** REIL. PAPI(P2L)—GA 3.5° TCH 31'. Thld dsplcd 250'.**SERVICE:** FUEL 100LL, JET A LGT ACTVT REIL Rwy 01 and 19, PAPI Rwy 19, HIRL Rwy 01-19—CTAF.

AIRPORT REMARKS: Unattended. Rwy conds not mnt when unatndd. 3 ft swales mid 1/3 of rwy on E & W sides outside of rwy safety area.
 100LL and A fuel self svc only. Cold temperature airport. Altitude correction required at or below -19C.

AIRPORT MANAGER: 802-279-9746**WEATHER DATA SOURCES:** ASOS 135.625 (802) 888-7934.**COMMUNICATIONS:** CTAF/UNICOM 122.8

® BOSTON CENTER APP/DEP CON 135.7

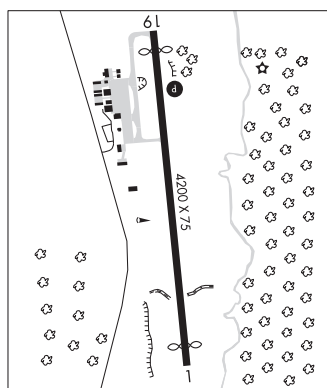CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE BTV.

BURLINGTON (VL) VOR/DME 117.5 BTV Chan 122 N44°23.83' W73°10.96' 086° 25.8 NM to fld. 417/15W.

VOR unusable:

030°-086° byd 40 NM
 075°-132° byd 30 NM blo 9,000'
 087°-097° byd 40 NM blo 9,000'
 087°-097° byd 49 NM
 098°-169° byd 40 NM
 133°-165° byd 30 NM blo 8,000'
 170°-180° byd 40 NM blo 5,800'
 170°-180° byd 47 NM
 181°-196° byd 40 NM
 244°-292° byd 40 NM
 340°-350° byd 40 NM blo 6,000'
 351°-010° byd 40 NM

DME unusable:

075°-132° byd 30 NM blo 9,000'
 133°-165° byd 30 NM blo 8,000'

NEWPORT

NORTHEAST KINGDOM INTL (EFK)(KEFK) 3 SW UTC-5(-4DT) N44°53.29' W72°13.72'

MONTREAL

934 B LRA NOTAM FILE BTV

H-11D, L-32H

RWY 18-36: H5301X100 (ASPH) S-30, D-44 PCN 33 F/D/X/T MIRL

IAP

RWY 18: REIL. PAPI(P4L)—GA 3.0° TCH 43'. Thld dsplcd 299'.

RWY 36: REIL. PAPI(P4L)—GA 3.0° TCH 44'. Ground.

RWY 05-23: H3996X100 (ASPH) S-30, D-44

RWY 05: Trees.

RWY 23: Pole.

SERVICE: S4 FUEL 100LL, JET A+ LGT ACTVT PAPI Rwy 18 and 36; MIRL Rwy 18-36—CTAF.

AIRPORT REMARKS: Attended 1400-2200Z. 100LL and Jet A+ fuel 24 hr self svv. Mobile fuel vehicle when atndd. Rwy conds not mnt when unatdd. Rwy 05 extsv cracking, shoulders failed. Gulls on and in vicinity of arpt. Cold temperature airport. Altitude correction required at or below -32C.

AIRPORT MANAGER: 802-272-7725

WEATHER DATA SOURCES: AWOS-3P 118.275 (802) 334-4427.

COMMUNICATIONS: CTAF/UNICOM 122.8

NEWPORT RCO 122.5 (BURLINGTON RADIO)

® BOSTON CENTER APP/DEP CON 135.7


CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE BML.

BERLIN (H) DME 116.55 BML Chan 112(Y) N44°38.01' W71°11.17' 289° 47.1 NM to fld. 1730.

DME unusable:

080°-125° blo 10,000'
 188°-198° blo 10,000'
 275°-292° blo 10,000'

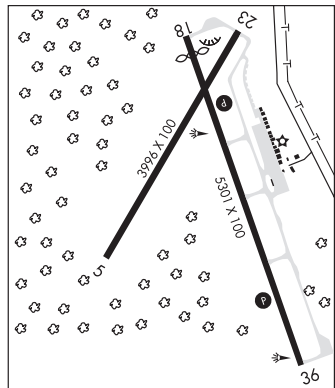

NORTHEAST KINGDOM INTL (See NEWPORT on page 329)

PATRICK LEAHY BURLINGTON INTL (See BURLINGTON on page 324)

POST MILLS (2B9) 0 E UTC-5(-4DT) N43°53.02' W72°15.13'

NEW YORK

696 NOTAM FILE BTV

RWY 04-22: 2900X80 (TURF)

RWY 04: Trees. Rgt tfc.

RWY 22: Road.

RWY 05-23: 2300X80 (TURF) 0.8% up NE

RWY 05: Trees. Rgt tfc.

RWY 23: Road.

AIRPORT REMARKS: Attended irregularly. Ultralights; gliders and hot air balloons on and invov arpt. Arpt open to ski acft only when snow covered. No snow removal. See snowtam rpts. Propane avbl for hot air balloons. Rwy 04-22: 70 ft trees, 40 ft E of cntrn, S 1700 ft.

AIRPORT MANAGER: 802-266-1355

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.