


BUMPASS

LAKE ANNA (W4) 0 NW UTC-5(-4DT) N37°57.95' W77°44.75'
 351 B NOTAM FILE DCA
Rwy 08-26: H2558X50 (ASPH) S-6 MIRL
Rwy 08: Trees.
Rwy 26: Tree.
SERVICE: LGT ACTIVATE MIRL Rwy 08-26—CTAF.
AIRPORT REMARKS: Unattended. Deer on and invof arpt.
AIRPORT MANAGER: 804-550-5794
WEATHER DATA SOURCES: AWOS-3 120.775 (540) 872-0303.
COMMUNICATIONS: CTAF 122.9
 Ⓡ **POTOMAC APP/DEP CON** 126.75
CLEARANCE DELIVERY PHONE: For CD ctc Potomac Apch at 866-640-4124.

WASHINGTON
 L-34E, 36H
 IAP

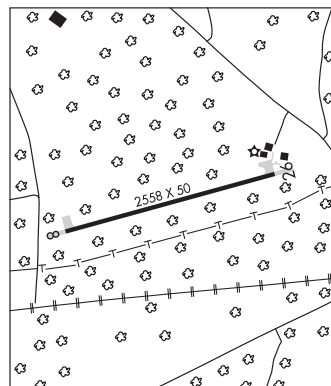

CAMP PEARY LNDG STRIP (W94) A 3 NE UTC-5(-4DT) N37°18.77' W76°38.29'
 41 NOTAM FILE DCA Not insp.
Rwy 05-23: H5018X151 (ASPH) LIRL
Rwy 05: ALSF2. PAPI(P4L).
Rwy 23: ALSF2. PAPI(P4L).

WASHINGTON
 H-101, 121, L-34E, 36H
 DIAP

MILITARY REMARKS: Opr Mon-Fri 1300-2130Z†. Fld rstd, PPR by written req to Base Commander, Attn Air OPS. Exc when opr under prior permission authorized, pilots should maintain at least 3000' abv the arpt elevation within 5 NM.

AIRPORT MANAGER: 757-808-3900

CLEARANCE DELIVERY PHONE: For CD ctc Norfolk Apch at 757-464-0757.

RADIO AIDS TO NAVIGATION: NOTAM FILE DCA.

HARCUM (L) (L) VORTACW 108.8 HCM Chan 25 N37°26.92' W76°42.68' 164° 8.9 NM to fld. 8/7W.
 VOR unusable:
 056°-095° blo 2,000'
 096°-112° byd 20 NM
 174°
 275°-300° blo 2,000'

CAMPBELL FLD (See WEIRWOOD on page 381)

CASANOVA N38°38.47' W77°51.93' NOTAM FILE DCA.
 (H) (H) **VORTACW** 116.3 CSN Chan 110 184° 6.9 NM to Culpeper Rgnl. 442/6W.
 VOR unusable:
 310°-350° byd 10 NM blo 11,000'
 TACAN AZIMUTH unusable:
 310°-350° byd 10 NM blo 11,000'
 DME unusable:
 310°-350° byd 10 NM blo 11,000'

WASHINGTON
 H-10H, L-29D, 34E, 361, A

CAVERNS N38°41.96' W78°28.34' NOTAM FILE DCA.
NDB (MHW) 245 LUA 223° 2.4 NM to Luray Caverns. 834/9W. NDB unmonitored when arpt unatndd.
 NDB unusable:
 050°-208° byd 10 NM
 209°-049° byd 15 NM

WASHINGTON
 L-29G

CHAMBERS FLD (See NORFOLK NS (CHAMBERS FLD) on page 365)