

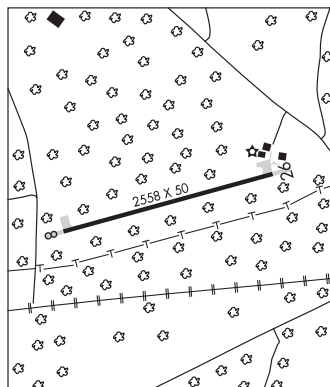
BUMPASS**LAKE ANNA** (7W4) 0 NW UTC-5(-4DT) N37°57.95' W77°44.75'

351 B NOTAM FILE DCA

RWY 08-26: H2558X50 (ASPH) S-6 MIRL**RWY 08:** Trees.**RWY 26:** Tree.**SERVICE:** LGT ACTIVATE MIRL Rwy 08-26—CTAF.**AIRPORT REMARKS:** Unattended. Deer on and invof arpt.**AIRPORT MANAGER:** 804-550-5794**WEATHER DATA SOURCES:** AWOS-3 120.775 (540) 872-0303.**COMMUNICATIONS:** CTAF 122.9® **POTOMAC APP/DEP CON** 126.75**CLEARANCE DELIVERY PHONE:** For CD ctc Potomac Apch at 866-640-4124.**WASHINGTON**

L-34E, 36H

IAP

**CAMP PEARY LNDG STRIP** (W94) A 3 NE UTC-5(-4DT) N37°18.77' W76°38.29'

41 NOTAM FILE DCA Not insp.

RWY 05-23: H5018X151 (ASPH) LIRL**RWY 05:** ALSF2. PAPI(P4L).**RWY 23:** ALSF2. PAPI(P4L).**MILITARY REMARKS:** Opr Mon-Fri 1300-2130Z. Fld rstd, PPR by written req to Base Commander, Attn Air OPS. Exc when opr under prior permission authorized, pilots should maintain at least 3000' abv the arpt elevation within 5 NM.**AIRPORT MANAGER:** 757-808-3900**CLEARANCE DELIVERY PHONE:** For CD ctc Norfolk Apch at 757-464-0757.**RADIO AIDS TO NAVIGATION:** NOTAM FILE DCA.**HARCUM (L) VORTACW** 108.8 HCM Chan 25 N37°26.92' W76°42.68' 164° 8.9 NM to fld. 8/7W.

VOR unusable:

056°-095° blo 2,000'

096°-112° byd 20 NM

174°

275°-300° blo 2,000'

WASHINGTON

H-101, 121, L-34E, 36H

DIAP

CAMPBELL FLD (See WEIRWOOD on page 385)**CASANOVA** N38°38.47' W77°51.93' NOTAM FILE DCA.**(H) VORTACW** 116.3 CSN Chan 110 184° 6.9 NM to Culpeper Rgnl. 442/6W.

VOR unusable:

310°-350° byd 10 NM blo 11,000'

TACAN AZIMUTH unusable:

310°-350° byd 10 NM blo 11,000'

DME unusable:

310°-350° byd 10 NM blo 11,000'

WASHINGTON

H-10H, L-29D, 34E, 36I, A

CAVERNS N38°41.96' W78°28.34' NOTAM FILE DCA.**NDB (MHW)** 245 LUA 223° 2.4 NM to Luray Caverns. 834/9W. NDB unmonitored when arpt unatndd.

NDB unusable:

050°-208° byd 10 NM

209°-049° byd 15 NM

WASHINGTON

L-29G

CHAMBERS FLD (See NORFOLK NS (CHAMBERS FLD) on page 368)