

EASTPORT MUNI (EPM)(KEPM) 1 W UTC-5(-4DT) N44°54.61' W67°00.76'

HALIFAX

45 B LRA NOTAM FILE EPM

L-321

RWY 14-32: H4002X75 (ASPH) S-30 MIRL

IAP

RWY 14: REIL. PAPI(P2L)—GA 3.1° TCH 53'. Tree.

RWY 32: REIL. PAPI(P2L)—GA 3.28° TCH 44'.

SERVICE: S4 **FUEL** 100LL, JET A+ **LGT** ACTVT REIL Rwy 14 and 32;
PAPI Rwy 14 and 32; MIRL Rwy 14-32-2 clicks—CTAF. Wind
indicator: ACTVT—CTAF-2 clicks. Rwy 14 PAPI unusbl byd 6 degs L
of cntrln.

AIRPORT REMARKS: Attended on call: contact Airport Manager
207-214-4751. Deer and nmrs birds on and invof rwy. 24 hr
self-svc fuel avbl with credit card. Jet-A fuel pump lmted to ovr wing
gravity rfilg ops. 40-50 ft obstn lgts on poles 250 ft R of cntrln near
Rwy 14 end & apch area. Req cust at 207-853-4313.

AIRPORT MANAGER: 207-214-4751

WEATHER DATA SOURCES: AWOS-AV 122.8 (207) 853-0682. Frequency: 3
clicks to actvt.

COMMUNICATIONS: CTAF/UNICOM 122.8

® **BOSTON CENTER APP/DEP CON** 124.25

CLEARANCE DELIVERY PHONE: For CD etc Boston ARTCC at 603-879-6859.


RADIO AIDS TO NAVIGATION: NOTAM FILE BGR.

PRINCETON (L) DME 114.3 PNN Chan 90 N45°19.75'

W67°42.25' 130° 38.7 NM to fld. 398.

DME unusable:

300°-330° byd 25 NM blo 4,500'

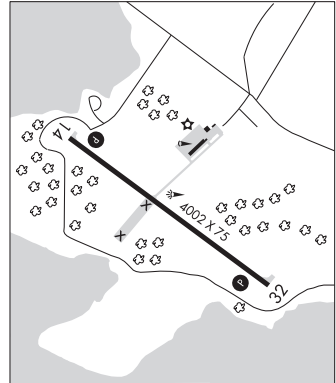

ELIOT

SEACOAST AIRFIELD (3B4) 2 SE UTC-5(-4DT) N43°08.59' W70°46.41'

NEW YORK

125 NOTAM FILE BGR

L-32H, 33D

RWY 12-30: H2701X50 (ASPH) S-8 0.7% up NW

RWY 12: Trees.

RWY 30: Thld dsplcd 86'. Trees.

AIRPORT REMARKS: Unattended. Arpt CLOSED indef. Birds & deer on & invof
arpt.

AIRPORT MANAGER: 949-378-8405

COMMUNICATIONS: CTAF 122.9


® **BOSTON APP/DEP CON** 125.05

CLEARANCE DELIVERY PHONE: For CD etc Boston Apch at 603-594-5551.

RADIO AIDS TO NAVIGATION: NOTAM FILE BGR.

ROLLINS NDB (MHW) 260 ESG N43°13.21'

W70°49.70' 168° 5.2 NM to fld. 72/16W.

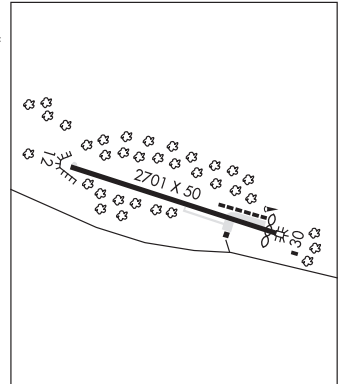

FORT KENT MUNI (7ME) 3 SSE UTC-5(-4DT) N47°12.21' W68°34.77'

HALIFAX

708 NOTAM FILE BGR Not insp.

L-321

RWY 18-36: 2140X90 (TURF)

AIRPORT MANAGER: 207-231-2286

COMMUNICATIONS: CTAF 122.9