

SAND SPRINGS STRIP (8U1) 1 NW UTC-7(-6DT) N47°06.25' W107°30.18'

BILLINGS

3180 TPA—3900(720) NOTAM FILE GTF

RWY 10-28: 2400X60 (TURF) 0.9% up E

RWY 10: Road.

AIRPORT REMARKS: Attended daltg hrs. No snow plowing in winter. Animals on and invof rwy. Rwy 10-28 may be soft when wet. Rwy 10-28 rough and uneven mowing intmt. No ldg on twy connected to Rwy 28.

AIRPORT MANAGER: 406-853-0561**COMMUNICATIONS:** CTAF/UNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Salt Lake ARTCC at 801-320-2568.**SCHAFFER (USFS)** (8U2) 15 SE UTC-7(-6DT) N48°04.78' W113°14.70'

GREAT FALLS

4856 NOTAM FILE GTF

RWY 07-25: 3200X60 (TURF)

RWY 07: Trees.

RWY 25: Trees.

AIRPORT REMARKS: Unattended. Summer phone 406-752-7345. Watch for horses or big game animals on rwy. Low area north side of rwy approximately 1100' from AER 25, use caution. Trees and terrain in transition sfc both sides of rwy full length. Primary purpose of air station is a trailhead for wilderness areas. Rwy 07 first 800 ft unmarked exc thr. Rwy 25 rwy cone width may vary. First 2400' marked with white cones 200' apart. First 400' of Rwy 25 is uneven, bouncy and rough. Txf and land Rwy 25 conditions permitting.

AIRPORT MANAGER: 406-481-0826**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Salt Lake ARTCC at 801-320-2568.**SCOBEY****SCOBEY** (9S2) 1 NW UTC-7(-6DT) N48°48.46' W105°26.37'

BILLINGS

2434 B NOTAM FILE GTF

RWY 12-30: H4020X75 (ASPH) S-11 MIRL 1.1% up SE

RWY 12: PAPI(P2L)—GA 3.0° TCH 25'.

RWY 30: PAPI(P2L)—GA 3.0° TCH 22'.

SERVICE: S4 FUEL 100LL, JET A LGT MIRL Rwy 12-30, PAPI Rwy 12 and Rwy 30 opr dusk-0600Z†, after 0600Z† ACTIVATE—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1500-0000Z†. Deer on and invof arpt.

AIRPORT MANAGER: 406-783-7093**WEATHER DATA SOURCES:** AWOS-3PT 128.325 (406) 487-9996.**COMMUNICATIONS:** CTAF/UNICOM 122.8

® SALT LAKE CENTER APP/DEP CON 126.85

CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at 801-320-2568.**RADIO AIDS TO NAVIGATION:** NOTAM FILE GGW.

GLASGOW (VH) (DH) VORW/DME 113.9 GGW Chan 86 N48°12.92' W106°37.53' 039° 59.2 NM to fld. 2283/14E.

VOR unusable:

001°-005° byd 50 NM

010°-025° byd 40 NM

030°-045° byd 63 NM blo 9,300'

050°-055° byd 55 NM

060°-080° byd 55 NM

335°-345° byd 50 NM

346°-355° byd 40 NM

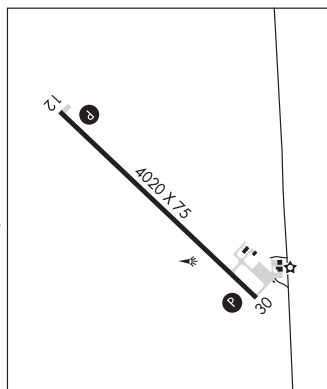
DME unusable:

001°-005° byd 50 NM

050°-055° byd 55 NM

060°-080° byd 55 NM

335°-345° byd 50NM

**SCOBEY BORDER STATION/EAST POPLAR INTL** (8U3) 13 N UTC-7(-6DT) N48°59.97' W105°24.02'

BILLINGS

2501 LRA NOTAM FILE GTF

RWY 07-25: 3330X75 (TURF) 1.7% up E

RWY 07: Pole.

AIRPORT REMARKS: Unattended. May have livestock on and invof arpt. No snow removal. Rwy 07-25 soft when wet. Rwy 07-25 marked with cones full length. Rwy 07-25 sfc rolling with gopher holes.

AIRPORT MANAGER: 406-444-2506**COMMUNICATIONS:** CTAF/UNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Salt Lake ARTCC at 801-320-2568.