

LAKESIDE MUNI (9S3) 0 NW UTC-8(-7DT) N43°34.99' W124°10.82'
 20 NOTAM FILE MMV
RWY 15-33: 2150X100 (TURF)
RWY 15: Trees.
RWY 33: Trees.

AIRPORT REMARKS: Unattended. Wildlife on and invof arpt. Remote ctl acft oprns at arpt. Rwy 15-33 rwy ends marked with white mats. To deactivate sprinklers key 122.9.

AIRPORT MANAGER: (209) 327-1578

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

KLAMATH FALLS

LAKEVIEW

LAKE CO (LKV)(KLKV) 3 SW UTC-8(-7DT) N42°09.67' W120°23.95'
 4734 B NOTAM FILE LKV

RWY 17-35: H5318X100 (ASPH) S-74, D-86 MIRL

RWY 17: REIL. PAPI(P4R)—GA 3.0° TCH 45'.

RWY 35: REIL. PAPI(P4L)—GA 3.0° TCH 45'.

SERVICE: S4 FUEL 100LL, JET A LGT ACTIVATE MIRL Rwy 17-35;
 PAPI Rwy 17 and Rwy 35; REIL Rwy 17 and Rwy 35—CTAF.

Tetrahedron lighting inop.

AIRPORT REMARKS: Attended Apr-Sep 1700-0000Z†, Oct-Mar 1500-0100Z†. Flocks of large waterfowl in vcnty Nov-May. Wildlife on and invof arpt. Extv airtanker ops in fire season. Possible glider ops on twy. Drag strip oriented NW-SE lctd 3000' southwest of Rwy 35. Twy NE-SW used for strong cross wind ldg. Cold temperature airport. Altitude correction required at or below -26C.

AIRPORT MANAGER: 541-947-4222

WEATHER DATA SOURCES: AWOS-3PT 135.525 (541) 947-5069.

COMMUNICATIONS: CTAF/UNICOM 122.8

RCO 122.3 (MC MINNVILLE RADIO)

® **SEATTLE CENTER APP/DEP CON** 127.6


CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Seattle ARTCC at 253-351-3694.

RADIO AIDS TO NAVIGATION: NOTAM FILE LKV.

LAKEVIEW (VH) (H) VORTACW 112.0 LKV Chan 57 N42°29.57' W120°30.43' 147° 20.5 NM to fld. 7465/19E.

VOR unusable:

120°-142° byd 40 NM
 143°-153° byd 117 NM
 143°-153° byd 40 NM blo 11,000'
 143°-153° byd 65 NM blo 14,000'
 154°-160° byd 40 NM
 161°-171° byd 40 NM blo 18,000'
 172°-208° byd 40 NM
 209°-219° byd 40 NM blo 9,000'
 209°-219° byd 63 NM
 220°-224° byd 40 NM
 225°-236° byd 40 NM blo 15,000'
 225°-236° byd 48 NM
 237°-248° byd 40 NM
 249°-259° byd 40 NM blo 12,000'
 249°-259° byd 56 NM
 260°-280° byd 40 NM

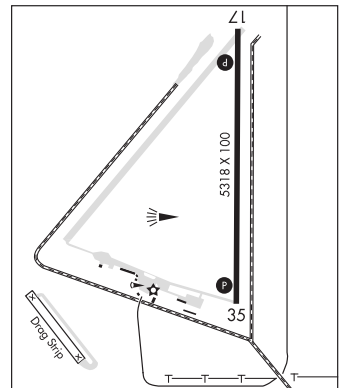

KLAMATH FALLS

H-3B, L-11A

IAP

LARK'S LDG SPB (See ONTARIO on page 192)

LEBANON STATE (S3Ø) 1 SW UTC-8(-7DT) N44°31.87' W122°55.78'
 349 B NOTAM FILE MMV

RWY 16-34: H2747X60 (ASPH) MIRL

RWY 16: PAPI(P2L)—GA 3.5° TCH 40'. Tree.

RWY 34: PAPI(P2L)—GA 3.0° TCH 44'. Thld dsplcd 260'. Road.

SERVICE: S4 FUEL 100LL, MOGAS LGT ACTVT PAPI RWY 16 & 34; MIRL RWY 16-34—CTAF.

AIRPORT REMARKS: Attended continuously. Acft departing Rwy 34 make 10° left turn after tkf as soon as safety permits.

AIRPORT MANAGER: 503-378-4880

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Cascade Apch at 541-607-4674/4675, when Apch clsd ctc Seattle ARTCC at 253-351-3694.

SEATTLE