

BREWSTER**ANDERSON FLD** (S97) 3 E UTC-8(-7DT) N48°06.28' W119°43.19'

920 B NOTAM FILE SEA

RWY 07-25: H4000X60 (ASPH) S-15 MIRL**SERVICE:** LGT ACTIVATE MIRL Rwy 07-25—CTAF. Twy lgts on center twy only.**AIRPORT REMARKS:** Unattended. Wind indicator lit in non-daylight hrs.

Pilots provide tie down ropes.

AIRPORT MANAGER: (509) 689-3464**COMMUNICATIONS:** CTAF/UNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD etc Seattle ARTCC at 253-351-3694.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MWH.**MOSES LAKE (VH) (DH) VOR/DME** 115.0 MWH Chan 97
N47°12.65' W119°19.01' 325° 56.1 NM to fld.

1193/18E.

VOR unusable:

025°-040° byd 40 NM

055°-070° byd 40 NM

071°-081° byd 40 NM blo 28,000'

175°-198° byd 40 NM blo 6,000'

175°-198° byd 67 NM blo 10,000'

175°-198° byd 70 NM


200°-210° byd 40 NM

220°-230° byd 40 NM

240°-253° byd 40 NM blo 18,000'

254°-260° byd 40 NM

315°-345° byd 40 NM

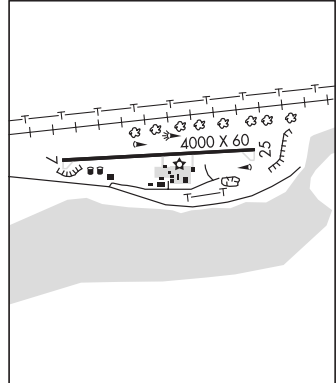**BUCKHORN MTN** N46°32.49' W123°01.28'

RCO 122.2 (SEATTLE RADIO)

SEATTLE

L-1C

BURLINGTON/MOUNT VERNON**SKAGIT RGNL** (BVS)(KBVS) 3 W UTC-8(-7DT) N48°28.23' W122°25.30'


145 B TPA—See Remarks LRA NOTAM FILE BVS

RWY 11-29: H5480X100 (ASPH) S-60, D-75, 2D-125 MIRL

0.8% up W

RWY 11: REIL. PAPI(P4L)—GA 3.0° TCH 43'.**RWY 29:** REIL. PAPI(P4L)—GA 3.0° TCH 42'.**RWY 04-22:** H3000X60 (ASPH) S-12.5 LIRL 0.3% up NE**RWY 04:** PAPI(P2L)—GA 4.0° TCH 43'.**RWY 22:** PAPI(P2L)—GA 3.0° TCH 44'.**SERVICE:** S4 FUEL 100LL, JET A OX 3, 4 LGT ACTIVATE MIRL Rwy 11-29 and LIRL Rwy 04-22, PAPI Rwy 11 and Rwy 29 and REIL Rwy 11 and Rwy 29—CTAF. PAPI Rwy 04 and Rwy 22 opr continuously.**AIRPORT REMARKS:** Attended 1500-0300Z. Migratory waterfowl and birds on and in/ov arpt. Helicopter training ops on arpt with autorotations on rwy. Rwy 04-22 CLOSED to acft more than 12,500 lbs and wingspan more than 49'. Terminal building open 1500-0300Z. After hours, access avbl to pilots. Terminal and apron adj to terminal free pilot access Wifi. Possible turbulence in/ov exhaust stacks 3,500' southwest of Rwy 04, avoid low alt over flt. Use of Twy B by acft with wingspan 49' or greater prohibited when Rwy 04-22 in use. TPA-1145(1000) Ultralight TPA-645(500). Rwy 04-22 has wdspr, opn, unsealed cracks and joints. U.S. Cust svc avbl for intl arr. Ck Port of Skagit website for req for svc instr, www.portofskagit.com. Avbl seve days a week, per apvl. Usage fees apply.**AIRPORT MANAGER:** 360-757-0011**WEATHER DATA SOURCES:** AWOS-3 121.125 (360) 757-7767.**COMMUNICATIONS:** CTAF/UNICOM 123.075

® WHIDBEY APP/DEP CON 120.7

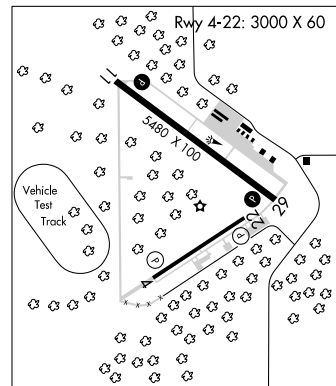

SEATTLE

H-1B, L-1E

IAP

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

CLEARANCE DELIVERY PHONE: For CD ctc Whidbey Apch at 360-257-3310.

RADIO AIDS TO NAVIGATION: NOTAM FILE SEA.

TATOOSH (VH) (H) VORTACW 112.2 TOU Chan 59 N48°17.99' W124°37.62' 061° 88.8 NM to fld. 1650/22E.

VOR unusable:

020°-025° byd 40 NM

085°-090° byd 40 NM

091°-101° byd 40 NM blo 15,000'

091°-101° byd 58 NM

103°-109° byd 40 NM

356°-360° byd 40 NM

CAMANO ISLAND AIRFIELD (See STANWOOD on page 271)

CAMAS

GROVE FLD (1W1) 3 N UTC-8(-7DT) N45°37.67' W122°24.26'

SEATTLE

429 B TPA-1229(800) NOTAM FILE SEA

RWY 07-25: H2710X40 (ASPH) MIRL(NSTD)

RWY 07: Thld dsplcd 493'. Trees.

RWY 25: Thld dsplcd 413'. Trees.

SERVICE: FUEL 100, MOGAS LGT Rwy 07-25 NSTD MIRL Rwy 07 and Rwy 25 dsplcd thlds unlighted. ACTIVATE rotating bcn and MIRL Rwy 07-25-CTAF.

NOISE: Noise abatement procedures in effect, ctc Port of Camas-Washougal at 360-835-2196.

AIRPORT REMARKS: Unattended. For fuel after hrs credit card lock. Rwy 07-25 has buildings, telephone poles and trees encroaching in safety areas.

AIRPORT MANAGER: 360-835-2196

COMMUNICATIONS: CTAF 122.7

CLNC DEL 121.65

CLEARANCE DELIVERY PHONE: For CD ctc Portland Apch at 503-493-7545.

CASHMERE-DRYDEN (8S2) 2 SW UTC-8(-7DT) N47°30.89' W120°29.08'

SEATTLE

858 B NOTAM FILE SEA

RWY 07-25: H1800X50 (ASPH) S-8 MIRL 1.4% up W

RWY 07: Trees.

RWY 25: Thld dsplcd 144'. Trees.

SERVICE: LGT ACTIVATE MIRL Rwy 07-25; bcn-121.7.

NOISE: Pilots are encouraged to minimize low-alt flt over noise-sensitive residential areas in the Cashmere vcnty.

AIRPORT REMARKS: Unattended. Ground vehicles and pedestrians use twy for hangar access. Exit rwy at twys only. Radio control model activity permitted on W end of arpt.

AIRPORT MANAGER: (509) 782-3321

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

CEDARS NORTH (See BATTLE GROUND on page 216)