

RITZVILLE**PRU FLD** (33S) 1 W UTC-8(-7DT) N47°07.41' W118°23.36'

1801 B NOTAM FILE SEA

RWY 01-19: H3433X40 (ASPH) S-12.5 MIRL**RWY 01:** PAPI(P2L)—GA 4.0° TCH 40'. P-line.**RWY 19:** PAPI(P2R)—GA 3.5° TCH 45'. Thld dsplcd 820'. Tree.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 01:** TORA-2614 TODA-2614 ASDA-3433 LDA-3433**RWY 19:** TORA-3433 TODA-3433 ASDA-3433 LDA-2614**SERVICE:** LGT ACTIVATE MIRL Rwy 01-19; PAPI Rwy 01 and Rwy 19—CTAF.**AIRPORT REMARKS:** Unattended. Arpt clsd when snow and ice on rwy. Pilots bring ropes. Rwy 01 and Rwy 19 mrkgs are faded.**AIRPORT MANAGER:** 509-659-1930**COMMUNICATIONS:** CTAF/UNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Grant County Apch at 509-762-2842, when Apch clsd ctc Seattle ARTCC at 253-351-3694.**RADIO AIDS TO NAVIGATION:** NOTAM FILE GEG.**SPOKANE (VH) (H) VORTACW** 115.5 GEG Chan 102 N47°33.90' W117°37.61' 216° 40.9 NM to fld. 2756/14E.

VOR unusable:

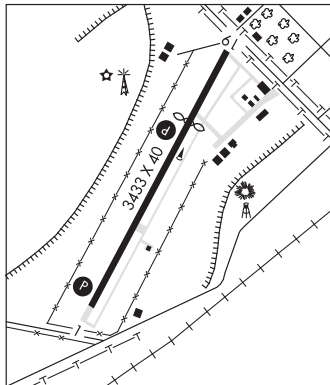
007°-022° byd 26 NM blo 7,000'

029°-041° byd 40 NM

307°-337° byd 30 NM blo 9,000'

342°-007° byd 18 NM blo 7,000'

342°-007° byd 25 NM

SEATTLE
L-13A**ROCHESTER****R & K SKYRANCH** (8W9) 1 N UTC-8(-7DT) N46°49.96' W123°05.49'

149 TPA-999(850) NOTAM FILE SEA

RWY 16-34: 2480X35 (TURF)**RWY 16:** Thld dsplcd 700'. Trees.**RWY 34:** Thld dsplcd 327'. Trees.**AIRPORT REMARKS:** Unattended. No touch and go landings. Rwy 16 first 1,100 ft has shrubs and 70 ft+ trees approximately 15 ft from rwy edges. Deer invov rwy. Trees and buildings in prim sfc area. Fence parallels both sides of rwy 50 ft from cntrln.**AIRPORT MANAGER:** (253) 405-0133**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle Apch at 206-214-4723.

SEATTLE

ROGERSBURG (See ANATONE on page 214)**ROSALIA MUNI** (72S) 2 W UTC-8(-7DT) N47°14.19' W117°25.28'

2170 B NOTAM FILE SEA

RWY 02-20: H2807X45 (ASPH) S-15.5 MIRL**RWY 02:** Thld dsplcd 165'. Tree.**RWY 20:** Thld dsplcd 137'. Road. Rgt tfc.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 02:** TORA-2807 TODA-2807 ASDA-2670 LDA-2505**RWY 20:** TORA-2807 TODA-2807 ASDA-2642 LDA-2505**SERVICE:** LGT ACTIVATE MIRL Rwy 02-20—122.9. Rwy 02-20 twy reflectors, no twy lgts.**AIRPORT REMARKS:** Unattended. Pilots bring own ropes.**AIRPORT MANAGER:** 509-262-8054**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Spokane Apch at 509-742-2522

SEATTLE