

WENATCHEE**PANGBORN MEML** (EAT)(KEAT) 4 E UTC-8(-7DT) N47°23.93' W120°12.41'

1249 B Class I, ARFF Index A NOTAM FILE EAT

RWY 12-30: H7000X150 (ASPH) S-116, D-192 PCR 450 F/A/X/T

HIRL

RWY 12: MALSR. PAPI(P4L)—GA 3.6° TCH 55'. Road. Rgt ttc.**RWY 30:** REIL. PAPI(P4L)—GA 3.6° TCH 60'.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 12:** TORA-7000 TODA-7000 ASDA-7000 LDA-7000**RWY 30:** TORA-7000 TODA-7000 ASDA-7000 LDA-7000**SERVICE:** S4 FUEL 100LL, JET A OX 1, 2 LGT ACTVT MALSR Rwy 12, REIL Rwy 30, HIRL Rwy 12-30—CTAF. PAPI Rwy 12 and Rwy 30 opr consly. Rwy 30 VGSI unusable byd 2.6 NM due to terrain.**AIRPORT REMARKS:** Attended 1600-0200Z†. Bird hazard. Glider activity from Mar-Nov. UAS activity 1.56 NM E of the EAT VOR, 400 ft and below dur daylight hrs. 24 hr PPR for unscheduled air carrier ops with more than 30 pax seats call arpt ops, 509-860-1852. Cold temperature airport. Altitude correction required at or below -6C. Ldg fee.**AIRPORT MANAGER:** 509-884-4700**WEATHER DATA SOURCES:** ASOS 119.925 (509) 886-4226.**COMMUNICATIONS:** CTAF/UNICOM 123.0

® SEATTLE CENTER APP/DEP CON 126.1

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.**AIRSPACE:** CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE EAT.**WENATCHEE (VL) (L) VORW/DME** 114.35 EAT Chan 90(Y) N47°23.98' W120°12.65' at fld. 1222/15E.

VOR unusable:

041°-123° byd 20 NM

124°-132° byd 17

133°-249° byd 20

250°-262° byd 25 NM blo 12,000'

250°-262° byd 35 NM

263°-349° byd 20 NM

350°-040° byd 16 NM

DME unusable:

041°-249° byd 20 NM

250°-262° byd 25 NM blo 12,000'


250°-262° byd 35 NM

263°-349° byd 20 NM

350°-040° byd 16 NM

ILS/DME 109.35 I-ADJ Chan 30(Y) Rwy 12. Class IE. LOC unusable byd 15 NM blo 5,700'. DME unmonitored.

Adj g/s unusable 5 degrees left of course NOTAM: ILS autocoupled approaches not applicable below 2,500'.

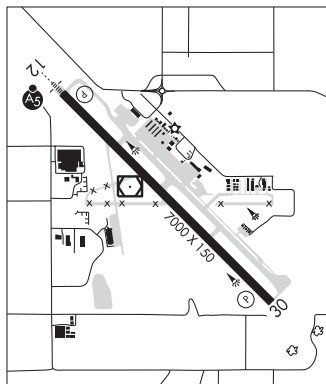

SEATTLE

H-1C, L-1D, 13A

IAP, AD

WESTPORT (14S) 1 N UTC-8(-7DT) N46°53.82' W124°06.04'

14 B NOTAM FILE SEA

RWY 12-30: H2318X50 (ASPH) MIRL**RWY 12:** PAPI(P2L). Trees.**RWY 30:** PAPI(P2L). Rgt ttc.**AIRPORT REMARKS:** Unattended. Deer on and invof rwy. Large bird nesting area adjacent to Rwy 12-30. Rwy 12-30 soft shoulders. 12 ft slope 16 ft fm both sides of rwy.**AIRPORT MANAGER:** 360-268-0131**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle ARTCC at 253-351-3694.

SEATTLE

WHATCOM N48°56.72' W122°34.76' NOTAM FILE BLI.

(H) TACAN 113.0 HUH Chan 77 150° 9.3 NM to Bellingham Intl. 82/20E.

TACAN AZIMUTH unusable:

155°-165° byd 15 NM blo 6,000'

SEATTLE

H-1B, L-1E

WHIDBEY AIR PARK (See LANGLEY on page 238)