

WILBUR (2S8) 2 SW UTC-8(-7DT) N47°45.20' W118°44.64'
2183 B NOTAM FILE SEA
RWY 02-20: H3851X60 (ASPH) S-15.5 MIRL 0.5% up N

RWY 02: REIL.

RWY 20: PAPI(P2L)—GA 3.0° TCH 44'.

SERVICE: S2 FUEL 100LL, JET A LGT ACTIVATE MIRL Rwy
02-20—CTAF. PAPI Rwy 20 opr continuously.

AIRPORT REMARKS: Attended Oct-Mar 1600-0100Z‡ Mon-Fri, Apr-Sep
1300-2200Z‡ Mon-Sat. Check NOTAMS for fire fighting operations
in summer months. Wildlife invof runway. Pilots bring own ropes.

AIRPORT MANAGER: 509-641-2079

WEATHER DATA SOURCES: AWOS-2 124.175 (509) 647-0337.

COMMUNICATIONS: CTAF 122.9

® GRANT COUNTY APP/DEP CON 126.4 (1400-0600Z‡)

® SEATTLE CENTER APP/DEP CON 126.1 (0600-1400Z‡)

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

RADIO AIDS TO NAVIGATION: NOTAM FILE EPH.

EPHRAATA (VH) (H) VORTACW 112.6 EPH Chan 73 N47°22.68'

W119°25.44' 030° 35.7 NM to fld. 1250/21E.

VOR unusable:

010°-014° byd 40 NM

042°-054° byd 40 NM

214°-228° byd 40 NM blo 7,000'

214°-228° byd 52 NM blo 10,000'

214°-228° byd 77 NM

229°-247° byd 40 NM

310°-350° byd 25 NM blo 6,500'

310°-353° byd 40 NM

358°-004° byd 40 NM

TACAN AZIMUTH unusable:


280°-295° byd 25 NM blo 7,000'

310°-350° byd 25 NM blo 6,500'

DME unusable:

280°-295° byd 25 NM blo 7,000'

310°-350° byd 25 NM blo 6,500'

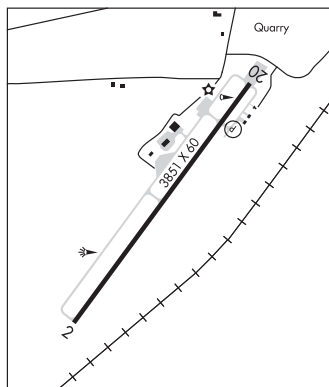

WILL ROGERS WILEY POST MEML SPB (See RENTON on page 265)

WILLAPA HARBOR (See SOUTH BEND(RAYMOND) on page 276)

WILLARD FLD (See TEKO on page 280)

WILLIAM R FAIRCHILD INTL (See PORT ANGELES on page 259)

WILSON CREEK (5W1) 1 E UTC-8(-7DT) N47°25.11' W119°06.55'
1430 NOTAM FILE SEA

RWY 10-28: H2500X50 (ASPH)


AIRPORT REMARKS: Unattended. Fence south side of rwy, mid field, 70 ft frn
rwy. Pilots bring own ropes.

AIRPORT MANAGER: (509) 345-2531

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Grant County Apch at

509-762-2842, when Apch clsd ctc Seattle ARTCC at 253-351-3694.

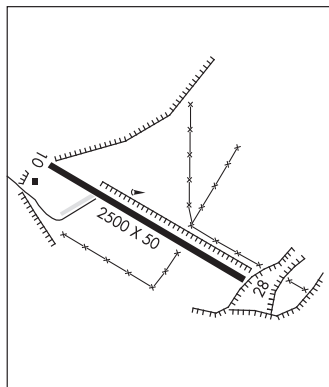

SEATTLE
L-13A
IAP