

**GILLETTE**

**NORTHEAST WYOMING RGNL** (GCC)(KGCC) 4 NW UTC-7(-6DT) N44°20.93' W105°32.36' **CHEYENNE**

4365 B TPA—See Remarks Class I, ARFF Index A NOTAM FILE GCC **H-1F, 2G, L-12F, 13E IAP, AD**

**RWY 16-34:** H7501X150 (CONC-GRVD) S-70, D-110, 2S-139,

2D-160 PCR 580 R/D/W/T HIRL 0.4% up SE

**RWY 16:** REIL. PAPI(P4L)—GA 3.17° TCH 43'. Road.

**RWY 34:** MALSR. PAPI(P4L)—GA 3.2° TCH 56'. P-line.

**RWY 03-21:** H5804X75 (CONC-GRVD) S-40, D-60

PCR 240 R/D/W/T MIRL 0.4% up SW

**RWY 03:** REIL. PAPI(P4L)—GA 4.0° TCH 41'.

**RWY 21:** REIL. PAPI(P4L)—GA 4.0° TCH 39'.

**RUNWAY DECLARED DISTANCE INFORMATION**

**RWY 03:** TORA-5803 TODA-5803 ASDA-5803 LDA-5803

**RWY 16:** TORA-7500 TODA-7500 ASDA-7500 LDA-7500

**RWY 21:** TORA-5803 TODA-5803 ASDA-5803 LDA-5803

**RWY 34:** TORA-7500 TODA-7500 ASDA-7500 LDA-7500

**SERVICE:** FUEL 100LL, JET A, A+ OX 1, 2 LGT ACTVT MALSR Rwy

34; REILS Rwys 03, 16 and 21; HIRL Rwy 16-34, MIRL Rwy

03-21—CTAF. Sequence flashers Rwy 34 avbl on high setting only.

PAPI Rwys 03, 16, 21, 34 opr consly.

**AIRPORT REMARKS:** Attended 1200-0700Z†. Conds unmon. Fuel avbl H24

via credit card. Aft hrs ops ctc 307-257-3137. Birds invof arpt.

Mining/blasting opns 1/2 mile N of AOA durg dalgt hrs.

TPA—5165(800) for light acft, 5565(1200) for large acft. PPR unscheduled air carrier ops with more than 30 pax seats call amgr 307-686-1042. Opn on unpaved sfcs prohibited.

**AIRPORT MANAGER:** 307-686-1042

**WEATHER DATA SOURCES:** ASOS 124.175 (307) 225-9101.

**COMMUNICATIONS:** CTAF 118.5 UNICOM 122.95

GILLETTE RCO 122.3 (CASPER RADIO)

® DENVER CENTER APP/DEP CON 135.6

**AIRSPACE:** CLASS E svc 1300-0600Z†; other times CLASS G.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE GCC.

**GILLETTE (VH) (H) VOR/DME** 114.6 GCC Chan 93 N44°20.87' W105°32.61' at fld. 4336/9E.

VOR unusable:


- 053°-157° byd 40 NM
- 158°-168° byd 40 NM blo 10,000'
- 158°-168° byd 56 NM
- 169°-188° byd 40 NM
- 189°-199° byd 40 NM blo 8,500'
- 189°-199° byd 46 NM
- 200°-238° byd 40 NM
- 253°-278° byd 20 NM blo 8,000'
- 259°-279° byd 40 NM
- 280°-320° byd 40 NM

DME unusable:

- 163°-193° byd 25 NM blo 10,300'
- 193°-268° byd 20 NM blo 8,000'
- 193°-268° byd 30 NM blo 13,000'
- 268°-333° byd 22 NM blo 10,500'

**DERYK NDB (MHW/LOM)** 380 GC N44°16.25' W105°31.33' 342° 4.7 NM to fld. 4674/9E. NDB unmonitored 0500-1300Z†.

**ILS/DME** 110.1 I-LLT Chan 38 Rwy 34. Class IE. LOM DERYK NDB. Glideslope unusable byd 8 NM. Unmonitored when arpt ops ofc clsd.

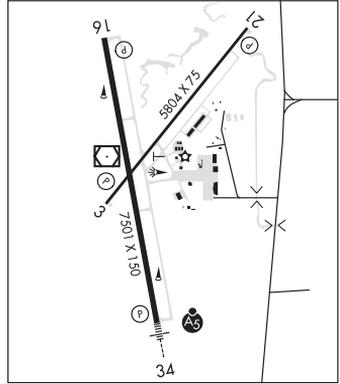

**GLENDO**

**THOMAS MEML** (76V) 1 N UTC-7(-6DT) N42°31.20' W105°01.20' **CHEYENNE**

4666 NOTAM FILE CPR

**RWY 16-34:** 4397X70 (TURF-DIRT)

**RWY 16:** Tree.

**RWY 34:** Road.

**AIRPORT REMARKS:** Unattended. Ctc town hall 307-735-4242 or arpt mgr 307-331-5005 prior to use for sfc cond. Ocnl antelope on rwy. First 500 ft Rwy 34 end very rough. Rwy 16-34 mowed natural grass. Rwy 16-34 muddy, slick and soft when wet, ocnl gopher holes. Unrestricted vehicle access.

**AIRPORT MANAGER:** 307-298-7397

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Denver ARTCC at 303-651-4257.