

FORT BRIDGER (FBR)(KFBR) 4 N UTC-7(-6DT) N41°23.60' W110°24.36'

7038 B NOTAM FILE CPR

SALT LAKE CITY

H-3E, L-11D

IAP

RWY 04-22: H6404X75 (ASPH) S-12.5, D-20, 2D-20 MIRL

0.5% up SW

RWY 04: REIL. PAPI(P2L)—GA 3.0° TCH 40'.**RWY 22:** REIL. PAPI(P2L)—GA 3.0° TCH 40'.**RWY 07-25:** 3520X50 (TURF-DIRT) 0.3% up SW**RWY 07:** Fence.**SERVICE:** **FUEL** 100LL **LGT** ACTVT PAPI Rwy 04 and 22; REIL Rwy 04 and 22; MIRL Rwy 04-22—CTAF.**AIRPORT REMARKS:** Unattended. For svc aft hrs call 307-799-5513.

Numerous prairie dog holes, sage brush and depressions on sfc. Fuel avbl by H24 via credit card. Rwy 04-22 plowed winter months; Rwy 07-25 clsd winter months except for ski equip acct; dirt/turf rwys not maintained.

AIRPORT MANAGER: 307-799-5513**WEATHER DATA SOURCES:** AWOS-3PT 118.8 (307) 782-3226.**COMMUNICATIONS:** CTAF/UNICOM 122.8**RCO** 122.3 (CASPER RADIO)® **SALT LAKE CENTER APP/DEP CON** 124.35**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Salt Lake ARTCC at 801-320-2568.**RADIO AIDS TO NAVIGATION:** NOTAM FILE CPR.**(VL) (DH) VOR/DME** 114.45 FBR Chan 91(Y) N41°22.71' W110°25.44' 028° 1.2 NM to fld. 7058/14E.

VOR unusable:

129°-207° byd 40 NM

208°-218° byd 40 NM blo 14,000'

208°-218° byd 69 NM

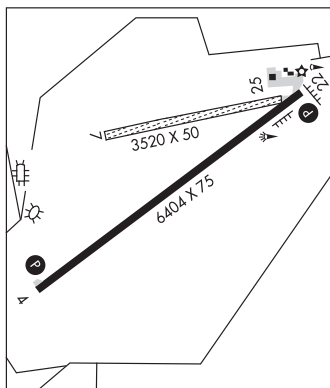
219°-226° byd 40 NM

227°-237° byd 40 NM blo 12,000'

227°-237° byd 65 NM

245°-257° byd 40 NM blo 12,000'

245°-257° byd 56 NM

**GILLETTE****NORTHEAST WYOMING RGNL** (GCC)(KGCC) 4 NW UTC-7(-6DT) N44°20.93' W105°32.36'

4365 B TPA—See Remarks Class I, ARFF Index A NOTAM FILE GCC

CHEYENNE

H-1F, 2G, L-12F, 13E

IAP, AD

RWY 16-34: H7501X150 (CONC-GRVD) S-70, D-110, 2S-139,

2D-160 PCR 580 R/D/W/T HIRL 0.4% up SE

RWY 16: REIL. PAPI(P4L)—GA 3.17° TCH 43'. Road.**RWY 34:** MALSR. PAPI(P4L)—GA 3.2° TCH 56'. P-line.**RWY 03-21:** H5804X75 (CONC-GRVD) S-40, D-60

PCR 240 R/D/W/T MIRL 0.4% up SW

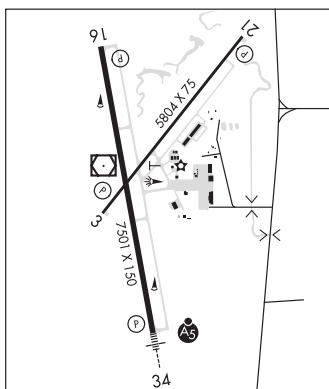
RWY 03: REIL. PAPI(P4L)—GA 4.0° TCH 41'.**RWY 21:** REIL. PAPI(P4L)—GA 4.0° TCH 39'.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 03:** TORA-5803 TODA-5803 ASDA-5803 LDA-5803**RWY 16:** TORA-7500 TODA-7500 ASDA-7500 LDA-7500**RWY 21:** TORA-5803 TODA-5803 ASDA-5803 LDA-5803**RWY 34:** TORA-7500 TODA-7500 ASDA-7500 LDA-7500

SERVICE: **FUEL** 100LL, JET A, A+ **OX** 1, 2 **LGT** ACTVT MALSR Rwy 34; REILS Rws 03, 16 and 21; HIRL Rwy 16-34, MIRL Rwy 03-21—CTAF. Sequence flashers Rwy 34 avbl on high setting only. PAPI Rws 03, 16, 21, 34 opr consly.

AIRPORT REMARKS: Attended 1200-0700Z±. Conds unmon. Fuel avbl H24 via credit card. Aft hrs ops ctc 307-257-3137. Birds invof arpt.

Mining/blasting opns 1/2 mile N of AOA durg dalgt hrs.

TPA—5165(800) for light acct, 5565(1200) for large acct. PPR unscheduled air carrier ops with more than 30 pax seats call amgr 307-686-1042. Opn on unpaved sfcs prohibited.

AIRPORT MANAGER: 307-686-1042**WEATHER DATA SOURCES:** ASOS 124.175 (307) 225-9101.**COMMUNICATIONS:** CTAF 118.5 UNICOM 122.95**GILLETTE RCO** 122.3 (CASPER RADIO)® **DENVER CENTER APP/DEP CON** 135.6**AIRSPACE:** CLASS E svc 1300-0600Z±; other times CLASS G.**CONTINUED ON NEXT PAGE**

NW, 9 JUL 2026 to 3 SEP 2026

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE GCC.

GILLETTE (VH) (H) VORW/DME 114.6 GCC Chan 93 N44°20.87' W105°32.61' at fld. 4336/9E.

VOR unusable:

053°-157° byd 40 NM
 158°-168° byd 40 NM blo 10,000'
 158°-168° byd 56 NM
 169°-188° byd 40 NM
 189°-199° byd 40 NM blo 8,500'
 189°-199° byd 46 NM
 200°-238° byd 40 NM
 253°-278° byd 20 NM blo 8,000'
 259°-279° byd 40 NM
 280°-320° byd 40 NM

DME unusable:

163°-193° byd 25 NM blo 10,300'
 193°-268° byd 20 NM blo 8,000'
 193°-268° byd 30 NM blo 13,000'
 268°-333° byd 22 NM blo 10,500'

DERYK NDB (MHW/LOM) 380 GC N44°16.25' W105°31.33' 342° 4.7 NM to fld. 4674/9E. NDB unmonitored
 0500-1300Z†.

ILS/DME 110.1 I-LLT Chan 38 Rwy 34. Class IE. LOM DERYK NDB. Glideslope unusable byd 8 NM. Unmonitored
 when aprt ops ofc clsd.

GLENDO

THOMAS MEML (76V) 1 N UTC-7(-6DT) N42°31.20' W105°01.20'

CHEYENNE

4666 NOTAM FILE CPR

RWY 16-34: 4397X70 (TURF-DIRT)

RWY 16: Tree.

RWY 34: Road.

AIRPORT REMARKS: Unattended. Ctc town hall 307-735-4242 or aprt mgr 307-331-5005 prior to use for sfc cond. Ocnl antelope on rwy. First 500 ft Rwy 34 end very rough. Rwy 16-34 mowed natural grass. Rwy 16-34 muddy, slick and soft when wet, ocnl gopher holes. Unrestricted vehicle access.

AIRPORT MANAGER: 307-298-7397

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.