

BISHOP-WINDHAM (Ø7R) 3 NE UTC-6(-5DT) N27°36.61' W97°45.15'**BROWNSVILLE**
L-20H, 21A

55 B NOTAM FILE SJT

RWY 15-33: H3200X50 (ASPH) S-12.5 MIRL**RWY 15:** Road.**RWY 33:** Road.**SERVICE:** LGT Rwy 15-33 MIRLS OTS indefly.**AIRPORT REMARKS:** Unattended. Intensive mil jet tfc 1300 ft AGL and abv from Kingsville NAS (NQ) 7 NM SW. Ctc Kingsville apch 119.9 for instrns.**AIRPORT MANAGER:** 361-584-2567**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Houston ARTCC at 281-230-5622.**RADIO AIDS TO NAVIGATION:** NOTAM FILE CRP.**CORPUS CHRISTI (VH) (H) VORTACW** 115.5 CRP Chan 102

N27°54.23' W97°26.69' 214° 24.0 NM to fld. 60/9E.

TACAN AZIMUTH & DME unusable:

024°-036° byd 35 NM blo 1,700'

037°-023° byd 35 NM blo 2,000'

265°-275°

VOR unusable:

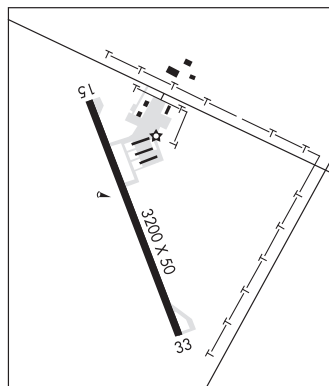
340°-005° byd 40 NM blo 7,000'

340°-005° byd 84 NM

Byd 30 NM blo 1,500'

TACAN AZIMUTH unusable:

080°-085° byd 30 NM

**BOERNE STAGE AIRFIELD** (See SAN ANTONIO on page 427)**BOLIVAR****BAR V K** (T38) P 1 N UTC-6(-5DT) N33°22.58' W97°14.61'**DALLAS-FT WORTH**

765 NOTAM FILE FTW

RWY 18-36: 2900X100 (TURF) LIRL**RWY 18:** Thld dsplcd 200'. Road.**RWY 36:** Thld dsplcd 200'. Trees.**SERVICE:** LGT ACTVT LIRL Rwy 18-36—122.825.**AIRPORT REMARKS:** Unattended. Arpt clsd at ngt to non-residents. Wildlife on and invof rwy. Glider actvt on and invof arpt.

PAEW on rwy. Grass mower will clear rwy aft low apch. No fuel or otr svcs avbl. Do not mistake north end 1400 ft long turf twy as rwy. Rwy soft when wet, call for ficons. Cell twr midfield inside downwind for Rwy 36. Ditch on both sides of rwy mid field outside of rwy lgts.

AIRPORT MANAGER: 940-453-5256**COMMUNICATIONS:** CTAF 122.85**CLEARANCE DELIVERY PHONE:** For CD ctc Lone Star Apch at 972-615-2799.**BONHAM****JONES FLD** (FØØ) 2 N UTC-6(-5DT) N33°36.79' W96°10.76'**DALLAS-FT WORTH**
L-17D, A
IAP

618 B NOTAM FILE FTW

RWY 17-35: H4000X75 (ASPH) S-12.5 MIRL**RWY 17:** PAPI(P2L)—GA 3.0° TCH 37'. Trees.**RWY 35:** PAPI(P2L)—GA 3.0° TCH 37'. Antenna.**SERVICE:** S4 FUEL 100LL, JET A+ LGT MIRL Rwy 17 and 35 SS-SR preset low; to ACTVT or incr instnt—CTAF. PAPI Rwy 17 and PAPI Rwy 35 opr consly.**AIRPORT REMARKS:** Unattended. For arpt attendant call 903-583-7555

Mon-Fri 1400-2300Z†. Aft hrs call Bonham Police Dept.

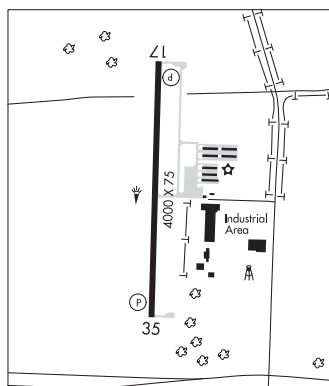
903-583-2141. 100LL self-serv. Jet A full serv. Call

903-227-5199. Extensive aerial AG ops Apr-Aug. Otr times irreg. For

airframe repairs call 903-640-0233 or 903-583-5119.

AIRPORT MANAGER: 903-583-8623**WEATHER DATA SOURCES:** AWOS-3PT 118.05 (903) 583-2082.**COMMUNICATIONS:** CTAF/UNICOM 122.8

® FORT WORTH CENTER APP/DEP CON 124.875

CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE FTW.

BONHAM (VH) (H) VORTACW 114.6 BYP Chan 93 N33°32.25' W96°14.05' 025° 5.3 NM to fld. 700/6E.

COMM/NAV/WEATHER REMARKS: UNICOM unmonitored.

BORGES

HUTCHINSON CO (BGD)(KBGD) 2 N UTC-6(-5DT) N35°42.05' W101°23.62'

3055 B NOTAM FILE BGD

RWY 17-35: H6299X100 (ASPH) S-60, D-100 MIRL 0.9% up S

RWY 17: PAPI(P4L)—GA 3.0° TCH 58'. Pole.

RWY 35: PAPI(P4R)—GA 3.0° TCH 41'. Trees.

RWY 03-21: H3897X100 (ASPH) S-60, D-100 MIRL 0.5% up SW

SERVICE: FUEL 100LL, JET A+ LGT ACTVT PAPI Rwy 17 and 35;
MIRL Rwy 03-21 and 17-35—CTAF.

AIRPORT REMARKS: Attended 1400-0000Z†. Rwy 21, 100' drop-off, 95' dstc. Rwy 3, 40' drop-off, 150' dstc.

AIRPORT MANAGER: 806-273-0137

WEATHER DATA SOURCES: ASOS 118.325 (806) 274-7318.

COMMUNICATIONS: CTAF/UNICOM 123.0

① AMARILLO APP/DEP CON 119.5 (1200-0600Z‡)

① ALBUQUERQUE CENTER APP/DEP CON 127.85 (0600-1200Z‡)

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at
505-856-4861.

RADIO AIDS TO NAVIGATION: NOTAM FILE BGD.

BORGES (L) TACAN Chan 23 BGD (108.6) N35°48.42'

W101°22.93' 174° 6.4 NM to fld. 3130/11E.

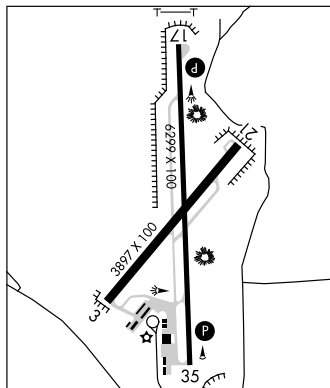
TACAN AZIMUTH unusable:

220°-320° byd 10 NM blo 12,000'

DALLAS-FT WORTH

H-6G, L-15B

IAP



BORGES N35°48.42' W101°22.93' NOTAM FILE BGD.

(L) TACAN 108.6 BGD Chan 23 174° 6.4 NM to Hutchinson Co. 3130/11E.

TACAN AZIMUTH unusable:

220°-320° byd 10 NM blo 12,000'

DALLAS-FT WORTH

H-6G, L-15B

BOURLAND FLD (See FORT WORTH on page 327)

BOWIE MUNI (ØF2) 4 NE UTC-6(-5DT) N33°36.10' W97°46.53'

1101 B NOTAM FILE FTW

RWY 17-35: H3603X60 (ASPH) S-12.5 MIRL 0.5% up N

RWY 17: PAPI(P2L)—GA 3.0° TCH 35'. Pole.

RWY 35: PAPI(P2L)—GA 3.0° TCH 40'. Trees.

SERVICE: FUEL 100LL, JET A LGT Dusk-dawn. ACTVT PAPI Rwy 17
and 35; MIRL 17-35—CTAF.AIRPORT REMARKS: Attended Mon-Fri 1330-2230Z†. For arpt attendant
after hrs call 940-841-4156. Deer on and in/ov arpt. Crop dusting
Jan-Apr. 100LL and Jet A 24 hr self-serve. Rwy 35 has 30 ft drop-off
190 ft dstc, both sides. Rwy 17-35 pymt lip 1.5 inches abv grade.

AIRPORT MANAGER: 940-841-4156

WEATHER DATA SOURCES: AWOS-3PT 118.75 (940) 872-2366.

COMMUNICATIONS: CTAF/UNICOM 122.8

① FORT WORTH CENTER APP/DEP CON 127.95

CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at
817-858-7584.

RADIO AIDS TO NAVIGATION: NOTAM FILE FTW.

(H) (H) VORTACW 117.15 UKW Chan 118(Y) N33°32.15'

W97°49.28' 024° 4.6 NM to fld. 1102/6E.

DALLAS-FT WORTH

L-17C, A

IAP

