

HATTERAS**BILLY MITCHELL** (HSE)(KHSE) 4 E UTC-5(-4DT) N35°13.97' W75°37.07'

CHARLOTTE

16 NOTAM FILE HSE

L-35C

RWY 07-25: H3002X75 (ASPH) S-30

IAP

RWY 07: Brush.**RWY 25:** Tree.

AIRPORT REMARKS: Unattended. Arpt CLOSED 30 min after SS until 30 min before SR. All ngt time ops prohibited. Flocks of seagulls on and in/ov arpt. High speed low-level mil ops in/ov arpt. Arpt located in Cape Hatteras National Seashore. Maintain 2000' vertical and horizontal distance from seashore beaches. Additional acft parking avbl on mid-field apron. Rwy 07-25 safety area is loose sand and dunes—not suitable for acft. +10-35' sand dunes and scrub trees both of rwy within ROFA.

AIRPORT MANAGER: 252-475-9000**WEATHER DATA SOURCES:** ASOS 118.375 (252) 552-1005.**COMMUNICATIONS:** CTAF 122.9**HATTERAS RCO** 122.3 (RALEIGH RADIO)Ⓡ **CHERRY POINT APP/DEP CON** 119.75**CLEARANCE DELIVERY PHONE:** For CD ctc Cherry Point Apch at 252-466-5960.**RADIO AIDS TO NAVIGATION:** NOTAM FILE ECG.**ELIZABETH CITY (VL) (DH) VORW/DME** 115.75 ECG Chan 104(Y)

N36°15.45' W76°10.54' 163° 67.2 NM to fld. 7/7W.

DME unusable:

250°-280° byd 30 NM blo 8,000'

VOR unusable:

045°-244° byd 40 NM

245°-255° byd 40 NM blo 7,000'

245°-255° byd 60 NM

256°-025° byd 40 NM

WRIGHT BROTHERS (T) (T) VORW/DME 111.6 RBX Chan 53 N35°55.23' W75°41.82' 183° 41.4 NM to fld.

10/8W. NOTAM FILE MQI. VOR/DME unmonitored 2300-1300Z†.

VOR unusable:

281°-318° blo 8,000'

319 blo 4,000'

320°-280°

CHERRY POINT (L) TACAN Chan 75 NKT (112.8) N34°54.14' W76°52.49' 081° 65.0 NM to fld.

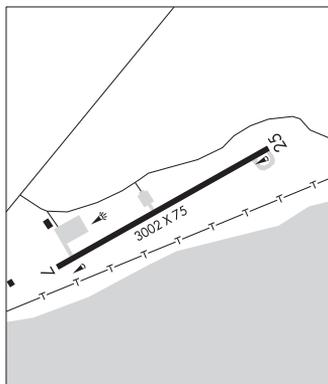
25/9W. NOTAM FILE RDU.

TACAN AZIMUTH unusable:

052°-060° byd 10 NM blo 3,000'

061°-089° byd 6 NM blo 5,000'

090°-109° byd 10 NM blo 3,000'

**HATTERAS** N35°14.01' W75°37.06'

CHARLOTTE

RCO 122.3 (RALEIGH RADIO)

L-35C

HENDERSON/OXFORD (See OXFORD on page 344)**HENDERSONVILLE** (ØA7) 2 E UTC-5(-4DT) N35°18.46' W82°25.99'

ATLANTA

2084 NOTAM FILE RDU

L-25C

RWY 15-33: H3075X40 (ASPH) S-10 RWY LGTS(NSTD)**RWY 15:** Thld dsplcd 270'. Trees.**RWY 33:** Thld dsplcd 325'. Trees.**SERVICE:** S4 LGT ACTVT LIRL Rwy 15-33—CTAF. OTS indefly. Rwy 15-33 no end or dsplcd thld lgts; lgts 50 ft from rwy edge south side and 11 ft from rwy edge north side. OTS indefly daylight opr only.

AIRPORT REMARKS: Attended 1330-2230Z†. For svc after hrs call 828-693-1897. Acft parked 40 ft from edge of Rwy 33. Nmrs obstns in apch and prim sfc. Hngr 90 ft left of Rwy 33. Lndg tfc use ctn when winds grt than 10 kts. Rwy 15 and Rwy 33, nrs and rwy mrkgs smaller than std. Rwy 15 and Rwy 33, rwy nrs vsb but cntrln nonexistent. North side of rwy has 60 ft trees 80 ft from cntrln.

AIRPORT MANAGER: 828-693-1897**COMMUNICATIONS:** CTAF/UNICOM 123.0**CLEARANCE DELIVERY PHONE:** For CD ctc Asheville Apch at 828-684-7259. When Asheville Apch clsd, for CD ctc Atlanta ARTCC at 770-210-7692.**RADIO AIDS TO NAVIGATION:** NOTAM FILE RDU.**SUGARLOAF MOUNTAIN (L) (L) VORTACW** 112.2 SUG Chan 59 N35°24.39' W82°16.12' 236° 10.0 NM to fld. 3970/2W.