

**MANTEO****DARE CO RGNL** (MQI)(KMQI) 1 NW UTC-5(-4DT) N35°55.14' W75°41.73'CHARLOTTE  
L-35D  
IAP, AD

13 B NOTAM FILE MQI

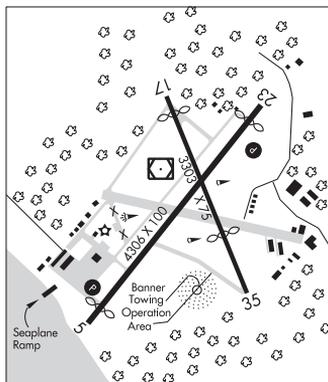
**RWY 05-23:** H4306X100 (ASPH) S-48 MIRL**RWY 05:** REIL. PAPI(P4L)—GA 3.0° TCH 30'. Thld dsplcd 305'.**RWY 23:** REIL. PAPI(P4L)—GA 4.0° TCH 32'. Thld dsplcd 301'. Bldg.**RWY 17-35:** H3303X75 (ASPH) S-20 MIRL**RWY 17:** Thld dsplcd 290'. Trees.**RWY 35:** Thld dsplcd 989'. Trees.**SERVICE:** S4 **FUEL** 100LL, JET A1+ **LGT** PAPI Rwy 05 and 23 opr consly, SS-SR—CTAF. ACTVT REIL Rwy 05, 23; MIRL Rwy 05-23 and 17-35—CTAF.**AIRPORT REMARKS:** Attended 1300-0000Z†. Unatndd Christmas Day. For svc aft hrs call 252-216-7028 or 252-216-8407. Migratory waterfowl Oct-Feb. 100LL avbl aft hrs self svc with credit card. Banner towing ops 200' W of Rwy 05. Twy F clsd permly. Rwy 05 15' dropoff 40' from thr. Seaplane ramp near apron.**AIRPORT MANAGER:** 252-475-5571**WEATHER DATA SOURCES:** AWOS-3 128.275 (252) 473-2826.**COMMUNICATIONS:** CTAF/UNICOM 122.8Ⓡ **CHERRY POINT APP/DEP CON** 124.725**CLEARANCE DELIVERY PHONE:** For CD ctc Cherry Point Apch at 252-466-5960, or when Apch clsd ctc Washington ARTCC at 703-771-3587.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MQI.**WRIGHT BROTHERS (T) (T) VOR/DME** 111.6 RBX Chan 53 N35°55.23' W75°41.82' at fld. 10/8W. VOR/DME unmonitored 2300-1300Z†.

VOR unusable:

281°-318° blo 8,000'

319 blo 4,000'

320°-280°

**MANTEO NDB (MHW)** 370 MQI N35°54.92' W75°41.70' at fld. 7/9W. NDB unmonitored 2300-1300Z†. SHUTDOWN.**MANTEO** N35°54.92' W75°41.70' NOTAM FILE MQI.**NDB (MHW)** 370 MQI at Dare Co Rgnl. 7/9W. NDB unmonitored 2300-1300Z†. SHUTDOWN.CHARLOTTE  
L-35D**MARION****SHIFLET FLD** (9A9) 3 N UTC-5(-4DT) N35°43.24' W82°00.59'

ATLANTA

1212 B NOTAM FILE RDU

**RWY 10-28:** 3340X180 (TURF) LIRL**RWY 10:** Trees.**RWY 28:** Trees.**SERVICE:** **LGT** Rotating bcn lgt RDO-CTL for based acft only. Arpt lgt RDO-CTL for based acft only.**AIRPORT REMARKS:** Unattended. Arpt CLOSED at ngt to in-transit t/c. Deer on and invof arpt. Rwy 10 has private drive crossing in front of thr. Rwy subj to flooding after very heavy rains on east end. Hangars are spaced closer than normal, slower taxi speeds rqr'd.**AIRPORT MANAGER:** 828-803-4019**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Atlanta ARTCC at 770-210-7692.**MARTIN CO** (See WILLIAMSTON on page 372)**MAXTN** N34°43.99' W79°26.62' NOTAM FILE RDU.**NDB (MHW/LOM)** 257 ME 055° 5.2 NM to Laurinburg/Maxton. 198/8W.CHARLOTTE  
L-35A, 36E