

LINCOLNTON

LINCOLN CO RGNL (IPJ)(KIPJ) 5 E UTC-5(-4DT) N35°28.99' W81°09.69'

CHARLOTTE

H-9B, 126, L-25D

IAP

878 B NOTAM FILE IPJ

RWY 05-23: H5700X100 (ASPH) S-30, D-60 MIRL 0.3% UP SW

RWY 05: REIL. PAPI(P2L)—GA 3.4° TCH 64'. Thld dsplcd 200'. Trees.

RWY 23: REIL. PAPI(P2L)—GA 3.0° TCH 47'. Thld dsplcd 199'. Trees.

SERVICE: S4 FUEL 100LL, JET A1+ 0X2, 4 LGT To ACTVT REIL Rwy

05 & 23 dusk-dawn—CTAF; to ACTVT PAPI Rwy 05 & 23—CTAF.

MIRL Rwy 05-23 dusk to 0300Z± preset low intst; to incr intst dusk to 0300Z± and to ACTVT MIRL Rwy 05-23 between 0300Z±-dawn—CTAF.

AIRPORT REMARKS: Attended Apr-Oct 1300-0000Z±, Nov-Mar 1300-2200Z±. Unattended Thanksgiving and Christmas Day. Deer, coyote and birds on and invof arpt. Rwy 23 has a 90 ft drop-off 100 ft fm pvmt end and 90 ft drop-off first 200 ft 160 ft both sides of cntrn. 200 ft swy SW end has been remarked as 200 ft dsplcd thr for Rwy 05.

AIRPORT MANAGER: 704-764-1100

WEATHER DATA SOURCES: AWOS-3 119.675 (704) 735-6954.

COMMUNICATIONS: CTAF/UNICOM 123.05

® CHARLOTTE APP/DEP CON 134.75 CLNC DEL 124.9

GCO 124.9 (CHARLOTTE APCH) (Key mike 4 times slowly, wait for dial tone and ring)

CLEARANCE DELIVERY PHONE: For CD if una via GCO ctc Charlotte Apch at 704-359-0241.

RADIO AIDS TO NAVIGATION: NOTAM FILE CLT.

CHARLOTTE (L) (L) VORW/DME 115.0 CLT Chan 97 N35°11.42' W80°57.11' 335° 20.3 NM to fld. 732/5W.

DME portion unusable:

015°-050° byd 25 NM blo 3,000'

050°-100° byd 25 NM blo 2,500'

185°-202° byd 15 NM

203°-220°


270°-350° byd 20 NM blo 5,000'

VOR/DME controlled by Charlotte ATCT

VOR unusable:

203°-220°

ILS/DME 111.15 I-IPJ Chan 48(Y) Rwy 23. Class IB.

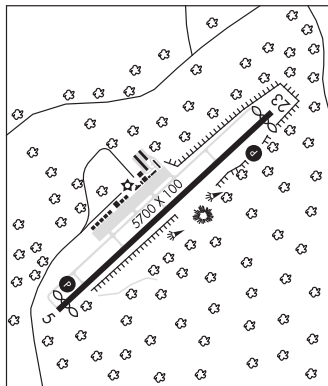

LONE HICKORY (See YADKINVILLE on page 385)

LOUISBURG

TRIANGLE NORTH EXEC (LHZ)(KLHZ) 5 SW UTC-5(-4DT) N36°01.40' W78°19.82'

CHARLOTTE

H-9C, 12H, L-35B, 36G

IAP

368 B NOTAM FILE LHZ

RWY 05-23: H5498X100 (ASPH-GRVD) S-63, D-91

PCR 240 F/C/X/T HIRL 0.7% up SW

RWY 05: MALSR. PAPI(P4L)—GA 3.0° TCH 42'. Trees. Rgt tfc.

RWY 23: REIL. PAPI(P4L)—GA 3.0° TCH 49'. Trees.

SERVICE: S4 FUEL 100LL, JET A1+ 0X3, 4 LGT ACTVT MALSR

Rwy 05; REIL Rwy 23; HIRL Rwy 05-23—CTAF. PAPI Rwy 05 and

23 oper consly. PCL hrs of oper 0200-1100Z±.

AIRPORT REMARKS: Attended 1300-2300Z±. Arpt unattended

Thanksgiving, Christmas and New Year Day. Birds on and invof arpt.

Hel fit tng dly prmrly on W side of arpt and twy. Arpt phone

919-496-1234; make prior arngmts drg FBO hrs for svcs aft hrs.

AIRPORT MANAGER: 919-496-1234

WEATHER DATA SOURCES: AWOS-3 118.325 (919) 497-0810.

COMMUNICATIONS: CTAF/UNICOM 123.0

® RALEIGH APP/DEP CON 125.3

CLEARANCE DELIVERY PHONE: For CD ctc Raleigh Apch at 919-380-3144.

RADIO AIDS TO NAVIGATION: NOTAM FILE RDU.

RALEIGH/DURHAM (H) (H) VORTACW 117.2 RDU Chan 119

N35°52.35' W78°47.00' 077° 23.9 NM to fld. 429/9W.

ILS/DME 109.35 I-LHZ Chan 30(Y) Rwy 05. Class IA. ILS

mnt at fbo. Glideslope autopilot cpd apch NA blw 600' MSL.

