

ROCKY MOUNT/WILSON RGNL (RWI)(KRWI) 7 SW UTC-5(-4DT)

N35°51.38' W77°53.52'

CHARLOTTE

158 B ARFF Index—See Remarks NOTAM FILE RWI

H-9C, 12H, L-35B, 36G

RWY 04-22: H7099X150 (ASPH-GRVD) S-101, D-162

IAP

PCR 600 F/A/W/T HIRL

RWY 04: MALSR. PAPI(P4L)—GA 3.0° TCH 41'. Trees.**RWY 22:** REIL. PAPI(P4L)—GA 3.0° TCH 42'. Trees.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 04:** TORA-7100 TODA-7100 ASDA-7100 LDA-7100**RWY 22:** TORA-7100 TODA-7100 ASDA-6900 LDA-6900**SERVICE:** S4 FUEL 100LL, JET A 0X1 LGT PAPI Rwy 04 and 22 opr consly. ACTVT MALSR Rwy 04; REIL Rwy 22; HIRL Rwy 04-22—CTAF.**AIRPORT REMARKS:** Attended Mon-Fri 1300-0000Z†, Sat-Sun 1300-2300Z†. Class IV, ARFF Index A. Clsd to ACR opns with more than 30 psgr seats excp 24 hr PPR call amgr 252-446-7057.**AIRPORT MANAGER:** 252-446-3189**WEATHER DATA SOURCES:** ASOS 118.875 (252) 446-0732.**COMMUNICATIONS:** CTAF/UNICOM 123.05® **WASHINGTON CENTER APP/DEP CON** 123.85**CLEARANCE DELIVERY PHONE:** For CD ctc Washington ARTCC at 703-771-3587.**AIRSPACE:** CLASS E svc 1300-2300Z†; other times CLASS G.**RADIO AIDS TO NAVIGATION:** NOTAM FILE RDU.**TAR RIVER (VL) (H) VORTAC** 117.8 TYI Chan 125 N35°58.60' W77°42.22' 237° 11.7 NM to fld. 73/5W.

VOR unusable:

048°-052° byd 40NM blo 6,000'

186°-189° byd 40 NM blo 6,000'

298°-318° byd 40 NM blo 6,000'

TAC AZ unusable:

008°-018° byd 27 NM

120°-127° byd 33 NM

284°-289°

DME unusable:

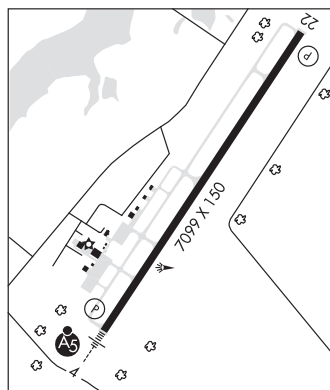
008°-018° byd 27 NM

120°-127° byd 33 NM

209°-215° byd 30 NM

287°-292° byd 38 NM

339°-347° byd 30 NM

ILS/DME 108.3 I-RWI Chan 20 Rwy 04. Class IA. ILS mnt lctn accc.**ROVDY** N35°43.99' W80°29.37' NOTAM FILE RUQ.

CHARLOTTE

NDB (LOWW) 275 RU 202° 5.4 NM to Mid-Carolina Rgnl. 700/6W.

L-25D, 36G

ROXBORO**RALEIGH RGNL AT PERSON CO** (TDF)(KTDF) 6 S UTC-5(-4DT)

N36°17.08' W78°59.08'

WASHINGTON

609 B NOTAM FILE TDF

H-9C, 12H, L-26J, 36G

RWY 06-24: H6005X100 (ASPH) S-45, D-68 MIRL

IAP

RWY 06: MALSR. PAPI(P4L)—GA 3.0° TCH 41'. Thld dspcd 303'.**RWY 24:** REIL. PAPI(P2L)—GA 3.0° TCH 44'. Trees.**SERVICE:** FUEL 100LL, JET A1+ LGT REIL Rwy 24; MIRL Rwy 06-24 opr SS-SR; to ACTVT otr times and ACTVT MALSR Rwy 06; PAPI Rwy 06 & 24—CTAF.**AIRPORT REMARKS:** Attended 1400-2200Z†. Arpt unatndd Thanksgiving and Christmas. For svc aft hrs call 615-351-9845. Deer and birds on and invof arpt. No line of sight btn rwy ends. Conc helipad, adj and NE of main apron, unlgtd, VFR only.**AIRPORT MANAGER:** 336-364-1111**WEATHER DATA SOURCES:** AWOS-3 126.725 (336) 364-1651.**COMMUNICATIONS:** CTAF/UNICOM 122.7® **RALEIGH APP/DEP CON** 132.35**GCO** 119.7 (RALEIGH APCH)**CLEARANCE DELIVERY PHONE:** For CD if una via GCO ctc Raleigh Apch at 919-380-3144.**RADIO AIDS TO NAVIGATION:** NOTAM FILE DBA.**SOUTH BOSTON (L) (L) VORTACW** 110.4 SCV Chan 41 N36°40.50' W79°00.87' 181° 23.4 NM to fld. 520/5W.**ILS/DME** 108.7 I-TDF Chan 24 Rwy 06. Class IB. ILS/DME unmonitored.