

SPARTANBURG DOWNTOWN MEML/SIMPSON FLD (SPA)(KSPA) 3 SW UTC-5(-4DT)

CHARLOTTE

H-9B, 12G, L-24J, 25C

IAP

N34°54.98' W81°57.35'

802 B TPA—See Remarks NOTAM FILE SPA

RWY 05-23: H5852X100 (ASPH) S-9S, D-131 PCN 37 F/C/X/T
HIRL**RWY 05:** MALSR. PAPI(P4R)—GA 3.0° TCH 45'. Tree.**RWY 23:** REIL. PAPI(P4L)—GA 3.0° TCH 46'.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 05:** TORA-5852 TODA-5852 ASDA-5852 LDA-5852**RWY 23:** TORA-5852 TODA-5852 ASDA-5452 LDA-5452**SERVICE:** S4 FUEL 100LL, JET A LGT ACTVT MALSR Rwy 05; REILRwy 23; PAPI Rwy 05 and 23; HIRL Rwy 05-23 and rotating
bcn—CTAF.**AIRPORT REMARKS:** Attended 1200-0000Z†. For fuel after hrs call
864-574-8552. Glider ops. TPA-800' AGL for piston acft,
1300' AGL for turboprop acft and small jets.**AIRPORT MANAGER:** (864) 580-5004**WEATHER DATA SOURCES:** AWOS-3 133.925 (864) 587-2529.**COMMUNICATIONS:** CTAF/UNICOM 123.0

RCO 122.1R 115.7T (ANDERSON RADIO)

® **GREER APP/DEP CON** 119.4 (1100-0445Z†) **CLNC DEL** 120.55**ATLANTA CENTER APP/DEP CON** 135.35 (0445-1100Z†)**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Greer

Apch at 864-877-8275, when Apch clsd ctc Atlanta ARTCC at 770-210-7692.

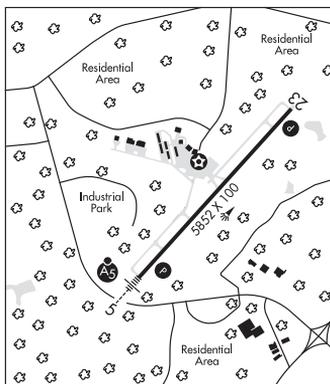
AIRSPACE: CLASS E svc 1100-2300Z†; other times CLASS G.**RADIO AIDS TO NAVIGATION:** NOTAM FILE SPA.(H) (H) **VORTAC** 115.7 SPA Chan 104 N35°02.02' W81°55.62' 193° 7.2 NM to fld. 935/2W.

VOR unusable:

270°-359° byd 7 NM blo 3,000'

Byd 28 NM blo 7,000'

Byd 9 NM blo 6,000'

ILS/DME 109.1 I-SPA Chan 28 Rwy 05. Class IA.**SUMMERVILLE** (DYB)(KDYB) 5 NW UTC-5(-4DT) N33°03.74' W80°16.86'

CHARLOTTE

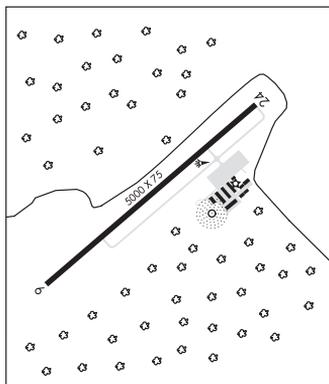
H-9B, 12G, L-24J

IAP

56 B NOTAM FILE AND

RWY 06-24: H5000X75 (ASPH) S-19.5, D-31 PCN 7 F/C/X/T MIRL
0.3% up NE**RWY 06:** Trees. Rgt tfc.**RWY 24:** Tree.**SERVICE:** S4 FUEL 100LL, JET A LGT MIRL Rwy 06-24 opr

dusk-0300Z†, after 0300Z† ACTVT—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1300-2300Z†, Sat-Sun
1330-2200Z†. For FBO call 843-806-1180. Banner towing 1500'
and blo intermittently daily, southside Rwy 06-24. Mowing ops on
Weds near actv rwys/twys during growing season. Visit
Dorchestercountysc.gov/government/administrative-services/airport for
airfield sts and other arpt info.**AIRPORT MANAGER:** 843-867-3927**WEATHER DATA SOURCES:** AWOS-3 119.575 (843) 821-8403.**COMMUNICATIONS:** CTAF/UNICOM 123.0® **CHARLESTON APP/DEP CON** 120.7**CLEARANCE DELIVERY PHONE:** For CD ctc Charleston Apch at 843-414-2832.

CONTINUED ON NEXT PAGE

CONTINUED ON NEXT PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE CHS.

CHARLESTON (VH) (H) VORTAC 113.5 CHS Chan 82 N32°53.66' W80°02.27' 314° 15.9 NM to fld. 39/5W.

VOR unusable:

070°–106° byd 40 NM

106°–116°

116°–146° byd 40 NM

248°–272° byd 40 NM blo 8,000'

TACAN AZIMUTH unusable:

109°–120° byd 25 NM

137°–147°

160°–170°

229°–262° byd 12 NM blo 5,000'

262°–272° byd 15 NM blo 5,000'

DORCHESTER COUNTY NDB (MHW) 365 DYB N33°03.69' W80°16.63' at fld. 49/7W. NOTAM FILE AND.

COMM/NAV/WEATHER REMARKS: For maint and rpr FBO call 843–851–0970.

SUMTER (SMS)(KSMS) 4 N UTC–5(–4DT) N33°59.70' W80°21.68'

182 B NOTAM FILE AND

RWY 05–23: H5501X100 (ASPH) S–31.5, D–42.5 PCN 12 F/D/Y/T

MIRL

RWY 05: REIL. PAPI(P4L)—GA 3.0° TCH 46'. Trees. Rgt tfc.

RWY 23: ODALS. REIL. PAPI(P4L)—GA 3.0° TCH 45'. Trees.

RWY 14–32: 3081X120 (TURF)

RWY 14: Trees.

RWY 32: Tree. Rgt tfc.

SERVICE: S4 FUEL 100LL, JET A LGT After 0100Z†, ACTVT REILS
Rwy 05–23; MIRL Rwy 05–23—CTAF. PAPI Rwy 05 and Rwy 23 opr
continuously.

AIRPORT REMARKS: Attended 1300–2300Z†. For 100LL aft 2200Z† call
803–469–4639. Wildlife on and invof arpt with incr act dusk and
dawn.

AIRPORT MANAGER: 803-469-4639

WEATHER DATA SOURCES: AWOS–3 118.075 (803) 469–6750.

COMMUNICATIONS: CTAF/UNICOM 122.7

® **SHAW APP/DEP CON** 125.4 (1100–0300Z† Mon–Fri, 1300–2100Z†
Sat–Sun, clsd fed hol, and ACC Family days)

® **JACKSONVILLE CENTER APP/DEP CON** 124.7 (0300–1100Z†)

CLEARANCE DELIVERY PHONE: For CD ctc Shaw Apch at 803-895-4884,
when Apch clsd ctc Jacksonville ARTCC at 904-845-1592.

RADIO AIDS TO NAVIGATION: NOTAM FILE CAE.

COLUMBIA (VH) (H) VORTAC 114.7 CAE Chan 94 N33°51.44' W81°03.23' 078° 35.5 NM to fld. 404/2W.

VOR unusable:

000°–073° byd 35 NM blo 6,000'

200°–234° byd 12 NM blo 3,000'

235°–245° byd 12 NM blo 6,000'

246°–289° byd 12 NM blo 3,000'

290°–305° byd 12 NM blo 2,400'

306°–344° byd 30 NM

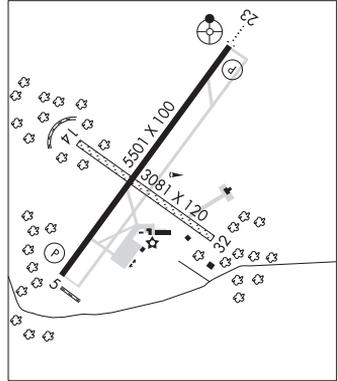
345°–359° byd 10 NM blo 5,000'

ILS/DME 109.35 I–SMS Chan 30(Y) Rwy 23. Glideslope unusable byd 6° right of course.

CHARLOTTE

H–9B, 12G, L–24I

IAP

**TIMMONSVILLE**

HUGGINS MEML (58J) 1 NE UTC–5(–4DT) N34°08.13' W79°55.28'

143 B NOTAM FILE AND

RWY 14–32: 3090X150 (TURF) LIRL

RWY 14: Bldg.

RWY 32: Trees.

SERVICE: LGT ACTVT LIRL Rwy 14–32 and rotating bcn—CTAF.

AIRPORT REMARKS: Unattended. Parachute Jumping. Rwy 14–32 standing water after heavy rain.

AIRPORT MANAGER: (843) 229-7515

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Florence Apch at 843-665-0632, when Apch clsd ctc Jacksonville ARTCC at
904-845-1592.

CHARLOTTE