

DEMING MUNI (DMN)(KDMN) 2 SE UTC-7(-6DT) N32°15.74' W107°43.14'

ALBUQUERQUE

4314 B NOTAM FILE DMN MON Airport

H-4K, L-6E

RWY 08-26: H8018X75 (ASPH) S-20 PCN 9 F/D/X/T MIRL

RWY 08: PAPI(P4L)—GA 3.0° TCH 43'. Brush. 0.3% down.

RWY 26: PAPI(P4L)—GA 3.0° TCH 40'. 0.3% up.

RWY 04-22: H5675X60 (ASPH) S-12 PCN 7 F/D/X/T MIRL

RWY 04: PAPI(P2L)—GA 3.0° TCH 44'. Brush.

RWY 22: PAPI(P2L)—GA 3.0° TCH 44'. Brush.

SERVICE: **FUEL** 100LL, JET A1+ **LGT** ACTVT PAPI Rwy 04, 08, 22, 26; MIRL Rwy 08-26—CTAF. 0030-0530Z† PAPI Rwy 04, 08, 22, 26; MIRL Rwy 08-26 preset low intst; incr intst—CTAF.

AIRPORT REMARKS: Attended 1400-0100Z†. Aft hr call 575-494-2311. Intersection tkof NA. Helicopters arr and dep East; remain North of segmented circle.

AIRPORT MANAGER: 575-546-8848

WEATHER DATA SOURCES: ASOS 118.525 (575) 544-4347.

COMMUNICATIONS: CTAF/UNICOM 122.8

RCO 122.2 (ALBUQUERQUE RADIO)

④ **ALBUQUERQUE CENTER APP/DEP CON** 128.2

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc

Albuquerque ARTCC at 505-856-4561.

AIRSPACE: CLASS E svc 1500-2300Z†; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE DMN.

(VL) (H) **VORTACW** 108.6 DMN Chan 23 N32°16.53' W107°36.33' 250° 5.8 NM to fld. 4210/12E.

VOR unusable:

155°-195° byd 15 NM

TACAN AZIMUTH unusable:

155°-195° byd 15 NM

DME unusable:

155°-195° byd 15 NM

COLUMBUS (VL) (L) VORW/DME 111.2 CUS Chan 49 N31°49.15' W107°34.47' 333° 27.5 NM to fld. 4008/12E. NOTAM FILE ABQ. VOR/DME unmonitored.

VOR unusable:

013°-016° byd 40 NM

036°-037° byd 40 NM

052°-086° byd 40 NM

227°-259° byd 40 NM

260°-270° byd 40 NM blo 9,000'


260°-270° byd 54 NM

271°-281° byd 40 NM blo 10,000'

271°-281° byd 51 NM

282°-345° byd 40 NM

335°-342° byd 30 NM blo 10,500'

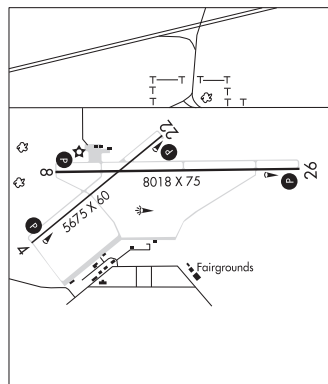

DONA ANA CO INTL JETPORT (See SANTA TERESA on page 462)

DOUBLE EAGLE II (See ALBUQUERQUE on page 429)

DUDLE N35°13.04' W106°42.77' NOTAM FILE AEG.

ALBUQUERQUE

NDB (LOMW) 351 AE 212° 5.9 NM to Double Eagle II. 5455/11E.