

MANTI

SANPETE CO RGNL (41U) 4 NE UTC-7(-6DT) N39°19.89' W111°36.76'

LAS VEGAS
H-3D, L-9C
IAP

5516 B NOTAM FILE CDC

RWY 03-21: H5021X75 (ASPH-GRVD) S-24 MIRL 0.8% up NE

RWY 03: REIL. PAPI(P2L)—GA 3.0° TCH 40'.

RWY 21: REIL. PAPI(P2L)—GA 3.0° TCH 40'. P-line.

SERVICE: S2 **FUEL** 100LL, JET A **LGT** ACTVT REIL Rwy 03 and 21;

PAPI Rwy 03 and 21; MIRL Rwy 03-21—CTAF.

AIRPORT REMARKS: Unattended. 100LL and Jet A 24 hr, self serve.

AIRPORT MANAGER: 435-421-4908

WEATHER DATA SOURCES: AWOS-3PT 120.025 (435) 283-4624.

COMMUNICATIONS: CTAF/UNICOM 122.8

® **SALT LAKE CENTER APP/DEP CON** 133.6

CLEARANCE DELIVERY PHONE: For CD ctc Salt Lake ARTCC at

801-320-2568.

RADIO AIDS TO NAVIGATION: NOTAM FILE HVE.

HANKSVILLE (VH) (H) VORTACW 115.9 HVE Chan 106 N38°25.01'

W110°41.98' 307° 69.5 NM to fld. 4431/15E.

VOR unusable:

015°-025° byd 40 NM blo 18,000'

026°-065° byd 40 NM

030°-060° byd 25 NM blo 7,500'

160°-180° byd 15 NM blo 9,500'

160°-190° byd 40 NM

215°-220° byd 40 NM

221°-231° byd 40 NM blo 18,000'

232°-248° byd 40 NM

249°-259° byd 40 NM blo 16,000'

249°-259° byd 74 NM

260°-014° byd 40 NM

TACAN AZIMUTH unusable:


030°-060° byd 25 NM blo 7,500'

160°-180° byd 15 NM blo 9,500'

DME unusable:

030°-060° byd 25 NM blo 7,500'

160°-180° byd 15 NM blo 9,500'

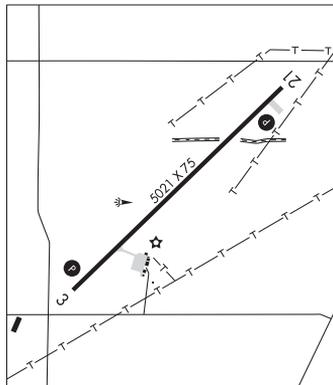

MICHAEL AAF (DUGWAY PROVING GROUND) (DPG)(KDPG) A 9 W UTC-7(-6DT) N40°11.84'

SALT LAKE CITY
H-3D, L-9C, 11C
DIAP, AD

W112°56.10'

4350 B TPA—See Remarks NOTAM FILE CDC Not insp.

RWY 12-30: H10999X150 (ASPH-GRVD) PCN 73 R/B/W/T HIRL

RWY 12: PAPI(P4L)—GA 3.0° TCH 88'. Thld dspcd 1000'.

RWY 30: PAPI(P4L)—GA 3.0° TCH 85'. Thld dspcd 1000'.

ARRESTING GEAR/SYSTEM

RWY 12 HOOK E5 (965 FT)

SERVICE: **LGT** ACTIVATE PAPI RWY 12 and RWY 30; HIRL RWY 12-30; TWY LGTS—CTAF. Rwy 12-30 NW first 5000' HIRL OTS indef. **MILITARY**— **JASU** 1(A/M32A-86) 1(A/M32A-60) **FUEL** A+ +. Aircard rqr comms. **OIL** O-156 **TRAN ALERT** Opr 1400-0030Z‡ Mon-Thu expc hol.

MILITARY REMARKS: Attended Mon-Thu 1400-2400Z‡, clsd Fri-Sun and hol. See FLIP AP/1 Supplementary Arprt Information. Twy B clsd to manned acct B1 to B2 1300-2300Z Mon-Thur. **RSTD** 24 hr PPR for Idg and fuel; ctc Base OPS DSN 789-5322, C435-831-5322. All USAF, ANG, and AFRES AMC acct consult ASRR for this location. **CAUTION** Ldg short of Rwy 30 is a significant haz. The E-5 barrier protrudes several inches abv the gnd. Acft ctc with the barrier short of the rwy thld can cause damage to the barrier and substantial damage to the acft. Potential for wild animals to cross rwy and foreign object damage haz dur high wind cond. Bird activity monitored on req. Limited ARFF capability for manned acct, call BASE OPS for information. **TFC PAT** TPA—Fixed wing 6000(1650), Rotary wing 5000(650).

AIRPORT MANAGER: 435-831-5322

COMMUNICATIONS: CTAF 126.2 270.3

RANGE CON 36.1 126.2 270.0 **CLOVER CON SOUTH** 134.1 363.5 **FIRE STATION** 126.2R

CLEARANCE DELIVERY PHONE: For CD ctc clover ctl at 801-777-7575 or VHF 134.1.

RADIO AIDS TO NAVIGATION: NOTAM FILE DPG.

(T) **TACAN** Chan 79 MIJ (113.2) N40°11.50' W112°55.34' at fld. 4348/13E.

No NOTAM MP: 1300-1500Z‡ Mon

MIJ TACAN not mntd but checked weekly